

PHASE I ENVIRONMENTAL SITE ASSESSMENT

Hubbard Power and Light 1600 5th Avenue Bay Shore, New York

Remedial Action Contract 2 (RAC 2)

U.S. Environmental Protection Agency Region II

Contract EP-W-11-043

Prepared by:

EES JV

a Joint Venture between Sullivan International Group, Inc. and Nobis Engineering, Inc.

February 2014

Revision 0



Phase I Environmental Site Assessment

Hubbard Power and Light 1600 5th Avenue Bay Shore, New York EPA Work Assignment No. 001-SION-0200

Remedial Action Contract 2 No. EP-W-11-043

For: US Environmental Protection Agency Region 2

By: EES JV

a Joint Venture between Sullivan International Group, Inc. and Nobis Engineering, Inc.

Project No. 84001

February 2014

Stepher Vetere, PE, LSP, LEP Senior Project Manager

Adam N. Roy, CHMM Project Scientist



TABLE OF CONTENTS PHASE I ENVIRONMENTAL SITE ASSESSMENT $1600\ 5^{\text{TH}}\ \text{AVENUE}$ BAY SHORE, NEW YORK

<u>SECTIO</u>	<u>N</u>	<u>PAGE</u>
1.0	EXECUTIVE SUMMARY	1
2.0	INTRODUCTION	3 4 4 4
3.0	SITE DESCRIPTION	6 6 6 er 7
4.0	USER-PROVIDED INFORMATION 4.1 Title Records	
5.0	RECORDS REVIEW 5.1 Standard Environmental Record Sources 5.1.1 Federal and State Regulatory Agencies 5.1.2 Suffolk County and Town of Islip Municipal Records 5.2 Physical Setting Sources 5.3 Historical Use Information on the Site 5.3.1 Topographic Maps 5.3.2 Sanborn Maps 5.3.3 Aerial Photographs 5.3.4 City Directories 5.3.5 Date of Development	10 10 15 16 16 17 17
6.0	SITE RECONNAISSANCE 6.1 Methodology and Limiting Conditions 6.2 General Site Setting	18



TABLE OF CONTENTS (cont.) PHASE I ENVIRONMENTAL SITE ASSESSMENT 1600 5TH AVENUE BAY SHORE, NEW YORK

<u>SECTION</u>			PAGE	
	6.3 6.4	Exterior Observations		
7.0	INTER\	/IEWS	20	
	7.1	Interview with Owner	20	
	7.2	Interview with Site Manager	20	
	7.3	Interviews with Occupants		
	7.4	Interviews with Local Government Officials	20	
	7.5	Interviews with Others	20	
8.0	FINDINGS		21	
9.0	OPINION		23	
10.0	CONCL	USIONS AND RECOMMENDATIONS	24	
	10.1	Conclusions	24	
	10.2	Recommendations	24	
11.0	DEVIA	TIONS	25	
12.0	ADDITI	ONAL SERVICES	26	
13.0	REFER	ENCES	27	
	13.1	Sources Consulted		
	13.2	Agencies Consulted		
14.0	QUALII	FICATIONS OF ENVIRONMENTAL PROFESSIONALS	28	

FIGURES

- 1 Locus Plan
- 2 Site Sketch

APPENDICES

- A Limitations
- B User Questionnaire
- C Site Photographs
- D Assessor's Office Records
- E EDR Radius Report
- F Historic Topographic Maps, Sanborn Maps, and Aerial Photos
- G Phase I Site Assessment Checklist

ii

1.0 EXECUTIVE SUMMARY

Engineering and Environmental Solutions JV (EES) has completed a Phase I Environmental Site Assessment (ESA) for the approximate 1.8-acre property located at 1600 5th Avenue in Bay Shore, New York 11706 (subject property). A summary of property ownership and institutional and engineering control information is provided in the table below.

Site Name/Owner	Hubbard Power and Light/Hubbard Power and Light
Address	1600 5 th Avenue, Bay Shore, NY11706
Parcel ID	0500-22400-0100-080002
Institutional or Engineering Controls In Place	No
Institutional or Engineering Controls Needed	To be determined during Phase II Investigations

The subject property is located in a commercial area of Bay Shore and is occupied by an approximate 7,700-square foot building that was formerly used as a power generation station. The subject property is currently abandoned.

As part of this ESA, state and federal environmental records were reviewed in the form of an environmental database report provided by Environmental Data Resource (EDR), Inc. The subject property was identified in several database and municipal records that were reviewed.

Based on review of the documentation available for the preparation of this Phase I ESA and the observations made on the property, it is the opinion of the Environmental Professionals who prepared this assessment that recognized environmental conditions (RECs) do exist on the subject property. These RECS are outlined below.

In June 1995, Suffolk County Department of Health Services (SCDHS) personnel
collected soil, sludge, and leachate samples from various locations throughout the subject
property. Laboratory analysis of samples detected concentrations of metals in sludge and
leachate. Concentrations of metals and volatile organic compounds (VOCs) were detected
in the soil samples.

- The subject property was included in the New York Spills list. The spills recorded at the subject property included reports of oil and diesel discharged into sewers; water, oil, and other chemicals pumped into a storm sewer; and leaking drums releasing possible waste oil and spent solvents.
- Several abandoned drums were observed at the site by EES during a site reconnaissance.
 The drums were observed to be in poor condition with visible holes present in many of the drums.
- Based on the review of historical records, there is a suspect lagoon located in the southwest corner of the subject property.
- Available information indicates that the groundwater at the Hubbard Sand & Gravel property (an adjoining property to the north) has been contaminated with high concentrations of VOCs. The contamination is reportedly from an unknown source located upgradient of Hubbard Sand & Gravel facility. Because the subject property was historically part of the Hubbard Sand & Gravel property, there is a potential for groundwater at the subject property to be impacted by the Hubbard Sand & Gravel Property.

In accordance with ASTM Practice E 1527-05 requirements, the Environmental Professionals that prepared this Phase I ESA provide the following Statement of Conclusion:

We have performed a Phase I ESA in conformance with the scope and limitations of ASTM Practice E1527 of 1600 5th Avenue in Bay Shore, New York, the subject property. Any exceptions to, or deletions from, this practice are described in Sections 2.4 and 11.0 of this report. This assessment has revealed evidence of historic or current *recognized environmental conditions* in connection with the property.

2.0 INTRODUCTION

The following sections document the purpose of the ESA and provide a detailed scope of services; significant assumptions; limitations and exceptions; special terms and conditions; user reliance; and user obligations.

2.1 Purpose

The objective of this Phase I ESA was to assess environmental conditions at the subject property and vicinity for RECs associated with the presence of petroleum products (PP) or hazardous material (HM) in conformance with ASTM E 1527-05, "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process". RECs are defined in ASTM Standard Practice E 1527-05 as:

The presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substances or petroleum products into structures on the property or into the ground, ground water, or surface water of the property.

2.2 Detailed Scope of Services

To meet the objectives of the Phase I, EES performed the following tasks:

- Review of New York State Department of Environmental Conservation (NYSDEC) and United States Environmental Protection Agency (USEPA) regulatory database listings concerning environmental conditions at and in the vicinity of the subject property, as provided by Environmental Data Resources, Inc. (EDR).
- Contacting officials of the Town of Islip and Suffolk County, New York to obtain information
 pertaining to present and historical environmental conditions at the subject property and
 adjacent environs.
- Review of available history of ownership and land usage records, and interviewing of persons with knowledge of the subject property to obtain past usage information.

- Review of available aerial photographs and topographic maps to aid in assessing local hydrogeology and in assessing past and present land use at the subject property and vicinity.
- Visiting the subject property on January 6, 2014 to assess surficial and general environmental conditions at the property and adjacent environs for evidence of RECs associated with past or present PP or HM waste handling or storage activities.
- Preparing this report summarizing the results of the assessment.

2.3 Significant Assumptions

It is assumed that federal, state, and local records are generally complete and current. The preparer assumes that all individuals contacted and/or interviewed during the preparation of this Phase I ESA have responded in good faith. EES is entitled to rely on all information gathered during this scope of work.

2.4 Limitations and Exceptions

Limitations associated with this assessment are noted in Appendix A.

2.5 Special Terms and Conditions

No special terms or conditions apply to this project.

2.6 User Reliance

User reliance is subject to the requirements of 40 CFR Part 312, ASTM E 1527-05, as noted herein.

2.7 User Obligations

As defined in ASTM E 1527-05, the user responsibilities, as applicable, are as follows:

- Identifying the scope of work.
- Deciding whether to use prior assessments.

- Checking title records for environmental liens and activity and use restrictions.
- Disclosing specialized knowledge and experience.
- Explaining why the purchase price is below market value, if it is discounted.
- Answering interview questions in good faith.
- Providing information as outlined in Section 6 of ASTM E 1527-05, including completing the User Questionnaire attached in Appendix B.

For the purpose of this ESA, the "user" is defined as Mr. Tom Kelly, Commercial Development Director, Suffolk County. Mr. Kelly provided responses to the User Questionnaire, which was used to generate the information required under Section 4.0.

3.0 SITE DESCRIPTION

The following section describes the site location; previous environmental investigations performed at the Site; general characteristics of the Site and immediate vicinity; current use of the Site; descriptions of structures, roads, and other improvements to the Site; and current use of adjoining properties.

3.1 Location and Legal Description

The subject property consists of an approximately 1.8-acre parcel located at 1600 5th Avenue in Bay Shore, New York. A Locus Plan is provided as Figure 1, and a Site Sketch depicting details of the developed portion of the subject property is included as Figure 2. Photographs taken during the inspection are provided in Appendix C.

The Town of Islip identifies the property as parcel number 0500-22400-0100-080002. City records indicate that Hubbard Power and Light is the current legal owner of the property. A summary of property ownership information available was not available from the Islip Assessors office. However, available documents indicate that the prior to power plant construction, the property was part of the Hubbard Sand and Gravel property. A copy of the Islip Assessor's office Assessor's Roll is included in Appendix D.

3.2 Previous Environmental Investigation

In June 1995, SCDHS personnel collected soil, sludge, and leachate samples from several locations throughout the subject property. Sample results reported detections of metals in sludge and leachate. Concentrations of metals and volatile organic compounds (VOCs) were detected in soil samples. SCHDS personnel conducted groundwater sampling in August and September of 2002. Concentrations of metals and VOCs were detected in the groundwater samples.

3.3 Site and Vicinity General Characteristics

The subject property is located in an industrial-zoned area of Bay Shore. Properties zoned for business and residential are located to the east of the subject property. The topography at the subject property slopes slightly downward from northwest to south-southeast. Based on maps provided in the EDR report (Appendix E), the subject property is located outside the 500-year

flood zone. Specific groundwater flow direction at the subject property could not be determined from the available records reviewed by EES. However, available records for nearby properties indicate that groundwater flow in the area is generally toward the southeast. Therefore, for the purpose of this Phase I ESA, groundwater at the subject property is inferred to flow toward the southeast.

3.4 Current Use of the Site, Descriptions of Structures, Roads, and Other Improvements on the Site

The subject property is occupied by an abandoned two-story building that was previously used as a power plant. Equipment (cooling towers, conveyor belts, pumps, etc.) formerly used by the power plant has been abandoned at the site. The building's total floor space is approximately 7,700 square feet. The building exterior is primarily constructed of concrete blocks and sheet metal. There is an approximate 1,200-square foot open-ended storage building located to the west of the main building. This structure was reportedly used to store wood chips but is currently the location of several abandoned drums.

3.5 Current Use of Adjoining Properties

The property is bordered to the north by Hubbard Sand & Gravel; to the south by K.P. Edwards (mason supplies, ready mix concrete, and precast concrete products); to the east by a commercial building used by a tire service center and communication and music center; and to the west by Hubbard Sand & Gravel.

4.0 USER-PROVIDED INFORMATION

The following sections summarize the information provided to EES by Mr. Thomas Kelly, Commercial Development Director for the Suffolk County Department of Economic Development and Planning. A copy of the user questionnaire is included in Appendix B.

4.1 Title Records

The user does not intend to retain a title company or title professional to review reasonable ascertainable title and judicial records for environmental liens or activity and use limitations (AULs).

4.2 Environmental Liens or Activity and Use Restrictions

The user is not aware of any environmental cleanup liens against the property that are filed or recorded under federal, tribal, state, or local law. The user is not aware of any AULs that are in place at the site and/or that have been filed or recorded in a registry under federal, tribal, state, or local law.

4.3 Specialized Knowledge

The user does not have any specialized knowledge or experience related to the property or nearby properties.

4.4 Commonly Known or Reasonably Ascertainable Information

The user is aware that water-softening chemicals and petroleum products, including motor oil and Number 2 fuel oil, are or once were present at the property. The user is aware that chlorinated compounds and heavy metals have been detected in groundwater samples at the subject property. Semi-volatile compounds and pesticides have been detected in surface soil samples collected from the subject property.

4.5 Valuation Reduction for Environmental Issues

This property was identified by the Suffolk County Inter-Agency task force as a potentially contaminated property and has been in tax arrears since 2006. The Suffolk County Land Bank is

considering this property for potential revitalization. Since the property is in tax arrears, a valuation reduction for environmental issues will not be necessary.

4.6 Owner, Property Manager, and Occupant Information

Mr. Kelly informed EES that the property was formerly used by Hubbard Power and Light to produce electricity. The property is currently owned by Hubbard Power and Light. The subject property has been abandoned.

4.7 Reason for Performing Phase I

This property was identified by the Suffolk County Inter-Agency Task Force as a potentially contaminated property and has been in tax arrears since 2006. The Suffolk County Land Bank is considering this property for potential revitalization. Based on the usage of the property and visual inspections, Suffolk County, by way of its Inter-Agency Task Force, has determined that the property may have contamination, and as such, is not inclined to take action on the property until an environmental assessment is made.

4.8 Other

The user does not know of any obvious indicators (other than the results of SCDHS inspections and reported spills) that point to the presence or likely presence of contamination at the property.

5.0 RECORDS REVIEW

The following sections document the information gathered during review of available environmental records, physical setting sources, and historical site use information.

5.1 Standard Environmental Record Sources

As part of this ESA, state and federal environmental records were reviewed in the form of an environmental database report provided by EDR. A copy of the database report is included as Appendix E. Information was also obtained from other local municipal and state records. The following is a summary of significant findings from this review.

5.1.1 Federal and State Regulatory Agencies

EPA National Priority List (NPL). The EPA's NPL is a list of confirmed or proposed Superfund facilities. The subject property was not identified as an NPL facility. No NPL facilities were identified within a ±1.0 mile radius of the subject property.

Comprehensive Environmental Response, Compensation, and Liability Information System (CERCLIS). The CERCLIS database is the EPA's database of current and potential Superfund sites currently or previously under investigation. The subject property was not identified as a CERCLIS facility. The database report identified two CERCLIS facilities within a ±0.5 mile radius of the subject property: the Servall Laundry Site (8 Drayton Avenue, 0.086 mile northeast) and Rite-Off, Inc. (1545 5th Industrial Court, 0.225 mile southwest). However, both CERCLIS facilities are located in an inferred downgradient location relative to the subject property; therefore, releases from these properties are unlikely to impact subsurface soil and groundwater conditions at the subject property.

Comprehensive Environmental Response, Compensation, and Liability Information System Archived Sites (CERCLIS-NFRAP). The CERCLIS-NFRAP database is a database of archived CERCLIS facilities at which, to the best of the EPA's knowledge, assessment has been completed and the EPA has determined that no further steps will be taken to list this site on the NPL. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site. The subject property was not identified in the CERCLIS-NFRAP database.

However, the database identified one CERCLIS-NFRAP facility (Hubbard Sand & Gravel) located 0.110 mile northeast of the subject property. Available information indicates that the groundwater at the Hubbard Sand & Gravel property has been contaminated with high concentrations of volatile organic compounds (VOCs). The contamination is reportedly from an unknown source located upgradient of Hubbard Sand & Gravel facility. Because the subject property was reportedly part of the Hubbard Sand and Gravel property, there is a potential for groundwater at the subject property to be impacted by Hubbard Sand & Gravel Property. No other CERCLIS-NFRAP facilities were identified within a ±0.5-mile radius of the subject property.

Emergency Response Notification System (ERNS) Releases. The ERNS database is the EPA's database of emergency response actions. The subject property was not identified in the ERNS database. No properties adjacent to the subject property were identified as ERNS sites.

Resource Conservation and Recovery Act (RCRA) Handlers. The RCRA database is the EPA's database of registered hazardous waste generators and Treatment, Storage or Disposal (TSD) facilities. The subject property and abutting properties were not identified as TSD or corrective action (CORRACTS) facilities. The database report did not identify any RCRA (TSD) facilities within a ±0.5-mile radius of the subject property, nor any RCRA (CORRACTS) facilities within a ±1.0-mile radius of the subject property.

The database identified three RCRA generator facilities located within a 0.25-mile radius of the subject property, which are summarized below:

Property Name	Generator Status	Distance from Subject Property	Direction from Subject Property
USA Industries	Large Quantity	0.141 miles	South
TJ Signs Unlimited	Small Quantity	0.027 miles	East-Northeast
Finish Line Technologies	Small Quantity	0.225 miles	South-Southwest

Based on the nature and location of the RCRA handlers identified within the specified search radii, none of them is expected to have adverse impacts on the subject property.

Federal Institutional Control / Engineering Control Sites. The Federal Institutional Control/ Engineering Control (IC/EC) registry is the EPA's database of Superfund or RCRA sites that have either institutional or engineering controls in place as part of the remedial action to achieve or maintain protection of human health and the environment. No Federal IC/EC sites were identified within a ±0.25-mile radius of the subject property.

New York State and Tribal Institutional Control / Engineering Control Sites. The New York IC / EC database is a NYSDEC database which contains information on sites with activity and use limitations (AULs) where remedial action relies on the restriction of site activities and uses to achieve or maintain protection of human health and the environment. No New York State IC / EC sites were identified within a ±0.25-mile radius of the subject property.

NYSDEC and Tribal Hazardous Waste Site Inventory (SHWS) Sites. The SHWS Sites database is a database of confirmed disposal sites; locations to be investigated, waived, or deleted; and reserved sites. The subject property was not identified in the EDR database report as a SHWS site. Eight SHWS sites were identified within ±1.0-mile radius of the subject property. Four SHWS sites were identified in close proximity (approximately 0.125 mile or less) to the subject property. One adjoining property (K.P. Edwards Materials) was identified as a SHWS site. The K.P. Edwards Materials site was included as part of a 2009 site characterization study on the Americana Laundromat site. It was determined that the K.P. Edwards Material site was located upgradient of the Americana Laundromat site and that concentrations of VOCs had diminished to non-detectable levels. Therefore, it is unlikely that soil and groundwater at the subject property will be impacted from the K.P. Edwards Materials site.

The Hubbard Sand & Gravel site (located 0.110 mile northeast) was also identified as a SHWS site. Available information indicates that the groundwater at the Hubbard Sand & Gravel property has been contaminated with high concentrations of volatile organic compounds (VOCs). The contamination is reportedly from an unknown source located upgradient of the Hubbard Sand & Gravel facility. Because the subject property was reportedly once part of the Hubbard Sand & Gravel property, there is a potential for groundwater at the subject property to be impacted by groundwater contamination on the Hubbard Sand & Gravel property.

Based on the distance or downgradient setting relative to the subject property, it is unlikely that releases from the other SHWS sites would have affected soil or groundwater conditions at the subject property.

New York State and Tribal Active Solid Waste Facilities / Landfill Sites (SWF/LF). The State/Tribal SWF/LF database is a listing of municipally operated solid waste facilities, including landfills, compost facilities, transfer stations, incinerators, and material recovery facilities. The subject property was not identified as a current or former SWF/LF site. Ten SWF/LF sites were identified within a ±0.5-mile radius of the subject property.

The Hubbard Sand & Gravel site was identified as a SWF/LF site under the operational names of Northeast Recycling Corp. and Hubbard Enterprises. Northeast Recycling is an active recycling facility that processes asphalt, brick, concrete rock, clean soil, and wood (brush, branches, trees, and stumps). Hubbard Enterprises reportedly took in construction and demolition debris for disposal. Based on the described operational use of the SWF/LF facilities identified in the database report, activities at the SWF/LF sites are not expected to affect soil or groundwater conditions at the subject property.

New York Spills. This list includes data collected on spills reported to New York State Department of Environmental Conservation (NYSDEC). The subject property was included in the New York Spills list. The spills recorded at the subject property are summarized below.

- December 23, 1994 Spill Number 9412773: An employee notified the NYSDEC that
 when service was performed on machines, oil and diesel were dumped in the rear of the
 building into sewers. The spill record has been closed and no other information is
 available.
- January 1, 1995 Spill Number 94134426: A citizen notified the NYSDEC that water is
 released into trenches and the trenches continually collect spillage of oil and other
 chemicals; these fluids are subsequently pumped into a storm sewer. The spill record has
 been closed and no other information is available.
- June 9, 2004 Spill Number 0402576: A SCHDS employee reported drums on the west side of the property. The drums were leaking (weeping) possible waste oil and spent solvents. The spill record has been closed and no other information is available.

The database report identified four other spill sites within a ±0.125-mile radius of the subject property. Based on their distance relative to the subject property, the four other spill sites should not impact subsurface soil or groundwater at the subject property.

New York State and Tribal Leaking Storage Tank Incident Reports (LTANKS). The LTANKS list is a database of sites where leaking underground and aboveground storage tanks have been identified/reported and it is maintained by the NYSDEC. Neither the subject property nor adjoining properties were identified as an LTANKS site in the database report. The database identified eight LTANKS sites within a ±0.5-mile radius of the site, summarized below:

Property Name	Distance from Subject Property	Direction from Subject Property
Town Cesspool Co.	0.250 mile	North
Advanced Engineering Products	0.331 mile	North
Drexel Drive Assoc.	0.152 mile	North
Natures Value	0.340 mile	North
BP Amoco	0.445 mile	North
DNS Associates	0.460 mile	North
Rite Off Aerosal	0.225 mile	South-Southwest
Guido Residence	0.302 mile	East-Northeast

All of the LTANKS sites identified in the database report have been closed; therefore, releases from these LTANKS sites would not be expected to impact soil or groundwater at the subject property.

New York State and Tribal Underground Storage Tank (UST), Aboveground Storage Tank (AST), and Chemical Bulk Storage (CBS) List. The UST/AST list is a database of registered underground and aboveground storage tanks maintained by the NYSDEC's Petroleum Bulk Storage (PBS) Database. The subject property was not identified as a UST or AST facility. The database identified three UST facilities and five AST facilities within a ±0.25-mile radius of the subject property. However, none of the adjoining properties was identified as a UST/AST facility.

The CBS list is a database of facilities storing hazardous substances listed in 6 NYCRR Part 597 in aboveground tanks with capacities of 185 gallons or greater and/or in underground tanks of any size. The subject property was not identified as a CBS facility. The database identified two

CBS ASTs within a ±0.25-mile radius of the subject property. Both of the CBS AST sites are located in an inferred downgradient setting relative to the subject site. Therefore, releases from these facilities are not expected to impact subsurface soil and groundwater at the subject property.

State and Tribal Brownfields Sites/Local Brownfields Sites. The Brownfields and US Brownfields Sites database assists EPA in collecting, tracking, and updating information, as well as reporting on the major activities and accomplishments of the various Brownfield grant programs. The database did not identify any Brownfields sites within a ±0.5-mile radius of the subject property.

5.1.2 Suffolk County and Town of Islip Municipal Records

EES reviewed records available from the Suffolk County Department of Health Services (SCDHS) Town of Islip Assessor's Office, Building Department, Department of Planning Development, and Fire Marshall's Office. A summary of available records is provided below.

Suffolk County Department of Health Services. Available records reviewed at the SCDHS office indicate that subject property was developed circa 1989 for use as a power-generating station. The site operators took in wood waste to use as fuel for steam-generating boilers that powered a 3-megawatt steam-driven turbine to produce electricity that was sold to Long Island Lighting Company. Available records indicate that as many as four drywells were constructed at the subject property. The drywells reportedly received cooling tower and boiler blowdown water. SCHDS records indicate that nine fires occurred at the property from 1993 through 1995.

In June 1995, SCDHS personnel collected soil, sludge, and leachate samples from several locations throughout the subject property. Sample results reported detections of metals in sludge and leachate. Metals and VOCs were detected in soil samples. It is unclear how long the power plant was in operation; however, SCDHS inspection reports indicate that the subject property had been abandoned as early as 2001. At that time, several abandoned drums were noted on the southern side of the property. SCHDS personnel conducted groundwater sampling in August and September 2002. Concentrations of metals and VOCs were detected in the groundwater samples. Available records also indicate that a possible lagoon is located in the southwestern corner of the subject property. It is unknown what materials were discharged to the lagoon.

Assessor's Office. Available records reviewed at the Town of Islip Assessors office indicate that Hubbard Power and Light, Inc. is the current owner of the subject property. The subject property is identified as tax map number 0500-22400-0100-080002.

Building Department. Available records at the building department contained a December 28, 1988 permit application for construction of a new co-generation power plant.

Department of Planning and Development. There were no records listed for the subject property.

Fire Marshal's Office. There were no records listed for the subject property.

5.2 Physical Setting Sources

The subject property is located at 40°45'20.56" N and 73°15'46.80" W. The site is located at approximately 68 feet above sea level.

5.3 Historical Use Information on the Site

Available information indicates that the subject property was formerly used as power-generating station. The power plant operated for a period of less than 10 years. The subject property has been abandoned since at least 2001. The subject property is currently not in use.

5.3.1 Topographic Maps

EES reviewed historical topographic maps provided by EDR dated 1903, 1904, 1942, 1943, 1954, 1967, 1969, and 1979. The maps dated 1903, 1904, and 1942 show the subject property and surrounding area as mostly undeveloped. The maps dated 1943, 1954, and 1967 show the site and surrounding area as mostly undeveloped, with the area to the north of the subject property shown as a sand and gravel pit. The map dated 1969 does not show the subject property. The map dated 1979 shows the subject property and surrounding area slightly more developed than previous years' maps. Copies of topographic maps are included in Appendix F.

5.3.2 Sanborn Maps

EDR did not provide EES with any Sanborn Maps, as the subject property is an unmapped property in the Sanborn Library.

5.3.3 Aerial Photographs

EES reviewed aerial photos provided by EDR dated 1953, 1957, 1966, 1969, 1976, 1980, 1994, 2006, 2008, 2009, and 2011. The subject property building appears in the aerial photos provided by EDR starting in 1994. Prior to 1994, the subject property and surrounding area appears to be part of a large sand and gravel operation. Copies of the aerial photos are included in Appendix F.

5.3.4 City Directories

EES reviewed city directories provided by EDR dated 1973, 1978, 1983, 1983, 1993, 1999, 2003, 2008, and 2013. The results of the city directory review are summarized below.

- The subject property was not identified in the 1973, 1978, or 1983 directories.
- The subject property was identified in the 1993 directory as "Hubbard Power & Light."
- The subject property was not identified in the 1999, 2003, 2008, and 2013 directories.

Copies of the city directories are included in Appendix F.

5.3.5 Date of Development

Available records indicate the property was developed circa 1989 and used as an electrical power plant for a period of approximately 10 years. The property is currently abandoned.

6.0 SITE RECONNAISSANCE

A site reconnaissance was performed by EES on January 6, 2014. Details of the site reconnaissance are provided in the following sections.

6.1 Methodology and Limiting Conditions

Mr. Adam Roy and Mr. Ayan Majmudar of EES visited the subject property on January 6, 2014 to observe general subject property conditions. Mr. Thomas Kelly (Commercial Development Director, Suffolk County Department of Economic Development and Planning) accompanied EES during the reconnaissance. General site features are shown on Figure 2. Site photographs are provided in Appendix C.

6.2 General Site Setting

The subject property is developed and generally industrial in nature. The property is bordered to the north by Hubbard Sand & Gravel; to the south by K.P. Edwards (mason supplies and readymix concrete); to the east by a commercial building used by a tire service center and communication and music center; and to the west by Hubbard Sand & Gravel.

6.3 Exterior Observations

EES exterior observations are provided below.

- Surficial observations in many areas were obscured by heavy vegetation.
- The areas to the north of the building were generally covered by asphalt pavement. EES
 did not observe any groundwater monitoring wells in any of the paved areas surrounding
 the subject property.
- EES observed several abandoned drums in the storage building. Most of the drums were observed to be in poor condition and many had visible rust holes. The contents (if any) of the drums are not known.

- EES observed two abandoned ASTs on the ground in the southern portion of the property and one AST near the north side of the building. The contents (if any) of the ASTs are not known.
- EES observed a suspect lagoon area in the southwestern corner of the subject property.
 The lagoon area appeared to have a concrete bottom. The concrete was observed to have numerous cracks and vegetation growing up through it.
- Several pieces of abandoned equipment (conveyor belts, pumps, electrical equipment)
 were observed throughout the subject property.
- Areas in the southeastern corner of the subject property appear to have been filled with asphalt, concrete, and scrap metal.
- Several miscellaneous containers (drums, carboys, etc.) were randomly distributed throughout the subject property.
- Two trailers were observed on the subject property.

6.4 Interior Observations

Access to the interior of the subject property building was not available on the day of the site visit.

7.0 INTERVIEWS

Interviews performed for preparation of this Phase I ESA are provided below.

7.1 Interview with Owner

A representative for the current site owner was not available during the preparation of this report.

7.2 Interview with Site Manager

The building at the subject property is currently abandoned; therefore, a site manager was not interviewed for preparation of this Phase I ESA.

7.3 Interviews with Occupants

The building at the subject property is currently abandoned; therefore, no occupants were interviewed for preparation of this Phase I ESA.

7.4 Interviews with Local Government Officials

The results of interviews and research at local government offices are discussed in section 5.1.2.

7.5 Interviews with Others

EES did not conduct interviews with other local government officials.

8.0 FINDINGS

Based on the information collected during this Phase I ESA of the property at 1600 5th Avenue in Bay Shore, New York, EES presents the following findings.

- The subject property is occupied by an abandoned two-story building that was previously used as power plant. Equipment (cooling towers, conveyor belts, pumps, etc.) formerly used by the power plant has been abandoned at the site. The building's total floor space is approximately 7,700 square feet. The building exterior is primarily constructed of concrete blocks and sheet metal. An approximate 1,200-square foot, open-ended storage building is present to the west of the main building. This structure was reportedly used to store wood chips and is currently occupied by several deteriorated drums.
- Available information indicates that the groundwater at the Hubbard Sand & Gravel
 property (adjoining property to the north) has been contaminated with high concentrations
 of VOCs. The contamination is reportedly from an unknown source located upgradient of
 Hubbard Sand & Gravel facility. Because the subject property was reportedly part of the
 Hubbard Sand & Gravel property, there is a potential for groundwater at the subject
 property to be impacted by Hubbard Sand & Gravel property.
- The subject property was included in the New York Spills list and three separate spills of PP/HM were recorded at the subject property. All three spill records have been closed and no other information is available.
- In June 1995, SCDHS personnel collected soil, sludge, and leachate samples from several locations throughout the subject property. Sample results reported detections of metals in sludge and leachate. Metals and VOCs were detected in soil samples. Several abandoned drums were noted on the southern side of the property. SCHDS personnel conducted groundwater sampling in August and September of 2002. Concentrations of metals and VOCs were detected in the groundwater samples.
- EES observed several abandoned drums in the open-ended storage building. Most of the drums were observed to be in poor condition and many had visible rust holes. The contents of the drums (if any) are not known.

- EES observed two abandoned ASTs on the ground in the southern portion of the property and one AST near north side of the building. The contents (if any) of the ASTs are not known.
- EES observed a suspect lagoon area in the southwestern corner of the subject property.
 The lagoon area appeared to have a concrete bottom. The concrete was observed to have numerous cracks and vegetation growing up through it.
- Areas in the southeastern corner of the subject property appear to have been filled with asphalt, concrete, and scrap metal.
- Access to the building was not available on the day of the site visit.

9.0 OPINION

Based on review of the documentation available for the preparation of this Phase I ESA and the observations made on the property, it is the opinion of the Environmental Professionals who prepared this assessment that RECs do exist on the subject property.

10.0 CONCLUSIONS AND RECOMMENDATIONS

Conclusions and recommendations for this Phase I ESA are presented in the sections that follow.

10.1 Conclusions

In accordance with ASTM Practice E 1527-05 requirements, the Environmental Professionals that prepared this Phase I ESA provide the following Statement of Conclusion:

We have performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527 of 1600 5th Avenue in Bay Shore, New York, the subject property. Any exceptions to, or deletions from, this practice are described in Sections 2.4 and 11.0 of this report. This assessment has revealed evidence of historic or current *recognized environmental conditions* in connection with the property.

10.2 Recommendations

Based on the RECs identified in this Phase I ESA, EES recommends a Phase II ESA be performed at the subject property. At a minimum, the Phase II ESA should include the collection of surface and subsurface soil samples, installation of new groundwater monitoring wells, and collection of groundwater samples. Soil and groundwater samples should be submitted to a certified laboratory for analysis of VOCs, semi-volatile organic compounds (SVOCs), metals, pesticides, and polychlorinated biphenyls (PCBs).

EES also recommends that a hazardous material inspection be performed on all of the buildings on the subject property. Building material (paint, caulking, window glazing, wall board, etc.) samples should be collected and analyzed for the presence of asbestos, lead, and PCBs, as necessary.

11.0 DEVIATIONS

Access to the interior of the building on the subject property was not available on the day of the site visit. Therefore, contents inside the subject property building (if any) are excluded from this Phase I ESA. This is not considered a "significant data gap" that affects the ability of the environmental professional to identify conditions indicative of releases or threats of release of hazardous materials at the subject property.

No other substantive deviations from ASTM E 1527-05 were encountered during performance of this Phase I ESA. Limitations of this Phase I ESA are discussed in Appendix A.

12.0 ADDITIONAL SERVICES

Additional Services including assessments, recommendations, or other details beyond the scope of ASTM Practice E 1527-05 were not performed.

13.0 REFERENCES

13.1 Sources Consulted

Environmental Data Resources, Inc. Environmental Database Report dated December 17, 2013 including:

- Sanborn Fire Insurance Map Report,
- Historic Topographic Maps, and
- Historic Aerial Photographs.

13.2 Agencies Consulted

Suffolk County Department of Health Services

Town of Islip Assessor's Office

Town of Islip Building Department

Town of Islip Department of Planning Development

Town of Islip Fire Marshall's Office

14.0 QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS

This section presents the qualifications of the Environmental Professionals that performed the assessment of the subject property. The following attestations are presented to satisfy the requirements of the All Appropriate Inquiries (AAI) Rule (40 CFR Part 312):

We declare that, to the best of our professional knowledge and belief, we meet the definition of Environmental Professional as defined in §312.10 of this part. We have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. We have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

A copy of the Checklist for Phase I Site Assessments Conducted using EPA Brownfields Assessment Grant Funds is provided in Appendix G of this report.

Adam N. Roy, CHMM

Project Scientist

Over 12 years of experience performing various investigations to identify the extent of airborne, soil, and groundwater organic and inorganic contamination at residential, commercial, and industrial sites. Researched historical federal, state, local, and commercial records to collect background information for numerous environmental projects.


Conducted or supervised numerous environmental investigation methods including a variety of drilling techniques, and the collection of air, soil, and groundwater samples using various EPA-approved techniques.

Performed numerous Phase I ESAs and other environmental projects involving research, investigation, and data assessment of historical and current site conditions on current or former residential, commercial, and industrial properties. Investigations have included identification, assessment, and delineation of petroleum and hazardous materials released to the environment or with the potential for release to the environment.

Stephen Vetere, PE, LSP, LEP Project Manager

Environmental Professional with over 14 years of experience providing a variety of environmental engineering services throughout the Northeast including site assessment, remediation, long-term monitoring, and five-year reviews.

Manages and performs site assessments, remedial investigations, and risk assessments, and develops remedial action plans. Designs and manages a variety of site remediation programs including contaminated soil excavation, groundwater recovery and treatment systems, *in situ* bioremediation systems, and enhanced natural attenuation remedial systems. Manages long-term monitoring programs at landfills and other closed facilities.

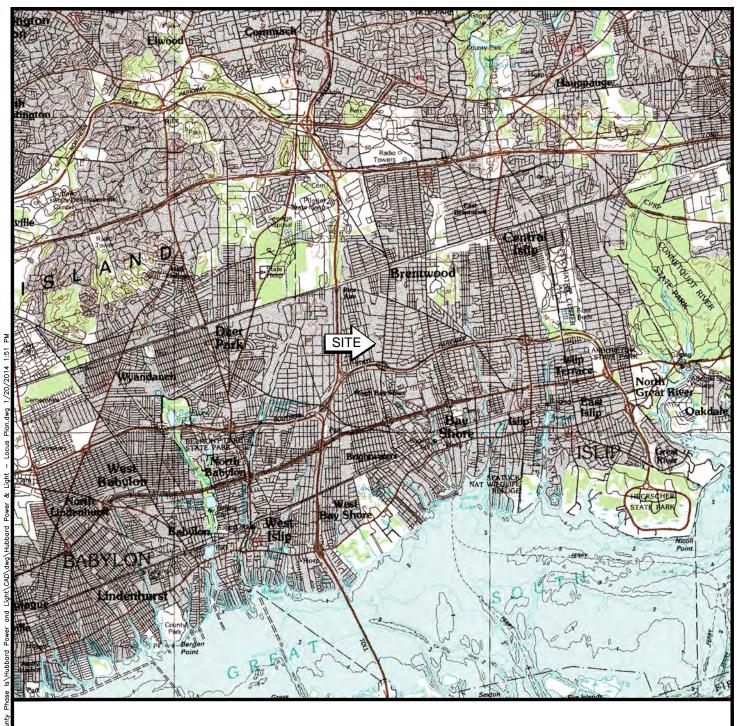



USGS TOPOGRAPHIC MAP

BAY SHORE, NEW YORK DECEMBER 2013 APPROXIMATE SCALE 1 INCH = 1,000 FEET





FIGURE 1


LOCUS PLAN

HUBBARD POWER & LIGHT 1600 5TH AVENUE BAY SHORE, NEW YORK 11706

PROJECT NO. 84001.01

DATE: JAN

JANUARY 2014

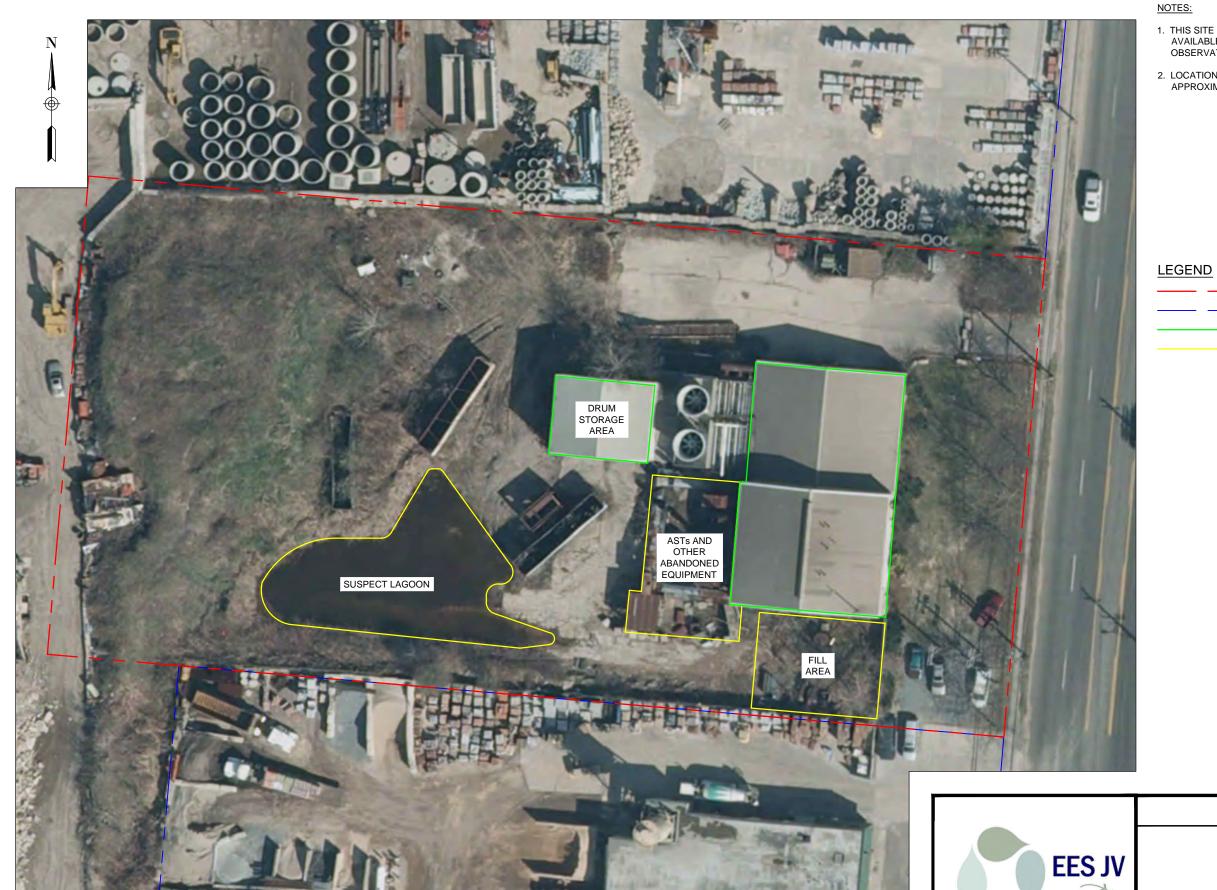

- 1. THIS SITE SKETCH WAS DEVELOPED FROM AN AERIAL PHOTO AVAILABLE FROM SUFFOLK COUNTY, NEW YORK GIS AND SITE OBSERVATIONS BY EES.
- 2. LOCATIONS AND SITE FEATURES DEPICTED HEREON ARE APPROXIMATE AND GIVEN FOR ILLUSTRATIVE PURPOSES ONLY.

SUBJECT PROPERTY BOUNDARY OTHER PROPERTY BOUNDARY BUILDING FOOTPRINT EXTERIOR OBSERVATION AREAS

GRAPHIC SCALE

FIGURE 2

SITE SKETCH

HUBBARD POWER & LIGHT 1600 5TH AVENUE BAY SHORE, NEW YORK 11706

APPROVED BY: AR DRAWN BY: PROJECT NO. 84001.02 DATE: JANUARY 2014

LIMITATIONS

- This Environmental Site Assessment was performed in accordance with generally accepted practices of other consultants undertaking similar assessments at the same time and in the same geographical area. The results of this assessment are based on our professional judgment and are not scientific certainties. Specifically, Engineering and Environmental Solutions JV does not and cannot represent that the site contains no hazardous wastes or other latent conditions beyond those observed during this preliminary assessment. No other warranty, express or implied, is made.
- 2) The observations and conclusions presented in this report were made solely on the basis of conditions described thereon and not on scientific tasks or procedures beyond the scope of described services or the budgetary and time constraints imposed by the client. The work described in this report was performed in general accordance with the terms and conditions described in Work Plan for Targeted Brownfields Assessments dated September 21, 2012. No other warranty, express or implied, is made.
- 3) Observations were made of the site as indicated in this report. Where access to portions of the site was unavailable or limited, Engineering and Environmental Solutions JV renders no opinion as to the presence of hazardous wastes or the presence of indirect evidence of hazardous wastes in those portions of the site.
- 4) No property boundary, site feature, or topographic surveys of the site were performed by Engineering and Environmental Solutions JV.
- 5) Our services did not include assessments for the presence of pesticides, herbicides, ureaformaldehyde foam insulation (UFFI), or lead in drinking water at the site. In addition, no air quality monitoring or chemical analyses of soil, surface water, or groundwater were performed as part of this assessment. The site was not assessed for compliance with the Clean Air Act. Our services did not include an assessment for typical non-friable asbestoscontaining materials such as floor tiles, exterior siding, and roofing materials.
- 6) The purpose of this screen was to preliminarily screen the physical characteristics of the subject site with respect to the presence of hazardous wastes in the environment within the context of ASTM E 1527-05, "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process". No attempt was made to check the compliance of present or past owners of the site with federal, state, or local laws.
- 7) This assessment has been prepared for the exclusive use of the U.S. Environmental Protection Agency solely for use in an environmental evaluation of the site. Reliance by others on the information and opinions contained herein is strictly prohibited without prior written consent of Engineering and Environmental Solutions JV.

Appendix A Limitations

ASTM E 1527-05 PHASE I ENVIRONMENTAL SITE ASSESSMENT

USER QUESTIONNAIRE

Section 1 - General

The information requested in this section is intended to assist the environmental professional but is not necessarily required to qualify for one of the Landowner Liability Protections (See Section 2).

(1.) Why is the Phase I Environmental Site Assessment required?

This property was identified by the Suffolk County Inter-Agency task force as a potentially contaminated property and has been in tax arrears since 1996. The Suffolk County Landbank is considering this property for potential revitalization.

(2.) What is the type of property and type of property transaction (sale, purchase, exchange, etc.)?

Property is 1.8 acre site, zoned Industrial; Property owned by Hubbard Power and Light.

Due to potential environmental concerns related to the property, neither Suffolk County, nor the Suffolk County Landbank have not taken any action in regards to the property.

(3.) What is the complete and correct address of the property?

1600 5th Ave, Bay Shore NY 11706

(4.) What is the scope of services desired for the Phase I?

As described in the contract / work scope Yes X No If No, please explain,

The services requested are to aid in the assessment of potential contamination on the property

Are any considerations beyond the requirements of Practice E 1527 to be addressed?

Yes___No_X

If Yes, please explain.

(5.) Please identify all parties who will rely on the Phase I report.

The Suffolk County Landbank and Suffolk County will rely on this report to make further determination on potential next steps in regards to the property

(6.) Please identify the site contact and how the site contact can be reached.

The assessed owner of the property is Hubbard Power and Light Incorporated, and has been shown as such since 1997. The contact can be reached via post.

(7.) Are	there	any	special	terms	and	conditions	that	must	be	agreed	upon	by	the	environmenta
profession	nal?										-			

No

(8.) Do you have any knowledge or experience with the property that may be pertinent to the environmental professional (prior environmental reports, documents, correspondence, etc. concerning the environmental condition of the property). Attach additional sheets if required.

See attached Suffolk County Department of Health history at bottom of form

(9) Does the user intend to retain a title company or title professional to review reasonable ascertainable title and judicial records for environmental liens or activity and use limitations (AULs)?

Yes___ No x

If Yes, will the results of the review be provided to the environmental professional?

Yes___ No __

Section 2 - Landowner Liability Protections

In order to qualify for one of the Landowner Liability Protections (LLPs) offered by the Small Business Liability Relief and Brownfields Revitalization Act of 2001 (the "Brownfields Amendments"), the user must provide the following information (if available) to the environmental professional. Failure to provide this information could result in a determination that "all appropriate inquiry" is not complete.

(1.) Environmental cleanup liens that are filed or recorded against the site (40 CFR 312.25).

Are you aware of any environmental cleanup liens against the property that are filed or recorded under federal, tribal, state or local law?

Not at this time

Landowner Liability Protections, or LLPs, is the term used to describe the three types of potential defenses to Superfund liability in EPA's Interim Guidance Regarding Criteria Landowners Must Meet in Order to Qualify for Bona Fide Prospective Purchaser, Contiguous Property Owner, or Innocent Landowner Limitations on CERCLA Liability ("Common Elements" Guide) issued on March 6, 2003.

(2.) Activity and land use limitations that are in place on the site or that have been filed or recorded in a registry (40 CFR 312.26).

Are you aware of any AULs, such as engineering controls, land use restrictions or institutional controls that are in place at the site and/or have been filed or recorded in a registry under federal, tribal, state or local law?

None that are known at this time.

(3.) Specialized knowledge or experience of the person seeking to qualify for the LLP (40 CFR 312.28).

As the user of this ESA do you have any specialized knowledge or experience related to the property or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the property or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business? If "yes", please explain.

No

(4.) Relationship of the purchase price to the fair market value of the property if it were not contaminated (40 CFR 312.29).

Does the purchase price being paid for this property reasonably reflect the fair market value of the property? If you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the property?

N/A

(5.) Commonly known or reasonably ascertainable information about the property (40 CFR 312.30).

Are you aware of commonly known or reasonably ascertainable information about the property that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example, as user,

(a.) Do you know the past uses of the property?

See attached Dept of Health information

(b.) Do you know of specific chemicals that are present or once were present at the property?

Petroleum products including motor oil and #2 Fuel oil.

(c.) Do you know of spills or other chemical releases that have taken place at the property?

Chlorinated compounds and heavy metals have been detected in groundwater samples. Semi-volatile compounds and minimal amounts of pesticides were found in surface soils.

Consent order with NYSDEC regarding petroleum spills; co	empliance deposition unknown.
(6.) The degree of obviousness of the presence of likely presand the ability to detect the contamination by appropriate i	
As the user of this ESA, based on your knowledge and experious indicators that point to the presence or likely presence	
Based on the usage of the property and visual inspections, the C Task force has determined that the property may have contamin action on the property until an environmental assessment is made	ounty, by way of its internal Inter-Agency ation and as such, is not inclined to take le
User Signature	
I have answered the above questions in good faith and based or	n my knowledge of the property.
Printed Name TOM KEW	Title EXEMPTIVE DUKE CTOK
Printed Name Tom Keung Signature MAMM	Title EXEMPLY DIRECTOR Date 1.114

(d.) Do you know of any environmental cleanups that have taken place at the property?

Suffolk County Landbank EPA Parcels – Phase I Environmental Assessments January 2014

1600 5th Avenue Bay Shore, NY 11706 Hubbard Power and Light, Inc.

Timeline

1990	SCDHS inspection. Violation for excessive drums
	w/o secondary containment.
	40 drums of various water conditioning chemicals.
1991	SCDHS inspection. No violations noted.
1992	SCDHS inspection. No violations noted.
1993	SPDES inspection. Over-limits noted for outfall 003
	(sulfide and perc are found in sample).
1994	SCDHS inspection. No violations noted.
2001	SCDHS inspection. Limited access. Abandoned power plant.
	2 stacks, 2 cooling towers are noted. Various debris on-site.
2002	SCDHS inspection. 13 abandoned drums.
2002	OWR / OPC install groundwater wells.
	MTBE 69 ppb; Perc 5 ppb; Chromium 5.5 ppb;
	Barium 40 ppb

Note: Numerous air complaints dating back to 1986



Date: 1/6/14 Location: Hubbard Power and Light

Description: A view of the building facing west from 5th Avenue.



Date: 1/6/14 Location: Hubbard Power and Light

Description: A view of the north side of the building facing southeast



Date: 1/6/14 Location: Hubbard Power and Light

Description: A view of the north side of the building and cooling towers.



Date: 1/6/14 **Location:** Hubbard Power and Light

Description: A view of abandoned drums located in the open-ended storage building.



Date: 1/6/14 Location: Hubbard Power and Light

Description: A view of an AST located on the north side of the building.



Date: 1/6/14 Location: Hubbard Power and Light

Description: A view of two abandoned ASTs.



Date: 1/6/14 Location: Hubbard Power and Light

Description: A view of abandoned electrical equipment on the north side of the subject

property.



Date: 1/6/14 Location: Hubbard Power and Light

Description: A view of label on the abandoned electrical equipment.



Date: 1/6/14 Location: Hubbard Power and Light

Description: A view of the suspect lagoon area located in the southwest corner of the subject property, facing west towards Hubbard Sand and Gravel.



Date: 1/6/14 Location: Hubbard Power and Light

Description: A view of the fill debris observed in the southeastern corner of the subject

property.



Date: 1/6/14 Location: Hubbard Power and Light

Description: Abandoned drum in the northern side of the subject property.



Date: 1/6/14 **Location:** Hubbard Power and Light

Description: Abandoned carboy that contained degreaser.

Home

Departments

About Islip

E-Services

News

Supervisor Tom Croci

Search			
	Contact	FAD	

Assessment Ro	oll Property Search	Roll Informatio
Street Number	1600	2013 *FINAL RO
Street Name	STH ▼	
Street Type	AVE 🔻	
Town/Hamlet	▼	
Tax Map Search	Dist Sect Block Lot	
Clear Search Crite	<u>ria</u> Search	
×		
Owner Name 1	HUBBARD POWER & LIGHT INC	
Owner Name 2	HODDAND FOWER & EIGHT INC	
Owner Address	1612 5TH AVE	
Owner Town St Zip	BAY SHORE NY 11706	
Tax Map Number	0500-22400-0100-080002	
Physical Address	1600 5TH AVE	
Physical Town Zip	BAY SHORE 11706	
NYS Code	877 -	
Hom / NonHom	N-H	
Exp Prop Type		
Land Assesed Value	40,100	
Acreage	1.84	
Dimensions	200X400	
Special Asmt Value Special Asmt Code		
Exemptions		
Assessed Values	925,000 FULL	
	925,000 TOWN 925,000 COUNTY	
	925,000 SPECIAL	
	925,000 SCHOOL	
Tax Code	515	
School District	12 - BRENTWOOD SCHOOL DISTRICT	
Zoning Code	IN1	
Roll Section	1	
Garbage	District: 018 Taxable: N	
Sewer	District: 00 Zone: 00	
ltem	027243	
SBEA Code	472812	
Taxable Status	March 1, 2013	
Description	TOWN OF ISLIPOUTSIDE VILLAGEROLL SECTION 10500	
Roll Year	2013	
Roll Type	*FINAL ROLL	

Hubbard Power & Light 1600 5th Avenue Bay Shore, NY 11706

Inquiry Number: 3812742.2s

December 17, 2013

The EDR Radius Map™ Report with GeoCheck®

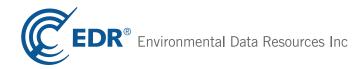


TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map.	2
Detail Map.	3
Map Findings Summary.	4
Map Findings	8
Orphan Summary	252
Government Records Searched/Data Currency Tracking	GR-1
GEOCHECK ADDENDUM	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map.	A-5
Physical Setting Source Map	A-11
Physical Setting Source Map Findings.	A-13
Physical Setting Source Records Searched	A-41

Thank you for your business.Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

1600 5TH AVENUE BAY SHORE, NY 11706

COORDINATES

Latitude (North): 40.7557000 - 40° 45' 20.52" Longitude (West): 73.2630000 - 73° 15' 46.80"

Universal Tranverse Mercator: Zone 18 UTM X (Meters): 646629.7 UTM Y (Meters): 4512878.0

Elevation: 68 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 40073-G3 GREENLAWN, NY

Most Recent Revision: 1979

East Map: 40073-G2 CENTRAL ISLIP, NY

Most Recent Revision: 1979

Southeast Map: 40073-F2 BAY SHORE EAST, NY

Most Recent Revision: 1979

South Map: 40073-F3 BAY SHORE WEST, NY

Most Recent Revision: 1979

AERIAL PHOTOGRAPHY IN THIS REPORT

Photo Year: 2011 Source: USDA

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
HUBBARD POWER & LIGHT INC. PROPER 1600 FIFTH AVENUE BAYSHORE, NY	FINDS	N/A
QUALITY RES RECOVERY CORP 1600 FIFTH AVENUE BAY SHORE, NY	NY Spills Spill Number/Closed Date: 9413426 / 1/24/1995	N/A

HUBBART POWER & LIGHT NY Spills N/A

1600 FIFTH AVENUESpill Number/Closed Date: 0402576 / Not ReportedBAY SHORE, NYSpill Number/Closed Date: 9412773 / 1/24/2003

HUBBARD POWER & LIGHT, INC NY SPDES N/A

1600 FIFTH AVENUE BAYSHORE, NY 11706

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL LIENS_____ Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

FEDERAL FACILITY..... Federal Facility Site Information listing

Federal RCRA CORRACTS facilities list

CORRACTS..... Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF...... RCRA - Treatment, Storage and Disposal

Federal institutional controls / engineering controls registries

US ENG CONTROLS...... Engineering Controls Sites List
US INST CONTROL...... Sites with Institutional Controls
LUCIS...... Land Use Control Information System

Federal ERNS list

ERNS..... Emergency Response Notification System

State and	l tribal	leaking	storage	tank	lists
-----------	----------	---------	---------	------	-------

NY HIST LTANKS..... Listing of Leaking Storage Tanks INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

NY TANKS	Storage Tank Faciliy Listing
NY CBS UST	Chemical Bulk Storage Database
NY MOSF UST	Major Oil Storage Facilities Database
NY MOSF AST	Major Oil Storage Facilities Database
NY MOSF	Major Oil Storage Facility Site Listing
INDIAN UST	Underground Storage Tanks on Indian Land
FEMA UST	Underground Storage Tank Listing

State and tribal institutional control / engineering control registries

NY ENG CONTROLS	Registry of Engineering Controls
	Registry of Institutional Controls
NY RES DECL	Restrictive Declarations Listing

State and tribal voluntary cleanup sites

INDIAN VCP..... Voluntary Cleanup Priority Listing

State and tribal Brownfields sites

NY ERP	Environmental Restoration Program Listing
NY BROWNFIELDS	Brownfields Site List

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

DEBRIS REGION 9	. Forres Martinez Reservation Illegal Dump Site Locations
ODI	Open Dump Inventory
NY SWTIRE	Registered Waste Tire Storage & Facility List
INDIAN ODI	Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US CDL	Clandestine Drug Labs
US HIST CDL	National Clandestine Laboratory Register

Local Lists of Registered Storage Tanks

NY HIST UST	Historical Petroleum	Bulk Storage Database
NY HIST AST	Historical Petroleum	Bulk Storage Database

Local Land Records

LIENS 2..... CERCLA Lien Information

NY LIENS..... Spill Liens Information

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System

NY Hist Spills_____ SPILLS Database

NY SPILLS 90 data from FirstSearch NY SPILLS 80 data from FirstSearch SPILLS 80 data from FirstSearch

Other Ascertainable Records

CONSENT...... Superfund (CERCLA) Consent Decrees

TRIS_____ Toxic Chemical Release Inventory System

TSCA..... Toxic Substances Control Act

Act)/TSCA (Toxic Substances Control Act)

HIST FTTS..... FIFRA/TSCA Tracking System Administrative Case Listing

SSTS..... Section 7 Tracking Systems

ICIS...... Integrated Compliance Information System

RAATS_____RCRA Administrative Action Tracking System

RMP..... Risk Management Plans

NY UIC...... Underground Injection Control Wells

NY AIRS..... Air Emissions Data

NY E DESIGNATION..... E DESIGNATION SITE LISTING

INDIAN RESERV..... Indian Reservations

SCRD DRYCLEANERS...... State Coalition for Remediation of Drycleaners Listing

NY COAL ASH...... Coal Ash Disposal Site Listing

NY Financial Assurance Information Listing

LEAD SMELTERS..... Lead Smelter Sites

2020 COR ACTION........... 2020 Corrective Action Program List

US AIRS...... Aerometric Information Retrieval System Facility Subsystem COAL ASH EPA...... Coal Combustion Residues Surface Impoundments List

PRP Potentially Responsible Parties

PCB TRANSFORMER______PCB Transformer Registration Database

US FIN ASSUR..... Financial Assurance Information

EPA WATCH LIST..... EPA WATCH LIST

COAL ASH DOE..... Steam-Electric Plant Operation Data

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP..... EDR Proprietary Manufactured Gas Plants

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in **bold italics** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal CERCLIS list

CERCLIS: The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 04/26/2013 has revealed that there are 2 CERCLIS sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
NYSDEC SERVALL LAUNDRY SITE	8 DRAYTON AVE	ENE 0 - 1/8 (0.086 mi.)	C9	36
RITE-OFF INC.	1545 5TH INDUSTRIAL COU	SSW 1/8 - 1/4 (0.225 mi.)	L49	191

Federal CERCLIS NFRAP site List

CERC-NFRAP: Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

A review of the CERC-NFRAP list, as provided by EDR, and dated 04/26/2013 has revealed that there is 1 CERC-NFRAP site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HUBBARD SAND & GRAVEL	1612 FIFTH AVE	NNE 0 - 1/8 (0.110 mi.)	D24	99

Federal RCRA generators list

RCRA-LQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA)

of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

A review of the RCRA-LQG list, as provided by EDR, and dated 09/10/2013 has revealed that there is 1 RCRA-LQG site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
USA INDUSTRIES	1560 FIFTH AVENUE	S 1/8 - 1/4 (0.141 mi.)	H34	130

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 09/10/2013 has revealed that there are 2 RCRA-SQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TJ SIGNS UNLIMITED	DBA AMERICAN SIGNCRAFT	ΓŒNE 0 - 1/8 (0.027 mi.)	5	14
Lower Elevation	Address	Direction / Distance	Map ID	Page
FINISH LINE TECHNOLOGIES	1545 5TH INDUSTRIAL COU	SSW 1/8 - 1/4 (0.225 mi.)	L48	170

State- and tribal - equivalent CERCLIS

NY SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the NY SHWS list, as provided by EDR, and dated 11/13/2013 has revealed that there are 8 NY SHWS sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HUBBARD ENTERPRISES	1612 5TH AVENUE	NNE 0 - 1/8 (0.110 mi.)	D22	91
LUMEX	100 SPENCE ST	NNW 1/2 - 1 (0.592 mi.)	65	240
PRESTIGELINE, INC.	5 INEZ DR	NNW 1/2 - 1 (0.762 mi.)	66	244
SOUTH SHORE OUTDOOR SITE	1760 FIFTH AVENUE	N 1/2 - 1 (0.908 mi.)	68	249
Lower Elevation	Address	Direction / Distance	Map ID	Page
NYSDEC SERVALL LAUNDRY SITE Class Code: Site is properly closed - requi	8 DRAYTON AVE res continued management.	ENE 0 - 1/8 (0.086 mi.)	C9	36
K.P. EDWARDS MATERIALS AMERICANA LAUNDROMAT AND DRY C FINISH LINE TECHNOLOGIES	1580 5TH AVENUE 1572 NORTH 5TH AVENUE 1545 5TH INDUSTRIAL COU	S 0 - 1/8 (0.091 mi.) S 0 - 1/8 (0.109 mi.) SSW 1/8 - 1/4 (0.225 mi.)	E15 E19 L48	71 85 170

NY VAPOR REOPENED: "Vapor intrusion" refers to the process by which volatile chemicals move from a subsurface source into the indoor air of overlying or adjacent buildings. The subsurface source can either be contaminated groundwater or contaminated soil which releases vapors into the pore spaces in the soil. Improvements in analytical techniques and knowledge gained from site investigations in New York and other states has led to an increased awareness of soil vapor as a medium of concern and of the potential for exposures from the soil vapor intrusion pathway. Based on this additional information, New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

A review of the NY VAPOR REOPENED list, as provided by EDR, and dated 01/01/2013 has revealed that there are 2 NY VAPOR REOPENED sites within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
SERVALL LAUNDRY	8 DRAYTON AVENUE	ENE 0 - 1/8 (0.086 mi.)	C10	55
RITE OFF AEROSAL	1545 5TH INDUSTRIAL COU	SSW 1/8 - 1/4 (0.225 mi.)	L47	167

State and tribal landfill and/or solid waste disposal site lists

NY SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the list.

A review of the NY SWF/LF list, as provided by EDR, and dated 10/08/2013 has revealed that there are 10 NY SWF/LF sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HUBBARD ENTERPRISES	1612 5TH AVENUE	NNE 0 - 1/8 (0.110 mi.)	D22	91
NORTHEAST RECYCLING CORP.	1612 FIFTH AVENUE	NNE 0 - 1/8 (0.110 mi.)	D25	106
PHOENIX AUTO PARTS	7 MCADAM STREET	N 0 - 1/8 (0.125 mi.)	G32	115
SALVAGE YARD	1 MACADAM AVENUE	NNE 1/8 - 1/4 (0.158 mi.)	<i>1</i> 35	136
MILLER'S USED TRUCK PARTS	18 MCADAM STREET	NW 1/8 - 1/4 (0.162 mi.)	37	138
BAYSHORE RECYCLING (GERSHOW RE	33 MCADAM STREET	NNW 1/8 - 1/4 (0.164 mi.)	J40	149
ALL ISLAND AUTO COMPANY INC	4 SWEENEYDALE AVENUE	N 1/8 - 1/4 (0.245 mi.)	M51	199
AMERICAN BURNER CORP	45 DREXEL DR	NNW 1/4 - 1/2 (0.407 mi.)	62	229
Lower Elevation	Address	Direction / Distance	Map ID	Page
KENNETH P. EDWARDS	1580 FIFTH AVE.	SSE 0 - 1/8 (0.049 mi.)	B6	27
CHAMPION RECYCLING	1512 FIFTH INDUSTRIAL C	SSW 1/8 - 1/4 (0.245 mi.)	N52	200

State and tribal leaking storage tank lists

NY LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the NY LTANKS list, as provided by EDR, and dated 09/25/2013 has revealed that there are 8 NY LTANKS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TOWN CESSPOOL CO	55 SWEENYDALE AVENUE	N 1/8 - 1/4 (0.250 mi.)	O57	205
Spill Number/Closed Date: 0509814 /	7/25/2006			
Spill Number/Closed Date: 9202302 /	7/6/1992			

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ADVANCED ENGINEERED PRODUCTS Spill Number/Closed Date: 9606352 /		N 1/4 - 1/2 (0.331 mi.)	P59	208
DREXEL DRIVE ASSOC Spill Number/Closed Date: 9311190 /	35 DREXEL DRIVE 1/14/1994	N 1/4 - 1/2 (0.331 mi.)	P60	227
NATURES VALUE Spill Number/Closed Date: 0609493 /	54 DREXEL DRIVE 1/12/2007	N 1/4 - 1/2 (0.340 mi.)	61	228
BP AMOCO Spill Number/Closed Date: 9909502 / Spill Number/Closed Date: 9909501 / Spill Number/Closed Date: 0612590 /	1672 5TH AVENUE 12/21/1999 12/21/1999 1/28/2010	N 1/4 - 1/2 (0.445 mi.)	Q63	233
DNS ASSOCIATES Spill Number/Closed Date: 9802827 /	12 WISCONSIN COURT 7/24/2001	N 1/4 - 1/2 (0.460 mi.)	Q64	238
Lower Elevation	Address	Direction / Distance	Map ID	Page
RITE OFF AEROSAL Spill Number/Closed Date: 9709669 /	1545 5TH INDUSTRIAL COU 1/30/1998	SSW 1/8 - 1/4 (0.225 mi.)	L47	167
GUIDO RESIDENCE Spill Number/Closed Date: 9305786 /	37 CONNITCUT AVE 8/11/1993	ENE 1/4 - 1/2 (0.302 mi.)	58	207

State and tribal registered storage tank lists

NY UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the NY UST list, as provided by EDR, and dated 11/13/2013 has revealed that there are 3 NY UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
5TH AVE FAST LUBE	1608 5TH AVE	NNE 0 - 1/8 (0.091 mi.)	D12	58
BAYSHORE TRUCK REPAIR	1629 5TH AVE	NNE 1/8 - 1/4 (0.186 mi.)	K42	151
SUFFOLK COUNTY POLICE 3RD PCT	1630 5TH AVE	NNE 1/8 - 1/4 (0.191 mi.)	K43	152

NY AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the NY AST list, as provided by EDR, and dated 11/13/2013 has revealed that there are 5 NY AST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
5TH AVE FAST LUBE	1608 5TH AVE	NNE 0 - 1/8 (0.091 mi.)	D12	58
HUBBARD SAND & GRAVEL CORP	1612 5TH AVE	NNE 0 - 1/8 (0.110 mi.)	D23	93
S & I INDUSTRIES INC GERSHOW	33 MCADAM ST	NNW 1/8 - 1/4 (0.164 mi.)	J39	139
BAYSHORE TRUCK REPAIR	1629 5TH AVE	NNE 1/8 - 1/4 (0.186 mi.)	K41	150
Lower Elevation	Address	Direction / Distance	Map ID	Page
PARKWAY REDI MIX MASON SUPPLY	1580 FIFTH AVE	S 0 - 1/8 (0.091 mi.)	E14	68

NY CBS AST: Chemical Bulk Storage Database. Registration data collected as required by 6 NYCRR Part 596. It includes facilities storing hazardous substances listed in 6 NYCRR Part 597, in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size. Includes facilities registered (and closed) since effective date of CBS regulations (July 15, 1988) through the date request is processed.

A review of the NY CBS AST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 2 NY CBS AST sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
SERVALL PROJECT SITE	8 DRAYTON AVENUE		C11	55
RITE-OFF INC.	1545 5TH INDUSTRIAL COU	SSW 1/8 - 1/4 (0.225 mi.)	L49	191

NY CBS: These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

A review of the NY CBS list, as provided by EDR, and dated 11/13/2013 has revealed that there are 2 NY CBS sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
NYSDEC SERVALL LAUNDRY SITE	8 DRAYTON AVE	ENE 0 - 1/8 (0.086 mi.)	C9	36
FINISH LINE TECHNOLOGIES	1545 5TH INDUSTRIAL COU	SSW 1/8 - 1/4 (0.225 mi.)	L48	170

State and tribal voluntary cleanup sites

NY VCP: Voluntary Cleanup Agreements. The voluntary remedial program uses private monies to get contaminated sites remediated to levels allowing for the sites' productive use. The program covers virtually any kind of site and contamination.

A review of the NY VCP list, as provided by EDR, and dated 11/13/2013 has revealed that there is 1 NY VCP site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
AMERICANA LAUNDROMAT AND DRY C	1572 NORTH 5TH AVENUE	S 0 - 1/8 (0.109 mi.)	E19	85

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

Registered Recycling Facility List from the Department of Environmental Conservation.

A review of the NY SWRCY list, as provided by EDR, and dated 10/08/2013 has revealed that there is 1 NY SWRCY site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HUBBARD ENTERPRISES	1612 5TH AVENUE	NNE 0 - 1/8 (0.110 mi.)	D22	91

Local Lists of Hazardous waste / Contaminated Sites

NY DEL SHWS: A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

A review of the NY DEL SHWS list, as provided by EDR, and dated 11/13/2013 has revealed that there are 2 NY DEL SHWS sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ALPHA WINDOWS	1760 5TH AVENUE	N 1/2 - 1 (0.900 mi.)	67	246
Lower Elevation	Address	Direction / Distance	Map ID	Page
RITE OFF, INC.		SSW 1/8 - 1/4 (0.218 mi.)	L46	165

Records of Emergency Release Reports

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 09/25/2013 has revealed that there are 6 NY Spills sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HUBBARD POWER AND LIGHT Spill Number/Closed Date: 9503233 /	1612 5TH AVENUE 5/22/2000	NNE 0 - 1/8 (0.110 mi.)	D21	90
UNK Spill Number/Closed Date: 0407289 / Spill Number/Closed Date: 9506509 /	1612 5TH AVENUE 10/15/2008 8/31/1995	NNE 0 - 1/8 (0.110 mi.)	D26	106
GERSHOW RECYCLING Spill Number/Closed Date: 0025056 /	MCADAM STREET & FIFTH A 11/14/2007	N 0 - 1/8 (0.117 mi.)	G30	113
Lower Elevation	Address	Direction / Distance	Map ID	Page
SUNOCO Spill Number/Closed Date: 9107410 /	1575 FIFTH AVENUE 6/24/1999	SSE 0 - 1/8 (0.064 mi.)	B8	31
UNK/CLOSED FACTORY Spill Number/Closed Date: 9304210 /	12 DRAYTON AVENUE 7/13/2004	ENE 0 - 1/8 (0.114 mi.)	F27	109

61 MCADAM STREET

Other Ascertainable Records

GERSHOW RECYCLING

Spill Number/Closed Date: 9404922 / 10/19/2011

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or

31

114

NNW 0 - 1/8 (0.120 mi.)

dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 09/10/2013 has revealed that there are 10 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TELEMECHANICS INC	1636 5TH AVE	NNE 1/8 - 1/4 (0.216 mi.)	45	157
GALE DELIVERY INC	45 SWEENEY DALE AVE	N 1/8 - 1/4 (0.247 mi.)	O56	203
Lower Elevation	Address	Direction / Distance	Map ID	Page
SUNOCO	1575 FIFTH AVENUE	SSE 0 - 1/8 (0.064 mi.)	B8	31
NYSDEC SERVALL LAUNDRY SITE	8 DRAYTON AVE	ENE 0 - 1/8 (0.086 mi.)	C9	36
FORMERLY AMERICANA LAUNDROMAT	1572 N 5TH AVE	S 0 - 1/8 (0.109 mi.)	E16	72
FORMERLY AMERICANA LAUNDROMAT	1572 NORTH 5TH AVE	S 0 - 1/8 (0.109 mi.)	E18	83
MACHINERY VALVES	12 DRAYTON AVE	ENE 0 - 1/8 (0.114 mi.)	F28	110
MACHINERY VALUES INC	12 DRAYTON AVE	ENE 0 - 1/8 (0.114 mi.)	F29	111
RITE-OFF INC.	1545 5TH INDUSTRIAL COU	SSW 1/8 - 1/4 (0.225 mi.)	L49	191
VINNEMONTES WASTE SYSTEMS	1510 FIFTH INDUSTRIAL C	SSW 1/8 - 1/4 (0.245 mi.)	N53	201

US MINES: Mines Master Index File. The source of this database is the Dept. of Labor, Mine Safety and Health Administration.

A review of the US MINES list, as provided by EDR, and dated 08/01/2013 has revealed that there are 2 US MINES sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HUBBARD SAND & GRAVEL	1612 FIFTH AVE	NNE 0 - 1/8 (0.110 mi.)	D24	99
Lower Elevation	Address	Direction / Distance	Map ID	Page
KENNETH P EDWARDS INC		SSW 0 - 1/8 (0.051 mi.)	7	28

NY HSWDS: The List includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity The latest version of the study is frozen in time. The sites on the study will not automatically be made superfund sites, rather each site will be further evaluated for listing in the registry. So overtime they will be added to the registry or not.

A review of the NY HSWDS list, as provided by EDR, and dated 01/01/2003 has revealed that there is 1 NY HSWDS site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HUBBARD WILSON LANDFILL	1612 FIFTH AVENUE	NNE 0 - 1/8 (0.110 mi.)	D20	88

NY MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the NY MANIFEST list, as provided by EDR, and dated 11/01/2013 has revealed that there are 9 NY MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TJ SIGNS UNLIMITED	DBA AMERICAN SIGNCRAFT	TEENE 0 - 1/8 (0.027 mi.)	5	14
TELEMECHANICS INC	1636 5TH AVE	NNE 1/8 - 1/4 (0.216 mi.)	45	157
GALE DELIVERY INC	45 SWEENEY DALE AVE	N 1/8 - 1/4 (0.247 mi.)	O56	203
Lower Elevation	Address	Direction / Distance	Map ID	Page
SUNOCO	1575 FIFTH AVENUE	SSE 0 - 1/8 (0.064 mi.)	B8	31
NYSDEC SERVALL LAUNDRY SITE	8 DRAYTON AVE	ENE 0 - 1/8 (0.086 mi.)	C9	36
FORMERLY AMERICANA LAUNDROMAT	1572 N 5TH AVE	S 0 - 1/8 (0.109 mi.)	E16	72
FORMERLY AMERICANA LAUNDROMAT	1572 NORTH 5TH AVE	S 0 - 1/8 (0.109 mi.)	E18	83
USA INDUSTRIES	1560 FIFTH AVENUE	S 1/8 - 1/4 (0.141 mi.)	H33	116
FINISH LINE TECHNOLOGIES	1545 5TH INDUSTRIAL COU	SSW 1/8 - 1/4 (0.225 mi.)	L48	170

RI MANIFEST: Hazardous waste manifest information

A review of the RI MANIFEST list, as provided by EDR, and dated 11/01/2013 has revealed that there is 1 RI MANIFEST site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
USA INDUSTRIES	1560 FIFTH AVENUE	S 1/8 - 1/4 (0.141 mi.)	H34	130

NJ MANIFEST: Hazardous waste manifest information.

A review of the NJ MANIFEST list, as provided by EDR, and dated 11/01/2013 has revealed that there is 1 NJ MANIFEST site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TJ SIGNS UNLIMITED	DBA AMERICAN SIGNCRAFTEENE 0 - 1/8 (0.027 mi.)		5	14

NY DRYCLEANERS: A listing of all registered drycleaning facilities.

A review of the NY DRYCLEANERS list, as provided by EDR, and dated 10/17/2013 has revealed that there is 1 NY DRYCLEANERS site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
STATE PLAZA SUPER LAUNDROMAT	1639 FIFTH AVENUE	NNE 1/8 - 1/4 (0.246 mi.)	M55	202

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR US Hist Auto Stat: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR US Hist Auto Stat list, as provided by EDR, has revealed that there are 6 EDR US Hist Auto Stat sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	1608 5TH AVE	NNE 0 - 1/8 (0.091 mi.)	D13	67
Not reported	1 MACADAM ST	NNE 1/8 - 1/4 (0.158 mi.)	136	138
Not reported	1631 5TH AVE	NNE 1/8 - 1/4 (0.199 mi.)	K44	156
Not reported	4 SWEENEYDALE AVE	N 1/8 - 1/4 (0.245 mi.)	M50	199
Not reported	1640 5TH AVE	N 1/8 - 1/4 (0.245 mi.)	M54	202
Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported	12 WALBRIDGE AVE	SSE 1/8 - 1/4 (0.163 mi.)	38	139

EDR US Hist Cleaners: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.


A review of the EDR US Hist Cleaners list, as provided by EDR, has revealed that there is 1 EDR US Hist Cleaners site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported	1572 5TH AVE	S 0 - 1/8 (0.109 mi.)	E17	83

Due to poor or inadequate address information, the following sites were not mapped. Count: 20 records.

Site Name Database(s) NYSDOT RCRA NonGen / NLR, FINDS, NY **MANIFEST NEW YORK TELEPHONE** NY MANIFEST **NYSDOT BIN 1049382** RCRA NonGen / NLR, NY MANIFEST **NYSDOT BIN 1049381** RCRA NonGen / NLR, NY MANIFEST SHAMROCK S/S NY UST NY UST HESS STATION #32537 GLOBAL MONTELLO GROUP #6610 NY UST SHAMROCK S/S NY AST **BRUNOS TRUCK REPAIR** NY AST RCRA NonGen / NLR, FINDS **JCPENNEY ROADWAY** NY Spills NY Spills UNKNOWN SOUTH SHORE MALL NY Spills NY Spills SOUTHWEST SEWER DISTRICT #3 NY Spills UNKNOWN NY Spills UNK UNK NY Spills UNKNOWN NY Spills NY Spills LILCO **RUBY'S COSTUMES** NY Spills


OVERVIEW MAP - 3812742.2s

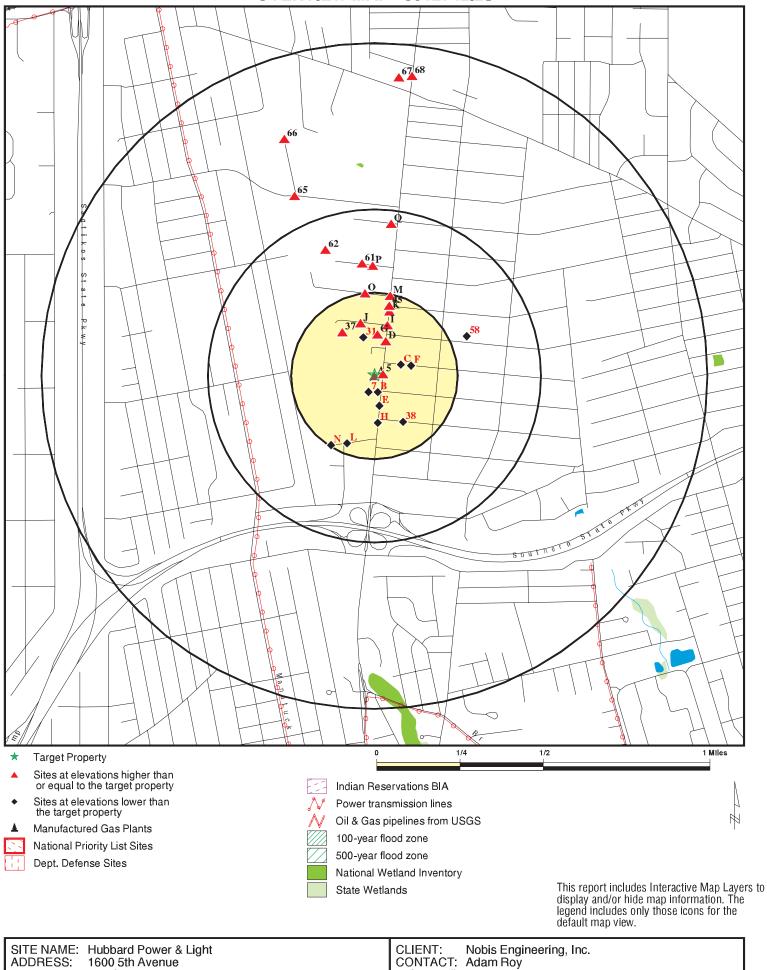

Bay Shore NY 11706 INQUIRY #: 3812742.2s LAT/LONG: 40.7557 / 73.263 DATE: December 17, 2013 12:13 pm

Copyright © 2013 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

DETAIL MAP - 3812742.2s

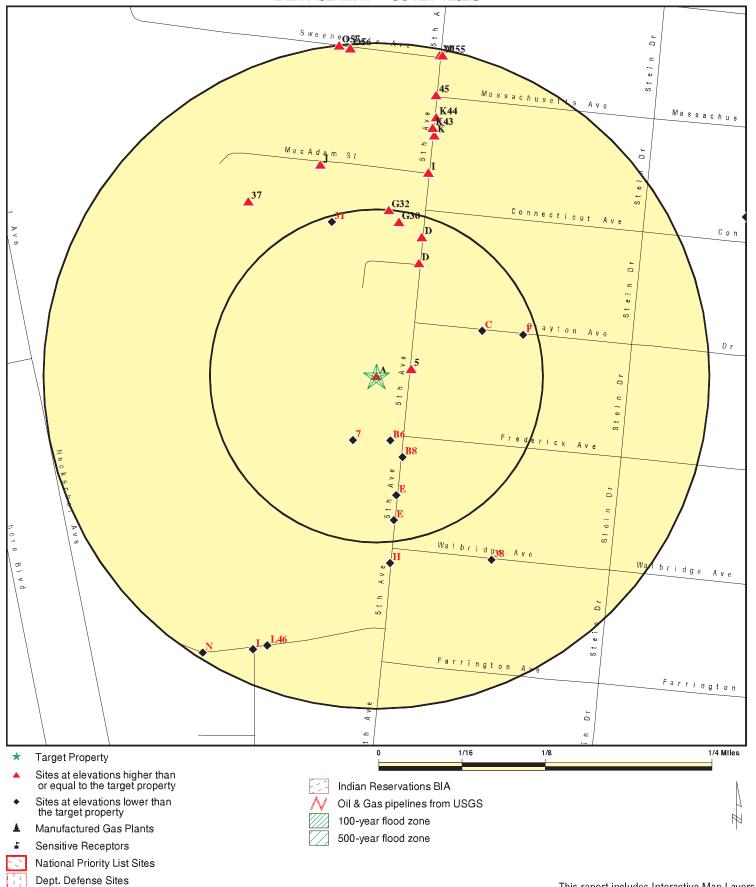

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Hubbard Power & Light ADDRESS: 1600 5th Avenue

Bay Shore NY 11706 LAT/LONG: 40.7557 / 73.263 CLIENT: Nobis Engineering, Inc. CONTACT: Adam Roy

INQUIRY #: 3812742.2s

DATE: December 17, 2013 12:13 pm

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted	
STANDARD ENVIRONMENTAL RECORDS									
Federal NPL site list									
NPL Proposed NPL NPL LIENS	1.000 1.000 TP		0 0 NR	0 0 NR	0 0 NR	0 0 NR	NR NR NR	0 0 0	
Federal Delisted NPL site	e list								
Delisted NPL	1.000		0	0	0	0	NR	0	
Federal CERCLIS list									
CERCLIS FEDERAL FACILITY	0.500 0.500		1 0	1 0	0 0	NR NR	NR NR	2 0	
Federal CERCLIS NFRAP	site List								
CERC-NFRAP	0.500		1	0	0	NR	NR	1	
Federal RCRA CORRACTS facilities list									
CORRACTS	1.000		0	0	0	0	NR	0	
Federal RCRA non-CORF	RACTS TSD f	acilities list							
RCRA-TSDF	0.500		0	0	0	NR	NR	0	
Federal RCRA generators	s list								
RCRA-LQG RCRA-SQG RCRA-CESQG	0.250 0.250 0.250		0 1 0	1 1 0	NR NR NR	NR NR NR	NR NR NR	1 2 0	
Federal institutional controls / engineering controls registries									
US ENG CONTROLS US INST CONTROL LUCIS	0.500 0.500 0.500		0 0 0	0 0 0	0 0 0	NR NR NR	NR NR NR	0 0 0	
Federal ERNS list									
ERNS	TP		NR	NR	NR	NR	NR	0	
State- and tribal - equivalent CERCLIS									
NY SHWS NY VAPOR REOPENED	1.000 1.000		4 1	1 1	0 0	3 0	NR NR	8 2	
State and tribal landfill and/or solid waste disposal site lists									
NY SWF/LF	0.500		4	5	1	NR	NR	10	
State and tribal leaking s	torage tank l	ists							
NY LTANKS NY HIST LTANKS INDIAN LUST	0.500 0.500 0.500		0 0 0	2 0 0	6 0 0	NR NR NR	NR NR NR	8 0 0	

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted	
State and tribal registere	State and tribal registered storage tank lists								
NY TANKS NY UST NY CBS UST NY MOSF UST NY AST NY CBS AST NY MOSF AST NY MOSF NY CBS INDIAN UST FEMA UST	0.250 0.250 0.250 0.500 0.250 0.250 0.500 0.500 0.250 0.250		0 1 0 0 3 1 0 0 1 0	0 2 0 0 2 1 0 0 1	NR NR O NR O O NR NR NR	NR NR NR NR NR NR NR NR NR	NR NR NR NR NR NR NR NR NR	0 3 0 0 5 2 0 0 2	
	State and tribal institutional control / engineering control registries								
NY ENG CONTROLS NY INST CONTROL NY RES DECL	0.500 0.500 0.125		0 0 0	0 0 NR	0 0 NR	NR NR NR	NR NR NR	0 0 0	
State and tribal voluntary cleanup sites									
NY VCP INDIAN VCP	0.500 0.500		1 0	0 0	0 0	NR NR	NR NR	1 0	
State and tribal Brownfie									
NY ERP NY BROWNFIELDS	0.500 0.500		0 0	0 0	0 0	NR NR	NR NR	0 0	
ADDITIONAL ENVIRONMEN	TAL RECORDS	<u>s</u>							
Local Brownfield lists									
US BROWNFIELDS	0.500		0	0	0	NR	NR	0	
Local Lists of Landfill / S Waste Disposal Sites	Solid								
DEBRIS REGION 9 ODI NY SWRCY NY SWTIRE INDIAN ODI	0.500 0.500 0.500 0.500 0.500		0 0 1 0	0 0 0 0	0 0 0 0	NR NR NR NR NR	NR NR NR NR NR	0 0 1 0	
Local Lists of Hazardous waste / Contaminated Sites									
US CDL NY DEL SHWS US HIST CDL	TP 1.000 TP		NR 0 NR	NR 1 NR	NR 0 NR	NR 1 NR	NR NR NR	0 2 0	
Local Lists of Registered	l Storage Tan	ıks							
NY HIST UST NY HIST AST	0.250 TP		0 NR	0 NR	NR NR	NR NR	NR NR	0 0	

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Local Land Records								
LIENS 2 NY LIENS	TP TP		NR NR	NR NR	NR NR	NR NR	NR NR	0 0
Records of Emergency	Release Repo	rts						
HMIRS NY Spills NY Hist Spills NY SPILLS 90 NY SPILLS 80	TP 0.125 0.125 0.125 0.125	2	NR 6 0 0	NR NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	0 8 0 0
Other Ascertainable Rec	cords							
RCRA NonGen / NLR DOT OPS DOD FUDS CONSENT ROD UMTRA US MINES TRIS TSCA FTTS HIST FTTS SSTS ICIS PADS MLTS RADINFO FINDS RAATS RMP NY HSWDS NY UIC NY MANIFEST RI MANIFEST RI MANIFEST NJ DRYCLEANERS NY SPDES NY AIRS NY E DESIGNATION INDIAN RESERV SCRD DRYCLEANERS NY COAL ASH NY Financial Assurance LEAD SMELTERS 2020 COR ACTION US AIRS COAL ASH EPA PRP	0.250 TP 1.000 1.000 1.000 1.000 0.500 0.250 TP	1	6 R 0 0 0 0 0 2 R R R R R R R R R R R R R	4 R O O O O O O RR R R R R R R R R R R R	NR O O O O O RRRRRRRRRRRRRR O NRRRRRRRRR	NR 0 0 0 0 R R R R R R R R R R R R R R R	N N N N N N N N N N N N N N N N N N N	10 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
PCB TRANSFORMER US FIN ASSUR EPA WATCH LIST COAL ASH DOE	TP TP TP TP		NR NR NR NR	NR NR NR NR	NR NR NR NR	NR NR NR NR	NR NR NR NR	0 0 0 0
EDR HIGH RISK HISTORICA	L RECORDS							
EDR Exclusive Records								
EDR MGP EDR US Hist Auto Stat EDR US Hist Cleaners	1.000 0.250 0.250		0 1 1	0 5 0	0 NR NR	0 NR NR	NR NR NR	0 6 1

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Direction Distance

Elevation Site Database(s) EPA ID Number

A1 HUBBARD POWER & LIGHT INC. PROPERTY FINDS 1004566954
Target 1600 FIFTH AVENUE N/A

Property BAYSHORE, NY

Site 1 of 4 in cluster A

Actual: 68 ft.

FINDS:

58 ft.

Registry ID: 110001595015

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

A2 QUALITY RES RECOVERY CORP

Target 1600 FIFTH AVENUE Property BAY SHORE, NY NY Spills \$102101090

N/A

EDR ID Number

Site 2 of 4 in cluster A

Actual: SPILLS:

68 ft. Facility ID:

 Facility ID:
 9413426

 DER Facility ID:
 192636

 Facility Type:
 ER

 Site ID:
 233799

 DEC Region:
 1

 Spill Date:
 1/9/1995

Spill Number/Closed Date: 9413426 / 1/24/1995

Spill Cause: Deliberate

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Unknown Responsible Party. Corrective action taken. (ISR)

SWIS: 5200

Investigator: RDDECAND

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

QUALITY RES RECOVERY CORP (Continued)

S102101090

Referred To: Not reported Reported to Dept: 1/9/1995 CID: Not reported Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Citizen Cleanup Ceased: 1/24/1995 Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: 0 Date Entered In Computer: 1/10/1995 Spill Record Last Update: 10/13/2000 Spiller Name: Not reported

Spiller Company: QUALITY RES RECOVERY CORP

Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 001

Not reported Contact Name: Not reported Contact Phone:

DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was

"DECANDIA"01/24/95: SAME AS 94-12774.

THE HUBBARD TOWER & LIGHT CO OPERATES A GENERATOR. THE GENERATOR Remarks:

RELEASES WATER INTO TRENCHES. THE TRENCHES COLLECT SPILLAGE OF OIL &

OTHER CHEMICALS, CONTINUALLY PUMPED INTO A STORM SEWER

Material:

Site ID: 233799 Operable Unit ID: 1010979 Operable Unit: 01 Material ID: 372171 Material Code: 0022

Waste Oil/Used Oil Material Name: Not reported Case No.: Petroleum Material FA:

Quantity: 0 Units: Gallons Recovered: No Not reported Resource Affected: Oxygenate: False Site ID: 233799 Operable Unit ID: 1010979 Operable Unit: 01

Material ID: 372170 Material Code: 0013 Lube Oil Material Name: Case No.: Not reported Material FA: Petroleum Quantity: O

Units: Gallons Recovered: No Resource Affected:

Not reported Oxygenate: False

Tank Test:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

A3 HUBBART POWER & LIGHT NY Spills S104499568 N/A

Target 1600 FIFTH AVENUE BAY SHORE, NY Property

Site 3 of 4 in cluster A

SPILLS: Actual:

0402576 68 ft. Facility ID: DER Facility ID: 405167 Facility Type: ER

Site ID: 323641 DEC Region: Spill Date: 6/9/2004

Spill Number/Closed Date: 0402576 / Not Reported Spill Cause: **Abandoned Drums**

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

SWIS: 5228 Investigator: **HMCIRRIT** Referred To: Not reported Reported to Dept: 6/9/2004 CID: 444

Water Affected: Not reported

Spill Source: Institutional, Educational, Gov., Other

Spill Notifier: Health Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: Date Entered In Computer: 6/9/2004 Spill Record Last Update: 6/17/2011 Spiller Name: Not reported Spiller Company: UNKNOWN Spiller Address: Not reported

Spiller City, St, Zip: NY Spiller Company: 999

Contact Name: **ALEX SANTINO** Contact Phone: (631) 854-2529

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"CIRRITO"6/9/04 TELECON TO ALEX SANTINO-SCHD, SITE IS WEST SIDE OF

5TH AVE NORTH OF SOUTHERN STATE, VACANT BLDGING, OWNER OWES SC BACK TAXES, DRUMS HAVE BEEN ON SITE FOR AWHILE, WORK BEING DONE ON

PROPERTY, DRUMS OBSERVED SINCE 2002, DRUMS HAVE STARTED TO LEAK (WEEP), NO PROPERTY OWNER, MATERIAL POSSIBLY WASTE OIL AND SPENT SOLVENTS7/29/04 FILE REASSIGNED

13 DRUMS AND AT LEAST ONE IS LEAKING: Remarks:

Material:

323641 Site ID: Operable Unit ID: 884244 Operable Unit: 01 Material ID: 490193 Material Code: 0064A

UNKNOWN MATERIAL Material Name:

Not reported Case No.: Material FA: Other Quantity: Units: Gallons

Direction Distance

Elevation Site Database(s) EPA ID Number

HUBBART POWER & LIGHT (Continued)

S104499568

EDR ID Number

Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

 Facility ID:
 9412773

 DER Facility ID:
 192636

 Facility Type:
 ER

 Site ID:
 323642

 DEC Region:
 1

Spill Date: 12/23/1994

Spill Number/Closed Date: 9412773 / 1/24/2003

Spill Cause: Deliberate

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Unable/unwilling Responsible Party. Corrective action taken. (ISR)

SWIS: 5200
Investigator: RDDECAND
Referred To: Not reported
Reported to Dept: 12/23/1994
CID: Not reported
Water Affected: Not reported

Spill Source: Commercial/Industrial
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported

Cleanup Meets Std: True

Last Inspection:

Recommended Penalty:

UST Trust:

Remediation Phase:

Not reported
False
False
0

Date Entered In Computer: 12/27/1994
Spill Record Last Update: 1/27/2003
Spiller Name: Not reported

Spiller Company: HUBBART POWER & LIGHT

Spiller Address: Not reported

Spiller City, St, Zip: ZZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"DECANDIA"SAME AS 94-13426, SEE ALSO 95-03233

Remarks: CALLER IS EMPLOYEE OF COMPANY STATES WHEN SERVICE IS DONE ON

MACHINES, OIL & DIESEL IS DUMPED IN REAR OF BLDG & IN SEWERS

Material:

Recovered:

Site ID: 323642 1006398 Operable Unit ID: Operable Unit: 01 Material ID: 375065 Material Code: 8000 Material Name: Diesel Not reported Case No.: Material FA: Petroleum Quantity: Units: Gallons

No

TC3812742.2s Page 11

Direction Distance

Elevation Site Database(s) **EPA ID Number**

HUBBART POWER & LIGHT (Continued)

S104499568

EDR ID Number

Not reported Resource Affected: Oxygenate: False Site ID: 323642 Operable Unit ID: 1006398 Operable Unit: 01 Material ID: 375066 Material Code: 0022

Waste Oil/Used Oil Material Name: Case No.: Not reported Material FA: Petroleum 0 Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported

Oxygenate: False

Tank Test:

Α4 **HUBBARD POWER & LIGHT, INC Target 1600 FIFTH AVENUE** BAYSHORE, NY 11706 **Property**

NY SPDES S108160630

N/A

Site 4 of 4 in cluster A

Actual: 68 ft.

SPDES:

Permit Number: NY0206695 State-Region:

Expiration Date: 02/01/1999 **Current Major Minor Status:** Minor Primary Facility SIC Code: 4911 State Water Body Name: GW Limit Set Status Flag: Active Total Actual Average Flow(MGD): Not reported Total App Design Flow(MGD): Not reported UDF1: Not reported

40.754861 / -73.263389 Lat/Long:

DMR Cognizant Official: Not reported UDF2: 001701 UDF3: GA FIPS County Code: NY103

Non-Gov Permit Affiliation Type Desc: **DMR Mailing Address**

Non-Gov Permit Org Formal Name: HUBBARD POWER & LIGHT, INC Non-Gov Permit Street Address: HUBBARD POWER & LIGHT, INC

Non-Gov Permit Supplemental Location: 1600 FIFTH AVENUE

Non-Gov Permit City: **BAYSHORE** Non-Gov Permit State Code: NY Non-Gov Permit Zip Code: 11706 Non-Gov Facility Affiliation Type Desc: Mailing Address

Non-Gov Facility Org Formal Name: HUBBARD POWER & LIGHT, INC HUBBARD POWER & LIGHT, INC Non-Gov Facility Street Address:

Non-Gov Facility Supplemental Location: 1600 FIFTH AVENUE

Non-Gov Facility City: **BAYSHORE** Non-Gov Facility State Code: NY 11706 Non-Gov Facility Zip Code:

Direction Distance

Elevation Site Database(s) EPA ID Number

HUBBARD POWER & LIGHT, INC (Continued)

S108160630

EDR ID Number

State Water Body: 02030202070

 UDF2:
 001701

 UDF3:
 GA

 FIPS County Code:
 NY103

Non-Gov Permit Affiliation Type Desc: DMR Mailing Address

Non-Gov Permit Org Formal Name: HUBBARD POWER & LIGHT, INC Non-Gov Permit Street Address: HUBBARD POWER & LIGHT, INC

Non-Gov Permit Supplemental Location: 1600 FIFTH AVENUE

Non-Gov Permit City: BAYSHORE

Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 11706
Non-Gov Facility Affiliation Type Desc: Owner

Non-Gov Facility Org Formal Name: HUBBARD POWER & LIGHT, INC Non-Gov Facility Street Address: HUBBARD POWER & LIGHT, INC

Non-Gov Facility Supplemental Location: 1600 FIFTH AVENUE

Non-Gov Facility City: BAYSHORE

Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 11706
State Water Body: 020202

State Water Body: 02030202070

 UDF2:
 001701

 UDF3:
 GA

 FIPS County Code:
 NY103

Non-Gov Permit Affiliation Type Desc: Permittee

Non-Gov Permit Org Formal Name: HUBBARD POWER AND LIGHT, INC

Non-Gov Permit Street Address: 1600 FIFTH AVENUE

Non-Gov Permit Supplemental Location: Not reported Non-Gov Permit City: BAYSHORE Non-Gov Permit State Code: NY Non-Gov Permit Zip Code: 11706 Non-Gov Facility Affiliation Type Desc: Mailing Address

Non-Gov Facility Org Formal Name: HUBBARD POWER & LIGHT, INC Non-Gov Facility Street Address: HUBBARD POWER & LIGHT, INC

Non-Gov Facility Supplemental Location: 1600 FIFTH AVENUE

Non-Gov Facility City: BAYSHORE

Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 11706
State Water Body: 02030202070

 UDF2:
 001701

 UDF3:
 GA

 FIPS County Code:
 NY103

Non-Gov Permit Affiliation Type Desc: Permittee

Non-Gov Permit Org Formal Name: HUBBARD POWER AND LIGHT, INC

Non-Gov Permit Street Address: 1600 FIFTH AVENUE

Non-Gov Permit Supplemental Location: Not reported Non-Gov Permit City: BAYSHORE Non-Gov Permit State Code: NY Non-Gov Permit Zip Code: 11706 Non-Gov Facility Affiliation Type Desc: Owner

Non-Gov Facility Org Formal Name: HUBBARD POWER & LIGHT, INC Non-Gov Facility Street Address: HUBBARD POWER & LIGHT, INC

Non-Gov Facility Supplemental Location: 1600 FIFTH AVENUE

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HUBBARD POWER & LIGHT, INC (Continued)

S108160630

Non-Gov Facility City: **BAYSHORE** Non-Gov Facility State Code: NY Non-Gov Facility Zip Code: 11706

State Water Body: 02030202070

TJ SIGNS UNLIMITED 5 RCRA-SQG 1001202872 ENE **DBA AMERICAN SIGNCRAFTERS INC FINDS** NYR000035444

BAYSHORE, NY 11706 < 1/8 0.027 mi.

NJ MANIFEST NY MANIFEST

140 ft.

RCRA-SQG: Relative:

Date form received by agency: 01/01/2007 Higher

Facility name: TJ SIGNS UNLIMITED

Actual: Facility address: DBA AMERICAN SIGNCRAFTERS INC 68 ft. 1591 FIFTH AVE

BAYSHORE, NY 11706 EPA ID: NYR000035444

Contact: THEODORE DYBUS DBA AMERICAN SIGNCRAFTERS INC Contact address:

BAYSHORE, NY 11706

Contact country: US

Contact telephone: (631) 968-6800

Telephone ext.: 14

Contact email: Not reported

EPA Region: 02

Land type: Facility is not located on Indian land. Additional information is not known.

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

> waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

AMERICAN SIGNCRAFTERS Owner/operator name:

Owner/operator address: 1591 5TH AVE

BAY SHORE, NY 11706

Owner/operator country: US

Owner/operator telephone: (516) 968-6800

Legal status: Private

Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: AMERICAN SIGNCRAFTERS

Owner/operator address: 1591 5TH AVE

BAY SHORE, NY 11706

US Owner/operator country:

Owner/operator telephone: (516) 968-6800 Legal status: Private

Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No

Direction Distance

Elevation Site Database(s) EPA ID Number

TJ SIGNS UNLIMITED (Continued)

1001202872

EDR ID Number

Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: Nο User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: TJ SIGNS UNLIMITED

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 02/20/2002

Facility name: TJ SIGNS UNLIMITED
Classification: Large Quantity Generator

Date form received by agency: 02/10/1997

Facility name: TJ SIGNS UNLIMITED
Site name: AMERICAN SIGNCRAFTERS

Classification: Conditionally Exempt Small Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - General

Date violation determined: 06/16/1997
Date achieved compliance: 10/30/1997
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL Enforcement action date: 06/16/1997

Enf. disposition status: Not reported Enf. disp. status date: Not reported Enforcement lead agency: State
Proposed penalty amount: Not reported Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 07/16/2002

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

State

Evaluation date: 12/22/1998

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

EPA

Direction Distance Elevation

Site Database(s) EPA ID Number

TJ SIGNS UNLIMITED (Continued)

1001202872

EDR ID Number

Evaluation date: 06/12/1997

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 10/30/1997 Evaluation lead agency: State

FINDS:

Registry ID: 110004532248

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

HAZARDOUS WASTE BIENNIAL REPORTER

NJ MANIFEST:

Manifest Code: NJA5107444 EPA ID: NYR000035444 Date Shipped: 04/24/2006 TSDF EPA ID: NJD002454544 Transporter EPA ID: NYD064748304 Transporter 2 EPA ID: NJD002454544 Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Date Trans1 Transported Waste: 04/24/2006 05/02/2006 Date Trans2 Transported Waste: Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Not reported Date Trans9 Transported Waste: Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 05/02/2006 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Generator EPA Facility Name: Not reported Not reported Transporter-1 EPA Facility Name: Transporter-2 EPA Facility Name: Not reported Transporter-3 EPA Facility Name: Not reported Transporter-4 EPA Facility Name: Not reported Transporter-5 EPA Facility Name: Not reported TSDF EPA Facility Name: Not reported QTY Units: Not reported Transporter SEQ ID: Not reported

Map ID MAP FINDINGS
Direction

Distance Elevation

Site Database(s) EPA ID Number

TJ SIGNS UNLIMITED (Continued)

Hand Code:

1001202872

EDR ID Number

Transporter-1 Date: Not reported Not reported Waste SEQ ID: Waste Type Code 2: Not reported Not reported Waste Type Code 3: Waste Type Code 4: Not reported Not reported Waste Type Code 5: Waste Type Code 6: Not reported Date Accepted: Not reported Manifest Discrepancy Type: Not reported Data Entry Number: 06260622 Reference Manifest Number: Not reported Was Load Rejected (Y/N): No

Was Load Rejected (17N).

Reason Load Was Rejected:

Waste Code:

Manifest Year:

Quantity:

Unit:

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Manifest Code: 004072169JJK EPA ID: NYR000035444 Date Shipped: 07/10/2008

Not reported

Not reported Not reported

TSDF EPA ID: NJD980536593 Transporter EPA ID: NYD064748304 Transporter 2 EPA ID: NJD080631369 Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported

Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported 07/10/2008 Date Trans1 Transported Waste: 07/18/2008 Date Trans2 Transported Waste: Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported

Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Not reported Date Trans10 Transported Waste: Date TSDF Received Waste: 07/18/2008 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Generator EPA Facility Name: Not reported Transporter-1 EPA Facility Name: Not reported Transporter-2 EPA Facility Name: Not reported Transporter-3 EPA Facility Name: Not reported

Transporter-4 EPA Facility Name:

Transporter-5 EPA Facility Name:

TSDF EPA Facility Name:

QTY Units:

Transporter SEQ ID:

Transporter-1 Date:

Not reported

Not reported

Not reported

Direction Distance Elevation

Site Database(s) EPA ID Number

TJ SIGNS UNLIMITED (Continued)

1001202872

EDR ID Number

Waste SEQ ID: Not reported Not reported Waste Type Code 2: Waste Type Code 3: Not reported Waste Type Code 4: Not reported Waste Type Code 5: Not reported Waste Type Code 6: Not reported Not reported Date Accepted: Not reported Manifest Discrepancy Type: Data Entry Number: Not reported Reference Manifest Number: Not reported

Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: F003

Manifest Year: 2008 New Jersey Manifest Data

Quantity: 900 Unit: P Hand Code: H141

Manifest Code: NJA4045047 EPA ID: NYR000035444 Date Shipped: 08/03/2004 TSDF EPA ID: NJD002454544 Transporter EPA ID: NYD064748304 Transporter 2 EPA ID: NJD002454544 Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Not reported Transporter 7 EPA ID: Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 08/03/2004 08/13/2004 Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 08/13/2004 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Generator EPA Facility Name: Not reported Transporter-1 EPA Facility Name: Not reported Transporter-2 EPA Facility Name: Not reported Transporter-3 EPA Facility Name: Not reported Transporter-4 EPA Facility Name: Not reported Transporter-5 EPA Facility Name: Not reported TSDF EPA Facility Name: Not reported QTY Units: Not reported Transporter SEQ ID: Not reported Transporter-1 Date: Not reported Waste SEQ ID: Not reported

Direction Distance Elevation

n Site Database(s) EPA ID Number

TJ SIGNS UNLIMITED (Continued)

Quantity:

Hand Code:

Unit:

1001202872

EDR ID Number

Waste Type Code 2: Not reported Not reported Waste Type Code 3: Waste Type Code 4: Not reported Waste Type Code 5: Not reported Waste Type Code 6: Not reported Date Accepted: Not reported Manifest Discrepancy Type: Not reported Data Entry Number: 09130421 Reference Manifest Number: Not reported Was Load Rejected (Y/N): No Reason Load Was Rejected: Not reported Waste Code: Not reported Manifest Year: Not reported

Not reported

Not reported

Not reported

Manifest Code: NJA4045048 EPA ID: NYR000035444 Date Shipped: 10/13/2004 TSDF EPA ID: NJD002454544 Transporter EPA ID: NYD064748304 Transporter 2 EPA ID: NJD002454544 Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 10/13/2004 Date Trans2 Transported Waste: 10/26/2004 Not reported Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 10/26/2004 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Generator EPA Facility Name: Not reported Transporter-1 EPA Facility Name: Not reported Transporter-2 EPA Facility Name: Not reported Transporter-3 EPA Facility Name: Not reported Transporter-4 EPA Facility Name: Not reported Transporter-5 EPA Facility Name: Not reported TSDF EPA Facility Name: Not reported QTY Units: Not reported Transporter SEQ ID: Not reported Transporter-1 Date: Not reported Waste SEQ ID: Not reported Waste Type Code 2: Not reported

Direction Distance Elevation

Site Database(s) **EPA ID Number**

TJ SIGNS UNLIMITED (Continued)

1001202872

EDR ID Number

Waste Type Code 3: Not reported Not reported Waste Type Code 4: Waste Type Code 5: Not reported Waste Type Code 6: Not reported Date Accepted: Not reported Manifest Discrepancy Type: Not reported Data Entry Number: 12060425 Reference Manifest Number: Not reported

Was Load Rejected (Y/N): No Reason Load Was Rejected: Not reported Waste Code: Not reported Not reported Manifest Year: Not reported Quantity: Unit: Not reported Hand Code: Not reported

NY MANIFEST:

EPA ID: NYR000035444

Country: **USA**

AMERICAN SIGNCRAFTERS Mailing Name: Mailing Contact: JEFFREY PETERSEN

Mailing Address: 1591 5TH AVE Mailing Address 2: Not reported Mailing City: **BAY SHORE**

Mailing State: NY Mailing Zip: 11706 Mailing Zip4: Not reported

Mailing Country: USA

Mailing Phone: 516-968-6800

Document ID: NJA3294746 Manifest Status: Not reported NJD002454544 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 09/14/2001 09/14/2001 Trans1 Recv Date: Not reported Trans2 Recv Date: TSD Site Recv Date: 09/14/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000035444 Trans1 EPA ID: NJD002454544 Trans2 EPA ID: Not reported TSDF ID: 2809

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00750

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 015

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

01.00 Specific Gravity: 2001 Year:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TJ SIGNS UNLIMITED (Continued)

1001202872

Document ID: NJA4045046 Manifest Status: Not reported Trans1 State ID: NJD002454544 Trans2 State ID: NYD064748304 Generator Ship Date: 03/14/2003 Trans1 Recv Date: 03/14/2003 Trans2 Recv Date: 03/14/2003 TSD Site Recy Date: 03/14/2003 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000035444 Generator EPA ID: NJD002454544 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: 2809

Waste Code: F003 - UNKNOWN

Quantity: 00400 P - Pounds Units:

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Year: 2003

Document ID: NJA4045049 Manifest Status: Not reported Trans1 State ID: NJD002434544 Trans2 State ID: NYD064748304 Generator Ship Date: 08/22/2003 Trans1 Recv Date: 08/22/2003 Trans2 Recv Date: 08/22/2003 TSD Site Recy Date: 08/22/2003 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000035444 Generator EPA ID: NJD002454544 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: 2809

F003 - UNKNOWN Waste Code:

00450 Quantity: Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 2003 Year:

Document ID: NJA5107444 Manifest Status: Not reported NYD064748304 Trans1 State ID: Trans2 State ID: NJD002454544 Generator Ship Date: 04/24/2006 Trans1 Recv Date: 04/24/2006 Trans2 Recy Date: 05/02/2006 TSD Site Recy Date: 05/02/2006 Part A Recv Date: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TJ SIGNS UNLIMITED (Continued)

1001202872

Part B Recv Date: Not reported NYR000035444 Generator EPA ID: NYS1A378 Trans1 EPA ID: Trans2 EPA ID: 2809

TSDF ID: NJD002454544 F003 - UNKNOWN Waste Code:

00800 Quantity: P - Pounds Units: Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Year: 2006

Document ID: CTF0513618 Completed copy Manifest Status: P207055IL Trans1 State ID: Trans2 State ID: Not reported 970224 Generator Ship Date: Trans1 Recv Date: 970224 Trans2 Recv Date: Not reported TSD Site Recy Date: 970226 Part A Recv Date: 970307 Part B Recv Date: 970313

Generator EPA ID: NYR000035444 Trans1 EPA ID: NJD080631369 Trans2 EPA ID: Not reported TSDF ID: MAD053452637 Waste Code: F005 - UNKNOWN

00165 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NYD064748304 Trans2 State ID: NJD080631369 Generator Ship Date: 2008-07-10 Trans1 Recv Date: 2008-07-10 2008-07-18 Trans2 Recv Date: TSD Site Recv Date: 2008-07-18 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000035444 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 900.0 P - Pounds Units: Number of Containers: 2.0

Direction Distance Elevation

tion Site Database(s) EPA ID Number

TJ SIGNS UNLIMITED (Continued)

1001202872

EDR ID Number

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2008

Manifest Tracking Num: 004072169JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: MAK0835290 Manifest Status: Not reported Trans1 State ID: NJD080631369 Trans2 State ID: Not reported Generator Ship Date: 10/06/1999 Trans1 Recv Date: 10/06/1999 Trans2 Recv Date: Not reported TSD Site Recv Date: 10/08/1999 Part A Recy Date: Not reported Part B Recv Date: Not reported NYR000035444 Generator EPA ID: MAD053452637 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: P298709IL Waste Code: F003 - UNKNOWN

Quantity: 00135

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 99

Document ID: MAK7122990 Manifest Status: Not reported Trans1 State ID: NJD080631369 Trans2 State ID: Not reported Generator Ship Date: 04/08/1999 Trans1 Recv Date: 04/08/1999 Trans2 Recv Date: Not reported TSD Site Recy Date: 04/20/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000035444 Generator EPA ID: Trans1 EPA ID: MAD053452637 Trans2 EPA ID: Not reported TSDF ID: P298709IL

Waste Code: F003 - UNKNOWN

Direction Distance Elevation

Site Database(s) **EPA ID Number**

TJ SIGNS UNLIMITED (Continued)

1001202872

EDR ID Number

Quantity: 00210

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 99

Document ID: MAK0495050 Manifest Status: Not reported NJD080631369 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 10/26/1998 Trans1 Recv Date: 10/26/1998 Trans2 Recv Date: Not reported TSD Site Recy Date: 10/29/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000035444 Generator EPA ID: Trans1 EPA ID: MAD053452637 Trans2 EPA ID: Not reported TSDF ID: P298709IL

Waste Code: F003 - UNKNOWN

Quantity: 00150

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 98

Document ID: MAK0259950 Not reported Manifest Status: NJD080631369 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 04/02/1998 Trans1 Recv Date: 04/02/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 04/08/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000035444 Generator EPA ID: Trans1 EPA ID: MAD053452637 Trans2 EPA ID: Not reported TSDF ID: P207061IL

Waste Code: F003 - UNKNOWN

Quantity: 00155

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 98

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TJ SIGNS UNLIMITED (Continued)

1001202872

Document ID: NJA4045044 Manifest Status: Not reported Trans1 State ID: NYD064748304 Trans2 State ID: NJD002454544 Generator Ship Date: 07/03/2002 Trans1 Recv Date: 07/03/2002 Trans2 Recv Date: 07/12/2002 TSD Site Recy Date: 07/12/2002 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000035444 Generator EPA ID: Trans1 EPA ID: NJD002454544 Trans2 EPA ID: Not reported TSDF ID: 26676JENY F003 - UNKNOWN Waste Code:

Quantity: 00300 P - Pounds Units:

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Year: 2002

Document ID: NJA4045047 Manifest Status: Not reported 26676JENY Trans1 State ID: Trans2 State ID: 2809 Generator Ship Date: 08/03/2004 Trans1 Recv Date: 08/03/2004 Trans2 Recv Date: 08/13/2004 TSD Site Recy Date: 08/13/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000035444 Generator EPA ID: NYD064748304 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NJD002454 F003 - UNKNOWN Waste Code:

Quantity: 00450 Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 2004 Year:

Document ID: NJA4045048 Manifest Status: Not reported NYSDEC1A3 Trans1 State ID: Trans2 State ID: 2809 Generator Ship Date: 10/13/2004 Trans1 Recv Date: 10/13/2004 Trans2 Recy Date: 10/26/2004 TSD Site Recy Date: 10/26/2004 Part A Recv Date: Not reported

Distance

Elevation Site Database(s) EPA ID Number

TJ SIGNS UNLIMITED (Continued)

1001202872

EDR ID Number

 Part B Recv Date:
 Not reported

 Generator EPA ID:
 NYR000035444

 Trans1 EPA ID:
 NYD064748304

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD002454

 Waste Code:
 F003 - UNKNOWN

Quantity: 00400 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Year: 2004

Document ID: Not reported Manifest Status: Not reported NYD064748304 Trans1 State ID: Trans2 State ID: NJD080631369 Generator Ship Date: 2008-07-10 Trans1 Recv Date: 2008-07-10 Trans2 Recv Date: 2008-07-18 TSD Site Recy Date: 2008-07-18 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000035444 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 900.0 Units: P - Pounds

Number of Containers: 2.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2008

Manifest Tracking Num: 004072169JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: MAK0136440

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: P207061IL
Trans2 State ID: Not reported
Generator Ship Date: 971111
Trans1 Recv Date: 971111

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

TJ SIGNS UNLIMITED (Continued)

1001202872

S105265208

N/A

NY SWF/LF

Trans2 Recv Date: Not reported TSD Site Recv Date: 971114 Part A Recv Date: Not reported Part B Recv Date: 971211 Generator EPA ID: NYR000035444 Trans1 EPA ID: NJD080631369 Trans2 EPA ID: Not reported TSDF ID: MAD053452637 Waste Code: F003 - UNKNOWN

Quantity: 00215

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

B6 KENNETH P. EDWARDS SSE 1580 FIFTH AVE.

< 1/8 0.049 mi.

261 ft. Site 1 of 2 in cluster B

Relative: SWF/LF:

Lower Flag: ACTIVE Region Code: 1

BAYSHORE, NY 11706

Actual: Phone Number: 6316662578

65 ft. Owner Name: Kenneth P. Edwards

Owner Type: Private

Owner Address: 1580 Fifth Avenue Owner Addr2: Not reported Owner City, St, Zip: Bayshore, NY 11706 Owner Email: Not reported Owner Phone: 6316662578 Kenneth P. Edwards Contact Name: Contact Address: Not reported Contact Addr2: Not reported NY Contact City, St, Zip:

Contact Email: Not reported Contact Phone: 6316662578

Activity Desc: C&D processing - registration

Activity Number: [52W31R]
Active: Yes
East Coordinate: 646648
North Coordinate: 4513048

Accuracy Code: 4.3 - Utilization of Digital Orthophoto Quads

Regulatory Status: Registration

Waste Type: Concrete; Asphalt; Brick

Authorization #: Not reported
Authorization Date: Not reported
Expiration Date: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

Y KENNETH P EDWARDS INC US MINES 1012128223 SSW N/A

SSW

< 1/8 SUFFOLK (County), NY

0.051 mi. 271 ft.

Relative: US MINES:

Lower Mine ID: 3003669

SIC code(s): 14410 00000 00000 00000 00000 00000

Actual: Entity name: K P EDWARDS MATERIAL 63 ft. Company: K ENNETH P EDWARDS INC

State FIPS code: NY
County FIPS code: SUFFOLK

Status: 2

Status date: 20090423
Operation Class: non-Coal Mining

Number of shops: 0 Number of plants: 0 Latitude: 40 45 18 Longitude: 073 15 48

Violations Details:

Violation Number: 8653407 Date Issued: 12/13/2011 Mine Status: Intermittent Status Date: 04/23/2009 Action Type: 104(a) Date Abated: 12/13/2011 Citation Citation/Order: Sig and Sub Designation: Proposed Penalty: 100.00 100.00 Paid Penalty: Assessment Status code: Closed Assess. Case Status code: Proposed Assessment Amount: 100.00 2011 Year:

Violation Number: 6534862 Date Issued: 04/23/2009 Mine Status: Intermittent Status Date: 04/23/2009 Action Type: 104(a) Date Abated: 05/05/2009 Citation/Order: Citation Sig and Sub Designation: 108.00 Proposed Penalty: Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated Assessment Amount: 0.00 2009 Year:

Violation Number: 6534863
Date Issued: 04/23/2009
Mine Status: Intermittent
Status Date: 04/23/2009
Action Type: 104(a)
Date Abated: 05/05/2009
Citation/Order: Citation

Distance Elevation

vation Site Database(s) EPA ID Number

KENNETH P EDWARDS INC (Continued)

1012128223

EDR ID Number

Sig and Sub Designation: N
Proposed Penalty: 100.00
Paid Penalty: 0.00
Assessment Status code: Closed
Assess. Case Status code: Vacated
Assessment Amount: 0.00
Year: 2009

Violation Number: 6534864 Date Issued: 04/23/2009 Mine Status: Intermittent Status Date: 04/23/2009 Action Type: 104(a) Date Abated: 05/05/2009 Citation/Order: Citation Sig and Sub Designation: Ν 100.00 Proposed Penalty: Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated Assessment Amount: 0.00 Year: 2009

Violation Number: 6534871 Date Issued: 04/23/2009 Mine Status: Intermittent Status Date: 04/23/2009 Action Type: 104(a) Date Abated: 05/05/2009 Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 100.00 Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated Assessment Amount: 0.00 2009 Year:

6534866 Violation Number: Date Issued: 04/23/2009 Mine Status: Intermittent Status Date: 04/23/2009 Action Type: 104(g)(1) Date Abated: 06/29/2010 Citation/Order: Order Sig and Sub Designation: Υ Proposed Penalty: 473.00 Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated Assessment Amount: 0.00 Year: 2009

Violation Number: 6534867
Date Issued: 04/23/2009
Mine Status: Intermittent
Status Date: 04/23/2009

Direction Distance

Elevation Site Database(s) EPA ID Number

KENNETH P EDWARDS INC (Continued)

1012128223

EDR ID Number

Action Type: 104(a) 05/28/2009 Date Abated: Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 100.00 Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated Assessment Amount: 0.00 Year: 2009

Violation Number: 6534868 Date Issued: 04/23/2009 Mine Status: Intermittent Status Date: 04/23/2009 Action Type: 104(a) Date Abated: 05/28/2009 Citation/Order: Citation Sig and Sub Designation: Ν 100.00 Proposed Penalty: Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated Assessment Amount: 0.00 Year: 2009

Violation Number: 6534869 Date Issued: 04/23/2009 Mine Status: Intermittent Status Date: 04/23/2009 Action Type: 104(a) Date Abated: 05/05/2009 Citation/Order: Citation Sig and Sub Designation: Ν 100.00 Proposed Penalty: Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated Assessment Amount: 0.00 Year: 2009

Date Issued: 04/23/2009 Mine Status: Intermittent Status Date: 04/23/2009 Action Type: 104(a) Date Abated: 06/26/2009 Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 100.00 Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated 0.00 Assessment Amount: Year: 2009

6534870

Violation Number:

Violation Number: 6534861

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

KENNETH P EDWARDS INC (Continued)

1012128223

Date Issued: 04/23/2009 Mine Status: Intermittent 04/23/2009 Status Date: Action Type: 104(a) Date Abated: 05/05/2009 Citation/Order: Citation Sig and Sub Designation: Υ Proposed Penalty: 108.00 Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated Assessment Amount: 0.00 Year: 2009

Violation Number: 6534865 Date Issued: 04/23/2009 Mine Status: Intermittent Status Date: 04/23/2009 Action Type: 104(a) 05/05/2009 Date Abated: Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 100.00 Paid Penalty: 0.00 Assessment Status code: Closed Assess. Case Status code: Vacated Assessment Amount: 0.00 Year: 2009

SUNOCO RCRA NonGen / NLR 1000328784 **1575 FIFTH AVENUE FINDS** NYD000701995

< 1/8 NORTH BAY SHORE, NY

0.064 mi.

B8

SSE

Site 2 of 2 in cluster B 338 ft.

RCRA NonGen / NLR: Relative:

Lower Date form received by agency: 01/01/2007

SUNOCO SERVICE STATION Facility name:

Actual: 1575 FIFTH AVE Facility address: 65 ft. NORTH BAY SHORE, NY 11706

> EPA ID: NYD000701995

Mailing address: FIFTH AVE

NORTH BAY SHORE, NY 11706

Contact: Not reported Contact address: FIFTH AVE

NORTH BAY SHORE, NY 11706

Contact country: US

Contact telephone: Not reported Not reported Contact email:

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: SUN OIL COMPANY OF PENNSYLVANIA

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

NY MANIFEST NY Spills

Distance

Elevation Site Database(s) EPA ID Number

SUNOCO (Continued) 1000328784

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: SUN OIL COMPANY OF PENNSYLVANIA

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Mixed waste (haz. and radioactive): No Recycler of hazardous waste: Nο Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: Nο Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: Nο Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: SUNOCO SERVICE STATION Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: SUNOCO SERVICE STATION Classification: Not a generator, verified

Date form received by agency: 08/18/1980

Facility name: SUNOCO SERVICE STATION Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110007993555

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport,

EDR ID Number

Direction Distance Elevation

ation Site Database(s) EPA ID Number

SUNOCO (Continued) 1000328784

and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

NY MANIFEST:

EPA ID: NYD000701995

Country: USA

Mailing Name: SUN REFINING & MARKETING

Mailing Contact: T W WILSON

Mailing Address: 400 EAGLES NEST ROAD

Mailing Address 2: Not reported Mailing City: BRIDGPORT

Mailing State: CT
Mailing Zip: 06607
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Country: USA

Mailing Phone: 800-688-9241

Document ID: NYB4441104
Manifest Status: Completed copy
Trans1 State ID: HL4120
Trans2 State ID: Not reported

 Generator Ship Date:
 920113

 Trans1 Recv Date:
 920113

 Trans2 Recv Date:
 Not reported

 TSD Site Recv Date:
 920113

 Part A Recv Date:
 Not reported

 Part B Recv Date:
 920123

 Generator EPA ID:
 NYD000701995

 Generator EPA ID:
 NYD000701995

 Trans1 EPA ID:
 NYD082785429

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD082785429

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00500

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 009

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 099
Waste Code: Not reported
Quantity: 00200
Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Document ID: NYB2134746
Manifest Status: Completed copy

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNOCO (Continued) 1000328784

Trans1 State ID: HL8142 Not reported Trans2 State ID: Generator Ship Date: 911007 Trans1 Recv Date: 911007 Trans2 Recv Date: Not reported TSD Site Recv Date: 911007 Part A Recv Date: Not reported Part B Recv Date: 911030

Generator EPA ID: NYD000701995 Trans1 EPA ID: NYD986893261 Trans2 EPA ID: Not reported NYD082785429 TSDF ID:

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00094

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

TT - Cargo tank, tank trucks Container Type:

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: Year: 91

Document ID: NYB6709536 Completed copy Manifest Status: HM3506 Trans1 State ID: Trans2 State ID: Not reported 941208 Generator Ship Date: Trans1 Recv Date: 941208 Trans2 Recv Date: Not reported TSD Site Recv Date: 941208 Part A Recv Date: 941223 Part B Recv Date: 941215

Generator EPA ID: NYD000701995 Trans1 EPA ID: NYD082785429 Trans2 EPA ID: Not reported TSDF ID: NYD082785429

D018 - BENZENE 0.5 MG/L TCLP Waste Code:

Quantity: 03200 Units: P - Pounds Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill. Specific Gravity: 100 Year: 94

Document ID: NJA2023050 Manifest Status: Completed copy

Trans1 State ID: S6993 Trans2 State ID: Not reported 941202 Generator Ship Date: Trans1 Recv Date: 941202 Trans2 Recv Date: Not reported TSD Site Recv Date: 941202 Part A Recv Date: 941219 Part B Recv Date: 941219

Generator EPA ID: NYD000701995

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNOCO (Continued) 1000328784

Trans1 EPA ID: NJD980772768
Trans2 EPA ID: Not reported
TSDF ID: NJD991291105

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 00330

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00660

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 012

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

SPILLS:

 Facility ID:
 9107410

 DER Facility ID:
 238046

 Facility Type:
 ER

 Site ID:
 294149

 DEC Region:
 1

Spill Date: 10/7/1991

Spill Number/Closed Date: 9107410 / 6/24/1999

Spill Cause: Other

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

SWIS: 5200
Investigator: CAMPBELL
Referred To: Not reported
Reported to Dept: 10/7/1991
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station

Spill Notifier: DEC Cleanup Ceased: Not reported Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False **UST Trust:** True Remediation Phase: 0 Date Entered In Computer: 11/1/1991 3/30/2004 Spill Record Last Update: Spiller Name: Not reported Spiller Company: SUNOCO

Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported

Spiller Address:

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CAMPBELL WELL"

Not reported

Remarks: 35-40 YDS ENCOUNTERED DURING REMOVAL HEAVY CONTAMINATION FOUND

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNOCO (Continued) 1000328784

Material:

294149 Site ID: Operable Unit ID: 957869 Operable Unit: 01 Material ID: 419620 0009 Material Code: Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: True Site ID: 294149 Operable Unit ID: 957869 Operable Unit: 01 Material ID: 572754

1213A MTBE (METHYL-TERT-BUTYL ETHER) Material Name:

01634044 Case No.:

Material FA: Hazardous Material Quantity: Not reported Units: Not reported Recovered: Not reported Resource Affected: Not reported Oxygenate: True

Tank Test:

Material Code:

C9 **NYSDEC SERVALL LAUNDRY SITE** 1000429187 **CERCLIS ENE 8 DRAYTON AVE** RCRA NonGen / NLR NYD068026657

< 1/8 BAY SHORE, NY 11706

0.086 mi.

CERCLIS:

Site 1 of 3 in cluster C 456 ft.

Relative: Lower

Site ID: 0201592 EPA ID: NYD068026657 Facility County: **SUFFOLK**

Actual: 67 ft.

Short Name: SERV-ALL LAUNDRY

Congressional District: 02

> IFMS ID: Not reported SMSA Number: 5380 USGC Hydro Unit: 02030202

Not a Federal Facility Federal Facility:

0.00000 DMNSN Number: Site Orphan Flag: Ν RCRA ID:

USGS Quadrangle: Not reported Site Init By Prog: Not reported NFRAP Flag: Not reported Parent ID: Not reported RST Code: Not reported

EPA Region: 02

Classification: Not reported **NY SHWS**

NY CBS

NY MANIFEST

Direction Distance

Elevation Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

Site Settings Code:

NPL Status:

DMNSN Unit Code:

RBRAC Code:

RResp Fed Agency Code:

Not reported

Not reported

Not reported

Not reported

Not reported

Non NPL Status: Site Reassessment Start Needed

Non NPL Status Date: 03/16/11 Site Fips Code: 36103 CC Concurrence Date: / /

CC Concurrence FY: Not reported Alias EPA ID: Not reported Site FUDS Flag: Not reported

CERCLIS Site Alias Name(s):

Alias ID: 101

Alias Name: SERV-ALL LAUNDRY

Alias Address: Not reported

SUFFOLK, NY

Alias Comments: Not reported

Site Description: As of 11/29/2006, O & M ongoing.

CERCLIS Assessment History:

Action Code: 001

Action: DISCOVERY

Date Started: / /

Date Completed: 03/25/86
Priority Level: Not reported
Operable Unit: SITEWIDE

Primary Responsibility: State, Fund Financed

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

Action Code: 001

Action: PRELIMINARY ASSESSMENT

Date Started: 03/25/86 Date Completed: 03/27/86

Priority Level: Higher priority for further assessment

Operable Unit: SITEWIDE

Primary Responsibility: State, Fund Financed

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

Action Code: 001

Action: SITE INSPECTION

 Date Started:
 03/31/89

 Date Completed:
 06/29/89

Priority Level: Higher priority for further assessment

Operable Unit: SITEWIDE

Primary Responsibility: EPA Fund-Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

RCRA NonGen / NLR:

Date form received by agency: 01/01/2007

Facility name: NYSDEC SERVALL LAUNDRY SITE

Facility address: 8 DRAYTON AVE

BAY SHORE, NY 117063030

EPA ID: NYD068026657
Mailing address: DRAYTON AVE

BAY SHORE, NY 11706

Contact: GERARD BURKE Contact address: DRAYTON AVE

BAY SHORE, NY 11706

Contact country: US

Contact telephone: (518) 457-9285 Contact email: Not reported

EPA Region: 02 Land type: State

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: NYS DEC
Owner/operator address: 50 WOLF RD

ALBANY, NY 12233

Owner/operator country: US

Owner/operator telephone: (518) 457-9285

Legal status: State
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NYS DEC
Owner/operator address: 50 WOLF RD

ALBANY, NY 12233

Owner/operator country: US

Owner/operator telephone: (518) 457-9285

Legal status: State
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Direction Distance

Elevation Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: NYSDEC SERVALL LAUNDRY SITE

Classification: Not a generator, verified

Date form received by agency: 03/03/1999

Facility name: NYSDEC SERVALL LAUNDRY SITE

Classification: Conditionally Exempt Small Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: Not reported

Area of violation: Generators - General

Date violation determined: 01/17/1984 Date achieved compliance: 01/17/1984 Violation lead agency: State Enforcement action: Not reported Enforcement action date: Not reported Enf. disposition status: Not reported Enf. disp. status date: Not reported Enforcement lead agency: Not reported Proposed penalty amount: Not reported Final penalty amount: Not reported Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 01/17/1984

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 01/17/1984 Evaluation lead agency: State

SHWS:

Program: HW Site Code: 55852

Classification: SITE IS PROPERLY CLOSED - REQUIRES CONTINUED MANAGEMENT

Region: 1
Acres: .200
HW Code: 152077
Record Add: 11/18/1999
Record Upd: 04/18/2013
Updated By: SLEDWARD

Site Description: Location: The ServAll Laundry site is located at 8 Drayton Avenue in

the Village of Bay Shore (Town of Islip) in Suffolk County, New York.Site:The two-story, former ServAll building occupies

approximately 8,000 square feet of a paved 22,000-square-foot lot on

the south side of Drayton Avenue. Adjacent tenants include a

household moving company and a heavy equipment sales company to the west and east, respectively, and a private residence to the south.

The ServAll property is bordered by a chain link fence topped with barbed wire on the south and west sides. The north side of the property fronts Drayton Avenue, where the building is separated from the street by a small parking lot. The site slope is from zero to 2 percent to the southeast. Two storm water runoff drywells, two sanitary system cesspools, and one underground fuel tank are located

in the front yard parking area between the building and Drayton

Avenue. A driveway, shared by the adjacent commercial property to the

Map ID Direction Distance Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

east, provides access to the backyard of both properties. A second underground fuel tank is located behind the ServAll building in the backyard.Current Use(s):The site is located in a mixed-use industrial/commercial/residential area. The groundwater treatment system used for remediation was dismantled in April 2009 and all remaining chemicals from the pump and treat system were removed from the site by January 2010. The building is currently unoccupied. Historical Use(s): ServAll Laundry was a laundry/dry-cleaning business owned by Ralph Colantuoni. ServAll Uniform Rental, Inc. (ServAll Uniform), operated as a commercial laundry from 1969 to 1972, and as a dry cleaner/laundry from 1972 to 1984. During this time, unknown quantities of wash water were pumped to, and occasionally overflowed from, three to 11 cesspools located outside and to the rear of the ServAll building without a State Pollution Discharge Elimination System (SPDES) permit. During 1978 and 1983, the Suffolk County Department of Health Services (SCDHS) conducted an on-site sampling of leachpools, cesspools and storm drains. The sampling data revealed that wastewater and sludge were contaminated with tetrachloroethylene (PCE or "perc.") at a level of 160 ppb, heavy metals, and vinyl chloride. In 1983, SCDHS, Bureau of Water Resources, located a vinyl chloride contaminated groundwater plume emanating southeast of the ServAll Laundry site. A plume of contamination has moved above a Suffolk County Water Authority Wellfield and is currently about two miles long. Analysis of the plume showed the presence of tetrachloroethylene. Until 1983, ServAll Uniform is believed to have continued illegal discharge and storage practices regardless of repeated notices from SCDHS. SCDHS alleged that discharges from ServAll Uniform resulted in groundwater contamination downgradient of the site. Although SCDHS personnel were denied access to the ServAll property for the purpose of installing monitoring wells to confirm the source of groundwater contamination, ServAll Uniform cleaned the on-site storm drains and an unknown number of cesspools, removing sludge and contaminated water in 1981. In 1984 the cesspools behind the building were backfilled and paved over.A state-funded Remedial Investigation/Feasibility Study (RI/FS) was completed and a Record of Decision was signed in March of 1992. The RI/FS confirmed the presence of trichloroethylene, dichloroethylene, dichloroethane, and vinyl chloride, and delineated the groundwater plume as well as quantified the on-site contamination. The ROD calls for soil vacuum extraction and groundwater pump and treat at the source area and a discharge study to be conducted on the front end of the plume. A State Funded remedial design began in December of 1992 and was completed in March of 1995. The groundwater pump and treat system construction began in October 1996 and began operating in March 1998. The site was reclassified to a class 4 in 1999. The operation of the treatment plant was suspended on November 28, 2001. In 2006, the treatment plant equipment was dismantled, and the treatment plant building vacated. The first full round of groundwater sampling was conducted for selected monitoring wells at this site in June 2006. An abbreviated round of sampling was conducted in April 2007 to confirm the concentration of tetrachloroethene (PCE) detected in monitoring well MW-6A. The second full round of groundwater samples were collected in August 2007. A soil vapor intrusion investigation was conducted in 2008 during the heating season. Groundwater continues to be sampled annually. Operable Unit(s): The site consists of one Operable Unit which includes the area of the onsite contaminated soil

Map ID Direction Distance Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

(treated by soil venting/vapor extraction) and groundwater(treated by collection, ultraviolet oxidation, and subsequent reinjection) Site Geology and Hydrogeology:The groundwater generally flows southeast across the site.

Env Problem:

Prior to RemediationIn 1978 and 1983, the Suffolk County Department of Health Services (SCDHS) conducted an on-site sampling of cesspools and storm drains. Results from some of the samples showed detections of PCE, trichloroethene (TCE), vinyl chloride (VC), chloroform, methylbenzenes, and a number of TAL metals. As indicated in the Record of Decision (ROD) (NYSDEC, 1992), ServAll Uniform cleaned the on-site storm drains and an unknown number of cesspools in 1981 removing sludge and contaminated water. In 1983, SCDHS performed an investigation in which a VOC plume was located southeast of the Site. The plume was found to extend 0.3 miles upgradient from the Suffolk County Water Authority (SCWA) Thomas Avenue Wellfield (located 1 mile south of the site). Subsequently, in 1984 the area behind the building was backfilled and paved over. The US Geological Survey (USGS) drilled and sampled a second series of wells in 1987 to better define the ServAll plume profile. The distal end of the plume was estimated at that time to be approximately 100 feet south of the Thomas Avenue Wellfield. The Thomas Avenue Wellfield is located off Thomas Avenue, near the Bay Shore Middle School and northwest of MW-11 (see Figure 2). A State-funded RI/FS was completed at the site. in which field work was completed from November 1990 through December 1991. The results of the investigation were documented in the final report dated January 1992 (E.C. Jordon Co.). The remedial investigation (RI)/feasibility study (FS) confirmed the presence of 1,2-dichloroethene (1,2-DCE), dichloroethane (DCA), TCE, PCE and VC in groundwater; delineated the groundwater plume, and quantified on-site contamination. Target cleanup levels for groundwater were set equal to New York States groundwater quality standards. Surface soil target clean-up levels were risk-based and developed to protect a site worker exposed by direct contact and incidental ingestion. Subsurface soil target clean-up levels were developed for PCE (PCE was the only chemical that presents a risk greater than the New York State Department of Health [NYSDOH] target level of 10-6). The plume is located in the upper glacial aguifer, which consists of coarsely stratified, fine to medium sand with trace amounts of gravel, cobbles, coarse sand, and silt. The aquifer ranges in thickness from 120 feet at the site to 86 feet 1.5 miles downgradient of the Site. Groundwater flows to the southeast towards Penataquit Creek, at about 910 feet per year (fpy). The RI concluded that the plume appeared to be moving at approximately 443 to 484 fpy from 1974 to 1988, and 355 fpy since 1988 (E.C. Jordan, October 1991). The ROD listed the cleanup criteria for PCE in soil as 40 mg/kg. The cleanup criteria for the six groundwater COCs were set to the NYS groundwater standards of 5 ?g/L, except for vinyl chloride where the target cleanup level is 2 ?g/L.Post Remediation During the approximate three-and-a-half year operation period of March 1998 through November 2001of the UVOX treatment system, over 127,000,000 gallons of groundwater were processed, based on the available data. The system operated almost continuously during this period, with a few temporary shut-downs due to equipment malfunctions and fouling of the reinjection well. Treatment system flow rates, averaged over approximate one-month intervals, ranged from 7.5 gpm to 211.5 gpm, with an overall average of 92 gpm. Average total VOC concentrations in the influent dropped by approximately 93 percent, from 245.7 ?g/L in

Map ID Direction Distance Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

1998 to 17 ?g/L at the end of operations in 2001. The concentrations in the effluent varied significantly over the period of operation. In summary, the recovery system at the Site removed and treated over 127,000,000 gallons of contaminated groundwater during its operation, removing approximately 126 pounds of VOCs in the process. Table. The system was taken off line in November 2001 after it was determined that the contaminant plume at the site was outside the cone of influence of the extraction well, and that it was not cost effective to keep the system operational. Post system operation groundwater monitoring was completed in June 2006 (12 monitoring wells), April 2007 (confirmation sampling event, 4 monitoring wells), August 2007 (11 monitoring wells), November 2008 (14 monitoring wells), February 2010 (14 monitoring wells including MW-1) and May 2011 (13 monitoring wells). Note that during the April 2007 sampling event that field personnel attempted unsuccessfully to open the extraction well located adjacent to monitoring well MW-7. Of the seven monitoring wells located near the former ServAll building (MW-2, MW-3A, MW-3B, MW- 4, MW-5, MW-6A, and MW-6B), VOCs were not detected in monitoring wells MW-3A, MW-3B, and MW-4 during any of the five long-term monitoring sampling events conducted to date at the ServAll Site. One exceedance of benzene was noted in MW-2. PCE was detected during the February 2010 sampling event at MW-6A and during the May 2011 sampling event at MW-2, but at concentrations below the criterion. Toluene was detected above the criterion at MW-5 during the November 2008 and February 2010 sampling events. Shallow monitoring well MW-6B has exhibited consistently high concentrations of PCE, TCE and cis-1,2-dichloroethene. Three wells (MW-12, MW-13 and MW-14) are located several blocks south of the Site along the Southern State Parkway. VOCs did not exceed criteria in MW-14. PCE exceeded the criteria once in MW-13. PCE exceeded the criterion in MW-12 during four of five sampling rounds with concentrations ranging from an estimated 1.6 ?g/L to 60 ?g/L. The four most downgradient wells, MW-11, MW-16, MW-23S and MW-23D had had exceedances of PCE with the highest concentrations noted in MW-23S (500 ?g/L to 5,200 ?g/L). Exceedance of TCE and cis-1,2-dichloroethene were also noted in these wells. In addition to the current groundwater monitoring program at the Site, two soil vapor investigations have been conducted since the shutdown of the groundwater pump and treat system. In January 2008, five soil vapor samples were collected from temporary soil vapor probes were installed adjacent to existing monitoring wells MW-6B, MW-11, MW-12, MW-16, and MW-23S Additionally, groundwater was sampled from each of the existing the five monitoring wells. Based on the levels of PCE and TCE measured in the soil vapor samples, NYSDEC directed the collection of indoor and outdoor air samples and subslab air samples at residences in the vicinity of the Site. Analytical results were compared to the guidance values listed in the NYSDOH Final Guidance for Evaluating Soil Vapor Intrusion (October 2006, and the June 2007 update). The NYSDOH guidance provides evaluation criteria for seven VOCs: carbon tetrachloride, 1,1-dichloroethene, cis-1,2-dichloroethene, 1,1,1- trichloroethane, PCE, TCE and vinyl chloride. In March 2009, subslab, indoor and outdoor air samples were collected at seven residences who agreed to participate in the sampling (27 properties were contacted), as well as the Site building. Results from Properties 1, 2 and 5 suggested no further action required when compared to the NYSDOH decision matrices (NYSDOH, October 2006), Results from Properties 6 and 7 found concentrations of carbon tetrachloride that prompt identify the

Direction Distance Elevation

Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

source and reduce exposure. Properties 3 and 4 warranted further monitoring due to the detected concentration of PCE in the subslab samples. High concentrations of PCE in the subslab sample collected beneath the ServAll Laundry building warrant mitigation when compared to the NYSDOH decision matrices. In February 2010, additional soil vapor intrusion sampling was completed at the site. The residence at Property 4 declined to participate; therefore sampling was only performed at Property 3. Initially, a pre-sampling building survey of the structure located on Property 3 was performed. Based on the findings of this survey, the same subslab and indoor air locations previously sampled were selected. Sampling at this property was conducted on February 24 to February 25, 2010. Based on the analytical results, several VOCs were detected in the indoor air, outdoor air, and subslab vapor samples. Detected VOCs included petroleum-related compounds, ketones, Freons, chlorinated compounds, alcohols and miscellaneous compounds (e.g., ethyl acetate, propene). The VOCs detected in this sampling event were similar to those detected in the previous (March 2009) event. PCE was detected in the subslab sample at a concentration that, when compared to NYSDOH Decision Matrix 2, prompts No Further Action or Identify the Potential Source(s) and Reduce Exposure. None of the other COPCs were detected in either the indoor air or subslab samples. When compared to NYSDOH Decision Matrices, no further action is suggested for this property

Health Problem:

Public water services the area of the site-related plume. The Suffolk County Department of Health Services did a private well survey in the area of the plume. Those residences with private wells were connected to public water. The Thomas Avenue wellfield is located one mile south of the site and the drinking water quality is routinely monitored by the Suffolk County Water Authority. The water quality has not been affected by the contaminant plume.

 Dump:
 False

 Structure:
 True

 Lagoon:
 False

 Landfill:
 False

 Pond:
 False

 Disp Start:
 1972

 Disp Term:
 1984

Lat/Long: 40:45:16:0 / 73:15:43:0

Dell: False

Record Add: 11/18/1999 12:00:00 PM Record Upd: 11/18/1999 12:00:00 PM

Updated By: INITIAL
Own Op: Disp. Owner

Sub Type: E

Owner Name: Ralph Colantuoni

Owner Company: SERVALL LAUNDRY, INC.

Owner Address: 8 Drayton Ave
Owner Addr2: Not reported
Owner City,St,Zip: Bay Shore, NY 11706
Owner Country: United States of America

Own Op: Owner Sub Type: E

Owner Name: c/o R. Colantuoni
Owner Company: 8 Drayton Ave., Inc.
Owner Address: 1167 Hillboro Mile
Owner Addr2: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

Owner City, St, Zip: Hillsboro Beach, FL 33062
Owner Country: United States of America

Own Op: Owner Sub Type: E

Owner Name: Ralph Colantuoni
Owner Company: 8 Drayton Ave, Inc.
Owner Address: 1149 Hillsboro Mile

Owner Addr2: Apt 609

Owner City,St,Zip: Pompano Beach, FL 33062 Owner Country: United States of America

Own Op: Owner Sub Type: E

Owner Name: William Lepido
Owner Company: 8 Drayton Ave, Inc.
Owner Address: 1051 Hillsboro Mile

Owner Addr2: Apt 707

Owner City,St,Zip: Pompano Beach, FL 33062
Owner Country: United States of America

Own Op: Owner Sub Type: E

Owner Name: R Colantuoni
Owner Company: 8 Drayton ave, Inc.
Owner Address: 1167 Hillsboro Mile
Owner Addr2: Not reported

Owner City,St,Zip: Hillsboro Beach, FL 33062
Owner Country: United States of America

HW Code: 152077

Waste Type: TETRACHLOROETHYLENE (PCE)

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 152077

Waste Type: VINYL CHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYD068026657

Cross Ref Type Code: 05

Cross Ref Type: EPA Site ID

Record Added Date: 5/10/2001 4:31:00 PM Record Updated: 2/24/2005 3:54:00 PM

Updated By: REGTRANS

NY MANIFEST:

EPA ID: NYD068026657

Country: USA

Mailing Name: SERV ALL CLEANERS INC Mailing Contact: RALPH COLANTUONI PRES.

Mailing Address: 8 DRAYTON AVE
Mailing Address 2: Not reported
Mailing City: BAY SHORE
Mailing State: NY

Mailing State: NY
Mailing Zip: 11706
Mailing Zip4: 3030
Mailing Country: USA

Mailing Phone: 516-666-3550

Document ID: Not reported

Direction Distance Elevation

Site Database(s) **EPA ID Number**

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

Manifest Status: Not reported NJ0000027193 Trans1 State ID: Not reported Trans2 State ID: Generator Ship Date: 2010-01-14 Trans1 Recv Date: 2010-01-14 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-01-14 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD068026657 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported

Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

1.0 Number of Containers:

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: L Landfill. Specific Gravity: 1.0 2010 Year:

003533919JJK Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported H141

Mgmt Method Type Code:

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 2010-01-14 Trans1 Recv Date: 2010-01-14 Not reported Trans2 Recv Date: TSD Site Recv Date: 2010-01-14 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD068026657 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported

Quantity: 5.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: L Landfill. Specific Gravity: 1.0 Year: 2010

Direction Distance Elevation

Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

003533919JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Tracking Num:

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported Manifest Status: Not reported NJ0000027193 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2010-01-14 Trans1 Recv Date: 2010-01-14 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-01-14 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD068026657 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported

Quantity: 15.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 003533919JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H061

Document ID: Not reported

Manifest Status: Not reported

Trans1 State ID: NJ0000027193

Trans2 State ID: Not reported

Generator Ship Date: 2010-01-14

Trans1 Recv Date: 2010-01-14

Trans2 Recv Date: Not reported

EDR ID Number

1000429187

Direction Distance

Elevation Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

TSD Site Recv Date: 2010-01-14 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD068026657 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported

Quantity: 30.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2010

Manifest Tracking Num: 003533919JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 2010-01-14 2010-01-14 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-01-14 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD068026657 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported

Quantity: 5.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2010

Manifest Tracking Num: 003533919JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N

Direction Distance Elevation

Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported Manifest Status: Not reported NJ0000027193 Trans1 State ID: Not reported Trans2 State ID: 2010-01-14 Generator Ship Date: Trans1 Recv Date: 2010-01-14 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-01-14 Part A Recy Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD068026657 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 1.0 Units: P - Pounds

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2010

Manifest Tracking Num: 003533919JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: NYO1029312 Completed copy Manifest Status: Trans1 State ID: NY10A14 Trans2 State ID: Not reported Generator Ship Date: 821102 Trans1 Recv Date: 821102 Trans2 Recv Date: Not reported TSD Site Recv Date: 821102 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD068026657 NYT000603894 Trans1 EPA ID: Trans2 EPA ID: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

TSDF ID: NYD000632232

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 00004

Units: Y - Cubic yards* (.85 tons)

Number of Containers: 001

Container Type: DT - Dump trucks
Handling Method: Not reported
Specific Gravity: 100
Year: 82

Document ID: NYO1029816 Completed copy Manifest Status: Trans1 State ID: NY1A014 Trans2 State ID: Not reported Generator Ship Date: 821101 Trans1 Recy Date: 821101 Trans2 Recv Date: Not reported TSD Site Recv Date: 821101 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD068026657 Generator EPA ID: Trans1 EPA ID: NYT000603894 Trans2 EPA ID: Not reported TSDF ID: NYD000632232

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 00013

Units: Y - Cubic yards* (.85 tons)

Number of Containers: 001

Container Type: DT - Dump trucks
Handling Method: Not reported

Specific Gravity: 100

Specific Gravity: 100 Year: 82

Document ID: NYO1029492 Manifest Status: Completed copy Trans1 State ID: NY1A014 Trans2 State ID: Not reported Generator Ship Date: 821019 Trans1 Recv Date: 821019 Trans2 Recv Date: Not reported TSD Site Recv Date: 821019 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD068026657 Generator EPA ID: Trans1 EPA ID: NYT000603894 Trans2 EPA ID: Not reported TSDF ID: NYD000632232 Waste Code: F001 - UNKNOWN

Quantity: 00475

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 010

Container Type: DM - Metal drums, barrels

Handling Method: Not reported Specific Gravity: 100 Year: 82

Direction Distance

Elevation Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

Document ID: NYO2291292 Manifest Status: Completed copy Trans1 State ID: 1A-042 Trans2 State ID: Not reported Generator Ship Date: 830228 Trans1 Recv Date: 830228 Trans2 Recv Date: Not reported 830228 TSD Site Recv Date: Part A Recv Date: 030308 Part B Recv Date: 030308 NYD068026657 Generator EPA ID: Trans1 EPA ID: NYD082785429 Trans2 EPA ID: Not reported

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 00220

Units: G - Gallons (liquids only)* (8.3 pounds)

NYD082785429

Number of Containers: 004

TSDF ID:

Container Type: DM - Metal drums, barrels

Handling Method: Not reported Specific Gravity: 100

Specific Gravity: 100 Year: 83

Document ID: NYO2289996 Completed copy Manifest Status: Trans1 State ID: 1A-042 Trans2 State ID: Not reported 830118 Generator Ship Date: 830118 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 830118 Part A Recv Date: 030127 Part B Recv Date: 030127 NYD068026657 Generator EPA ID:

 Trans1 EPA ID:
 NYD082785429

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD068026657

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 12000 Units: P - Pounds Number of Containers: 024

Container Type: DM - Metal drums, barrels

Handling Method: Not reported Specific Gravity: 100

Year: 83

Document ID: NYA6640402 Manifest Status: Completed copy AT-8756 Trans1 State ID: Trans2 State ID: Not reported 870410 Generator Ship Date: Trans1 Recv Date: 870410 Trans2 Recy Date: Not reported TSD Site Recy Date: 870410 Part A Recv Date: 870421

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

Part B Recv Date: 870421

NYD068026657 Generator EPA ID: ILD000805911 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NYD000708198

F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code:

00900 Quantity: Units: P - Pounds Number of Containers: 006

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 87

Document ID: NYA3280713 Completed copy Manifest Status:

IL009 Trans1 State ID: Trans2 State ID: Not reported 860923 Generator Ship Date: Trans1 Recv Date: 860923 Trans2 Recv Date: Not reported TSD Site Recy Date: 860923 Part A Recv Date: 860926 Part B Recv Date: 860926 Generator EPA ID: NYD068026657

Trans1 EPA ID: ILD000805911 Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

01350 Quantity: Units: P - Pounds Number of Containers: 009

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 86

Document ID: NYA3117780 Completed copy Manifest Status:

Trans1 State ID: IL009 Trans2 State ID: Not reported Generator Ship Date: 861114 Trans1 Recv Date: 861114 Trans2 Recv Date: Not reported TSD Site Recv Date: 861114 Part A Recv Date: 861120 Part B Recv Date: 861120 Generator EPA ID: NYD068026657

Trans1 EPA ID: ILD000805911 Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 01050 P - Pounds Units: Number of Containers: 007

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

Container Type: DF - Fiberboard or plastic drums (glass)

R Material recovery of more than 75 percent of the total material. Handling Method:

Specific Gravity: 100 Year: 86

NYA6615090 Document ID: Completed copy Manifest Status: Trans1 State ID: AT-8756 Trans2 State ID: Not reported 870320 Generator Ship Date: Trans1 Recv Date: 870320 Trans2 Recv Date: Not reported TSD Site Recv Date: 870320 Part A Recv Date: 870330 Part B Recv Date: 870326 NYD068026657 Generator EPA ID:

Trans1 EPA ID: ILD000805911 Trans2 EPA ID: Not reported NYD000708198 TSDF ID:

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 01350 Units: P - Pounds Number of Containers: 009

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 87

Document ID: NYA9095207 Manifest Status: Completed copy Trans1 State ID: AT8756 Trans2 State ID: Not reported 881020 Generator Ship Date: Trans1 Recv Date: 881020 Trans2 Recv Date: Not reported TSD Site Recv Date: 881020 Part A Recv Date: 881025 Part B Recv Date: 881025

Generator EPA ID: NYD068026657 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 03705 Units: P - Pounds Number of Containers: 019

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 88

Document ID: NYA9038373 Completed copy Manifest Status: Trans1 State ID: AT8756

Direction Distance Elevation

ation Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

Trans2 State ID: Not reported 880923 Generator Ship Date: Trans1 Recv Date: 880923 Trans2 Recv Date: Not reported TSD Site Recv Date: 880923 Part A Recv Date: 880929 Part B Recv Date: 880929 Generator EPA ID: NYD068026657 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00975 Units: P - Pounds Number of Containers: 005

Container Type: DF - Fiberboard or plastic drums (glass)

NYD000708198

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 88

TSDF ID:

Document ID: NYA9177118 Manifest Status: Completed copy Trans1 State ID: AT8756 Trans2 State ID: Not reported Generator Ship Date: 880728 Trans1 Recy Date: 880728 Trans2 Recv Date: Not reported 880728 TSD Site Recv Date: Part A Recv Date: 880802 Part B Recv Date: 880802 Generator EPA ID: NYD068026657 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00975 Units: P - Pounds Number of Containers: 005

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 88

Document ID: NYB5128155 Manifest Status: Completed copy Trans1 State ID: RK3198 Trans2 State ID: Not reported Generator Ship Date: 931103 Trans1 Recv Date: 931103 Trans2 Recv Date: Not reported TSD Site Recv Date: 931103 Part A Recv Date: 931126 Part B Recv Date: 931116 NYD068026657 Generator EPA ID: Trans1 EPA ID: NYD064743263

Direction Distance

Elevation Site Database(s) EPA ID Number

NYSDEC SERVALL LAUNDRY SITE (Continued)

1000429187

EDR ID Number

Trans2 EPA ID: Not reported
TSDF ID: NYD082785429
Waste Code: F005 - UNKNOWN

Quantity: 00030

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 93

Document ID: NYO2289321

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 1A-042 Trans2 State ID: Not reported Generator Ship Date: 821230 821230 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 821230 Part A Recv Date: 030106 Part B Recv Date: 030106

 Generator EPA ID:
 NYD068026657

 Trans1 EPA ID:
 NYD082785429

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD082785429

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 00320

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: Not reported Specific Gravity: 100 Waste Code: Not reported Quantity: 00800

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: Not reported Specific Gravity: 100 Year: 82

<u>Click this hyperlink</u> while viewing on your computer to access 40 additional NY_MANIFEST: record(s) in the EDR Site Report.

CBS:

CBS Number: 1-000484
Program Type: CBS
Facility Status: Unregulated
Expiration Date: N/A

Dec Region: 1

UTMX: 646755.08261000 UTMY: 4513108.1801500

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

C10 **SERVALL LAUNDRY** NY VAPOR REOPENED S104541579

N/A

ENE 8 DRAYTON AVENUE BAY SHORE, NY < 1/8

0.086 mi.

456 ft. Site 2 of 3 in cluster C

VAPOR REOPENED: Relative: Site Code: 152077 Lower

Facility Status: Underway

Actual: 67 ft.

NY CBS AST \$103039867 C11 **SERVALL PROJECT SITE ENE 8 DRAYTON AVENUE** N/A

< 1/8 BAY SHORE, NY 11706

0.086 mi.

456 ft. Site 3 of 3 in cluster C

CBS AST: Relative:

Lower

1-000484 CBS Number: ICS Number: Not reported

Actual: PBS Number: Not reported 67 ft. MOSF Number: Not reported SPDES Number: Not reported **ACTIVE FACILITY** Facility Status:

> Facility Type: UTILITY (631) 968-2701 Telephone: Facility Town: **ISLIP** Region: STATE 03/13/2000 **Expiration Date:**

Total Capacity of All Active Tanks(gal): 8400 Operator: PHILLIP SACHS, PLANT OPERATOR **Emergency Contact:** PHILLIP SACHS/SCOTT HAMARICH

Emergency Phone: (631) 436-8868

Owner Name: NYSDEC/DER/BHSC (ATTN: CARL HOFFMAN)

Owner Address: 50 WOLF ROAD Owner City, St, Zip: ALBANY, NY 12233 Owner Telephone: (518) 457-9538 Owner Type: State Government

Owner Sub Type: NYS Department of Environmental Conservation

H2M GROUP-HOME OFFICE Mail Name: 575 BROAD HOLLOW ROAD Mail Contact Addr:

Mail Contact Addr2: Not reported PHILLIP SACHS Mail Contact Contact: Mail Contact City, St, Zip: MELVILLE, NY 11747 Mail Phone: (631) 756-8000

Tank Id: 1 7664939 CAS Number: Federal ID: Not reported Tank Status: In Service Install Date: 02/98 Tank Closed: Not reported 2800 Capacity (Gal): Chemical: Sulfuric acid **ABOVEGROUND**

Tank Type: Fiberglass reinforced plastic [FRP]

Total Tanks: 3 Tank Secret: False

Tank Location:

Double-Walled Tank Containment: Tank Error Status: No Missing Data Date Entered: 03/12/1998

Direction Distance

Elevation Site Database(s) EPA ID Number

SERVALL PROJECT SITE (Continued)

S103039867

EDR ID Number

Certified Date: 03/13/1998

Substance: Single Hazardous Substance on DEC List

Internal Protection: None External Protection: None Aboveground Pipe Location: **PLASTIC** Pipe Type: Pipe Internal: None Pipe External: 0 Pipe Containment: None Pipe Flag: None

Leak Detection: Concrete Pad w/channels

Overfill Protection: None Haz Percent: 93

Last Test: Not reported
Due Date: Not reported
SWIS Code: 4728

Lat/Long: 40|45|26 / 73|15|43

Is Updated: False
Renew Date: Not reported
Is It There: False
Delinquent: False
Date Expired: Not reported

Owner Mark:

Certificate Needs to be Printed: 40|45|26 / 73|15|43
Fiscal Amt for Registration Fee Correct: 40|45|26 / 73|15|43
Renewal Has Been Printed for Facility: 40|45|26 / 73|15|43
Pre-Printed Renewal App Last Printed: 40|45|26 / 73|15|43

Tank Id: 3
CAS Number: 1310732
Federal ID: Not reported
Tank Status: In Service
Install Date: 02/98
Tank Closed: Not reported
Capacity (Gal): 2800

Chemical: Sodium hydroxide Tank Location: ABOVEGROUND

Tank Type: Fiberglass reinforced plastic [FRP]

Total Tanks: 3
Tank Secret: False

Tank Containment: Double-Walled
Tank Error Status: No Missing Data
Date Entered: 03/12/1998
Certified Date: 03/13/1998

Substance: Single Hazardous Substance on DEC List

Internal Protection:

External Protection:

Pipe Location:

Pipe Type:

PLASTIC

Pipe Internal:

Pipe External:

Pipe Containment:

None

None

None

None

Leak Detection: Concrete Pad w/channels

Overfill Protection: None Haz Percent: 25

Direction Distance

Elevation Site Database(s) EPA ID Number

SERVALL PROJECT SITE (Continued)

S103039867

EDR ID Number

Last Test: Not reported
Due Date: Not reported
SWIS Code: 4728

Lat/Long: 40|45|26 / 73|15|43

Is Updated: False
Renew Date: Not reported
Is It There: False
Delinquent: False
Date Expired: Not reported

Owner Mark: 1

Certificate Needs to be Printed: 40|45|26 / 73|15|43
Fiscal Amt for Registration Fee Correct: 40|45|26 / 73|15|43
Renewal Has Been Printed for Facility: 40|45|26 / 73|15|43
Pre-Printed Renewal App Last Printed: 40|45|26 / 73|15|43

Tank ld: 2

CAS Number: 7722841
Federal ID: Not reported
Tank Status: In Service
Install Date: 02/98
Tank Closed: Not reported
Capacity (Gal): 2800

Chemical: Hydrogen peroxide Tank Location: ABOVEGROUND

Tank Type: Fiberglass reinforced plastic [FRP]

Total Tanks: 3
Tank Secret: False

Tank Containment: Double-Walled
Tank Error Status: No Missing Data
Date Entered: 03/12/1998
Certified Date: 03/13/1998

Substance: Single Hazardous Substance on DEC List

Internal Protection: None **External Protection:** None Aboveground Pipe Location: **PLASTIC** Pipe Type: Pipe Internal: None Pipe External: 0 Pipe Containment: None Pipe Flag: None

Leak Detection: Concrete Pad w/channels

Overfill Protection: None Haz Percent: 50

Last Test: Not reported Due Date: Not reported

SWIS Code: 4728

Lat/Long: 40|45|26 / 73|15|43

Is Updated: False
Renew Date: Not reported
Is It There: False
Delinquent: False
Date Expired: Not reported

Owner Mark: 1

Certificate Needs to be Printed: 40|45|26 / 73|15|43 Fiscal Amt for Registration Fee Correct: 40|45|26 / 73|15|43 Renewal Has Been Printed for Facility: 40|45|26 / 73|15|43

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SERVALL PROJECT SITE (Continued)

S103039867

Pre-Printed Renewal App Last Printed: 40|45|26 / 73|15|43

U003538934 D12 **5TH AVE FAST LUBE** NY UST NNE 1608 5TH AVE **NY AST** N/A

SUFFOLK

BAY SHORE, NY 11706 < 1/8

0.091 mi.

478 ft. Site 1 of 9 in cluster D

SUFFOLK CO. UST: Relative:

Region: Higher Site Ref#: 14291 Actual: Status: ACTIVE 69 ft. Site Type: **PBS** Operating Permit Expires: 02/28/2014

Owner/Storage Information: **AVAILABLE**

Facility Info:

Site Ref#: 14291

Billing Contact: 5TH AVE LUBE CORP Billing Address: 1608 5TH AVE Billing Address: **BAY SHORE** Billing State: NY Billing Address: 11706

Storage Owner: 5TH AVE LUBE CORP Storage Owner Address: 1608 5TH AVE Storage Owner City: **BAY SHORE**

Storage Owner State: NY Storage Owner Zip: 11706

Tank Info:

Facility ID: 10001 Facility Reference #: 14291

Official Use: Removed Tank. 97

ISLIP Township:

0500 224.00 001 094.000 Tax Map No:

Region: SUFFOLK Permit to Operate: Not reported

Tank ID: 29068 Tank Key: Installed: Not reported Capacity: 000005000 Content: #2 FUEL OIL Date Removed: 020397 STEEL Construction: Dispenser: SUCTION Fill Type: **GRAVITY** Tank Location: **UNDER-OUT** Tabk Status: Not reported Total Capacity: 0000005000 Date Permitted: Not reported Not reported Date Closed: Not reported Internal Protection: Secondary Containment: Not reported **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported

Direction Distance Elevation

on Site Database(s) EPA ID Number

5TH AVE FAST LUBE (Continued)

U003538934

EDR ID Number

Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported GRAVITY Fill: 020397 Date Removed: Year Installed: Not reported

Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 1

Tank Key: Not reported Not reported Installed: Capacity: 5000 gallons Content: #2 FUEL OIL Date Removed: Not reported Construction: STEEL/ IRON Dispenser: SUCTION Fill Type: Not reported UNDER - OUT Tank Location: Tabk Status: REMOVED Total Capacity: 5000 gallons Date Permitted: Not reported Date Closed: 02/03/1997 NONE Internal Protection: Secondary Containment: NONE **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Not reported Spill Prevention: Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Not reported Pipe Containment: Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported Year Installed: Not reported

Tank ID: 2 Tank Key: 29069 Installed: Not reported 000000275 Capacity: Content: #2 FUEL OIL Date Removed: 020397 Construction: STEEL Dispenser: SUCTION Fill Type: **GRAVITY UNDER-OUT** Tank Location: Tabk Status: Not reported Total Capacity: 0000000275 Date Permitted: Not reported

Not reported

Description of drop records:

Direction Distance Elevation

Site Database(s) EPA ID Number

5TH AVE FAST LUBE (Continued)

U003538934

EDR ID Number

Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Not reported Pipe Leak Detection: Date Next Tank Test: Not reported **GRAVITY** Date Removed: 020397 Year Installed: Not reported

Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 2

Tank Key: Not reported Installed: Not reported Capacity: 275 gallons #2 FUEL OIL Content: Date Removed: Not reported Construction: STEEL/ IRON Dispenser: SUCTION Fill Type: Not reported Tank Location: **UNDER - OUT** Tabk Status: REMOVED Total Capacity: 275 gallons Date Permitted: Not reported Date Closed: 02/03/1997 Internal Protection: NONE Secondary Containment: NONE Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Fill: Not reported Date Removed: Not reported Year Installed: Not reported Description of drop records: Not reported

AST_SUFFOLK:

 Region:
 SUFFOLK

 Site Ref#:
 14291

 Status:
 ACTIVE

 Site Type:
 PBS

 Operating Permit Expires:
 02/28/2014

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

5TH AVE FAST LUBE (Continued)

U003538934

Owner/Storage Information: **AVAILABLE**

Facility Info:

Site Ref#: 14291

Billing Contact: 5TH AVE LUBE CORP Billing Address: 1608 5TH AVE Billing Address: **BAY SHORE** Billing State: NY

Billing Address: 11706 Storage Owner: 5TH AVE LUBE CORP

Storage Owner Address: 1608 5TH AVE Storage Owner City: **BAY SHORE**

Storage Owner State: NY Storage Owner Zip: 11706

Tank Info:

Facility ID: 10001 Facility Reference #: 14291 Township: **ISLIP** Tax Map No: 0500 **SUFFOLK** Region:

Tank ID: 3 Tank Key: 29070 Year Installed: Not reported Content: WASTE OIL Construction: Not reported Dispenser: SUCTION

Permitted Tank. Permit Runs Out. 05 Official Use:

Permit to Operate: 032100 Tank Location: ABOVE-IN Tabk Status: Not reported **Total Capacity:** 0000001000 Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported **Extrenal Protection:** Not reported Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Not reported Pipe External Protection: Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported PUMPED Fill: Date Removed: Not reported

Tank ID:

Tank Key: Not reported Year Installed: Not reported WASTE OIL Content: Construction: STEEL/ IRON Dispenser: SUCTION

Direction Distance

Elevation Site Database(s) EPA ID Number

5TH AVE FAST LUBE (Continued)

U003538934

EDR ID Number

Official Use: Not reported Not reported Permit to Operate: Tank Location: ABOVE - IN Tabk Status: IN SERVICE **Total Capacity:** 1000 gallons 03/21/2000 Date Permitted: Date Closed: Not reported NONE Internal Protection:

Secondary Containment: SECONDARY WALL - EPOXY COATED STEEL

Extrenal Protection: Not reported

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)
Overfill Prevention: - Electronic Leak Alarm - Sight/Level Gauge

Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Not reported Pipe External Protection: Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Tank ID: 4

Tank Key: Not reported Year Installed: Not reported MOTOR OIL Content: Construction: STEEL/ IRON Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported Tank Location: ABOVE - IN Tabk Status: IN SERVICE Total Capacity: 1000 gallons Date Permitted: 03/21/2000 Date Closed: Not reported Internal Protection: NONE

Secondary Containment: SECONDARY WALL - EPOXY COATED STEEL

Extrenal Protection: Not reported

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Overfill Prevention: - Sight/Level Gauge - Vent Whistle

Spill Prevention: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Tank ID: 4
Tank Key: 29071
Year Installed: Not reported
Content: MOTOR OIL
Construction: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

5TH AVE FAST LUBE (Continued)

U003538934

EDR ID Number

Dispenser: SUCTION

Official Use: Permitted Tank. Permit Runs Out. 05

Permit to Operate: 032100 Tank Location: ABOVE-IN Tabk Status: Not reported Total Capacity: 0000001000 Not reported Date Permitted: Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported **Extrenal Protection:** Not reported Leak Detection: Not reported Not reported Overfill Prevention: Spill Prevention: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Not reported Date Next Tank Test: Fill: **PUMPED** Date Removed: Not reported

Tank ID: Tank Key: Not reported Year Installed: Not reported Content: MOTOR OIL Construction: STEEL/ IRON SUCTION Dispenser: Official Use: Not reported Permit to Operate: Not reported Tank Location: ABOVE - IN Tabk Status: IN SERVICE **Total Capacity:** 500 gallons Date Permitted: 03/21/2000 Date Closed: Not reported Internal Protection: NONE

Secondary Containment: SECONDARY WALL - EPOXY COATED STEEL

Extrenal Protection: Not reported

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Overfill Prevention: - Sight/Level Gauge - Vent Whistle

Spill Prevention: Not reported Not reported Pipe Location: Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Not reported Fill: Date Removed: Not reported

Tank ID: 5
Tank Key: 29072
Year Installed: Not reported
Content: MOTOR OIL

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

5TH AVE FAST LUBE (Continued)

U003538934

Construction: Not reported SUCTION Dispenser:

Official Use: Permitted Tank. Permit Runs Out. 05

Permit to Operate: 032100 Tank Location: ABOVE-IN Not reported Tabk Status: 000000500 **Total Capacity:** Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported Not reported **Extrenal Protection:** Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Not reported Pipe Location: Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported PUMPED Fill: Date Removed: Not reported

Tank ID: 6

Tank Key: Not reported Year Installed: Not reported MOTOR OIL Content: STEEL/ IRON Construction: SUCTION Dispenser: Official Use: Not reported Permit to Operate: Not reported ABOVE - IN Tank Location: IN SERVICE Tabk Status: Total Capacity: 700 gallons Date Permitted: 03/21/2000 Date Closed: Not reported NONE Internal Protection:

SECONDARY WALL - EPOXY COATED STEEL Secondary Containment:

Extrenal Protection: Not reported

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Overfill Prevention: - Sight/Level Gauge - Vent Whistle

Spill Prevention: Not reported Not reported Pipe Location: Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Tank ID: 6 Tank Kev: 29073 Year Installed: Not reported

Distance

Elevation Site Database(s) EPA ID Number

5TH AVE FAST LUBE (Continued)

U003538934

EDR ID Number

Content: MOTOR OIL
Construction: Not reported
Dispenser: SUCTION

Official Use: Permitted Tank. Permit Runs Out. 05

Permit to Operate: 032100 ABOVE-IN Tank Location: Not reported Tabk Status: 000000700 **Total Capacity:** Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported Not reported Secondary Containment: Not reported **Extrenal Protection:** Leak Detection: Not reported Overfill Prevention: Not reported Not reported Spill Prevention: Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: **PUMPED** Date Removed: Not reported

Tank ID: 7

Tank Key: Not reported Year Installed: Not reported

Content: TRANSMISSION FLUID

STEEL/ IRON Construction: SUCTION Dispenser: Official Use: Not reported Permit to Operate: Not reported ABOVE - IN Tank Location: IN SERVICE Tabk Status: Total Capacity: 300 gallons Date Permitted: 03/21/2000 Date Closed: Not reported Internal Protection: NONE

Secondary Containment: SECONDARY WALL - EPOXY COATED STEEL

Extrenal Protection: PAINTED / COATED

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Overfill Prevention:

Spill Prevention:

- Sight/Level Gauge - Vent Whistle
SPILL/FILL BOX AND/OR SUMP

Pipe Location:

Pipe Type:

Not reported
Pipe External Protection:

Not reported
Pipe Containment:

Not reported
Pipe Leak Detection:

Not reported
Date Next Tank Test:

Not reported
Fill:

Not reported
Not reported
Not reported
Not reported

Tank ID: 7
Tank Key: 29074

Direction Distance

Elevation Site Database(s) EPA ID Number

5TH AVE FAST LUBE (Continued)

U003538934

EDR ID Number

Year Installed: Not reported

Content: TRANSMISSION FLUID

Construction: Not reported Dispenser: SUCTION

Official Use: Permitted Tank. Permit Runs Out. 05

Permit to Operate: 032100 ABOVE-IN Tank Location: Tabk Status: Not reported **Total Capacity:** 000000300 Date Permitted: Not reported Date Closed: Not reported Not reported Internal Protection: Secondary Containment: Not reported **Extrenal Protection:** Not reported Leak Detection: Not reported Not reported Overfill Prevention: Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported PUMPED Fill: Not reported Date Removed:

Tank ID: 8

Tank Key: Not reported Year Installed: Not reported Content: MOTOR OIL Construction: STEEL/ IRON Dispenser: SUCTION Official Use: Not reported Not reported Permit to Operate: Tank Location: ABOVE - IN Tabk Status: IN SERVICE **Total Capacity:** 500 gallons Date Permitted: 03/21/2000 Date Closed: Not reported Internal Protection: NONE

Secondary Containment: SECONDARY WALL - EPOXY COATED STEEL

Extrenal Protection: PAINTED / COATED

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Overfill Prevention: - Sight/Level Gauge - Vent Whistle
Spill Prevention: SECONDARY CONTAINMENT

Pipe Location:
Pipe Type:
Pipe External Protection:
Pipe Containment:
Not reported
Not reported
Not reported

Pipe Leak Detection: VISUAL MONITORING

Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

D13 EDR US Hist Auto Stat 1015254182 NNE 1608 5TH AVE EDR US Hist Auto Stat N/A

NNE 1608 5TH AVE < 1/8 BAY SHORE, NY 11706

0.091 mi.

478 ft. Site 2 of 9 in cluster D

Relative: EDR Historical Auto Stations:

Higher Name: 5 AVENUE LUBE INC

Year: 2001

Actual: Address: 1608 5TH AVE 69 ft.

Name: 5 AVENUE LUBE INC

Year: 2002

Address: 1608 5TH AVE

Name: 5 AVENUE LUBE INC

Year: 2003

Address: 1608 5TH AVE

Name: 5TH AVENUE LUBE INC

Year: 2004

Address: 1608 5TH AVE

Name: 5TH AVENUE LUBE INC

Year: 2005

Address: 1608 5TH AVE

Name: 5TH AVENUE LUBE INC

Year: 2006

Address: 1608 5TH AVE

Name: 5TH AVENUE LUBE INC

Year: 2007

Address: 1608 5TH AVE

Name: 5 AVENUE LUBE INC

Year: 2008

Address: 1608 5TH AVE

Name: 5 AVENUE LUBE INC

Year: 2009

Address: 1608 5TH AVE

Name: 5 AVENUE LUBE INC

Year: 2010

Address: 1608 5TH AVE

Name: 5 AVENUE LUBE INCORPORATED

Year: 2011

Address: 1608 5TH AVE

Name: 5 AVENUE LUBE INC

Year: 2012

Address: 1608 5TH AVE

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

E14 PARKWAY REDI MIX MASON SUPPLY NY AST A100383170
South 1580 FIFTH AVE

South 1580 FIFTH AVE < 1/8 BAY SHORE, NY 11706

0.091 mi.

Actual:

63 ft.

479 ft. Site 1 of 6 in cluster E

Relative: AST_SUFFOLK: Lower Region:

 Region:
 SUFFOLK

 Site Ref#:
 02199

 Status:
 ACTIVE

 Site Type:
 PBS

Operating Permit Expires: 07/31/2018
Owner/Storage Information: AVAILABLE

Facility Info:

Site Ref#: 02199

Billing Contact: PARKWAY REDI MIX MASON SUPPLY

Billing Address: 1580 FIFTH AVE
Billing Address: BAY SHORE

Billing State: NY
Billing Address: 11706

Storage Owner: PARKWAY REDI MIX MASON SUPPLY

Storage Owner Address: 1580 FIFTH AVE Storage Owner City: BAY SHORE

Storage Owner State: NY
Storage Owner Zip: 11706

Tank Info:

Facility ID: 02199
Facility Reference #: Not reported
Township: Not reported
Tax Map No: Not reported
Region: SUFFOLK

Tank ID:

Tank Key: Not reported Not reported Year Installed: KEROSENE Content: Construction: STEEL/ IRON Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: Tabk Status: IN SERVICE Total Capacity: 275 gallons Date Permitted: Not reported Date Closed: Not reported NONE Internal Protection:

Secondary Containment: DIKE - CONCRETE

Extrenal Protection: NONE

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Overfill Prevention: Not reported

Spill Prevention: SECONDARY CONTAINMENT
Pipe Location: ABOVEGROUND OUTDOORS ONLY

Pipe Type: GALVANIZED STEEL
Pipe External Protection: PAINT/COATED
Pipe Containment: NONE

Pipe Leak Detection: VISUAL MONITORING

Date Next Tank Test: Not reported

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

PARKWAY REDI MIX MASON SUPPLY (Continued)

A100383170

EDR ID Number

Fill: Not reported Date Removed: Not reported

Tank ID: 2

Not reported Tank Key: Year Installed: Not reported KEROSENE Content: Construction: STEEL/ IRON Dispenser: SUCTION Official Use: Not reported Not reported Permit to Operate: ABOVE - OUT Tank Location: Tabk Status: IN SERVICE Total Capacity: 275 gallons Date Permitted: Not reported Date Closed: Not reported Internal Protection: NONE

Secondary Containment: DIKE - CONCRETE

Extrenal Protection: NONE

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Overfill Prevention: Not reported

Spill Prevention: SECONDARY CONTAINMENT
Pipe Location: ABOVEGROUND OUTDOORS ONLY

Pipe Type: GALVANIZED STEEL
Pipe External Protection: PAINT/COATED

Pipe Containment: NONE

Pipe Leak Detection: VISUAL MONITORING

Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Tank ID: 3

Tank Key: Not reported Year Installed: Not reported Content: KEROSENE Construction: STEEL/ IRON Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported Tank Location: ABOVE - OUT Tabk Status: IN SERVICE 275 gallons **Total Capacity:** Date Permitted: Not reported Date Closed: Not reported Internal Protection: NONE

Secondary Containment: DIKE - CONCRETE

Extrenal Protection: NONE

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Overfill Prevention: Not reported

Spill Prevention: SECONDARY CONTAINMENT
Pipe Location: ABOVEGROUND OUTDOORS ONLY

Pipe Type: GALVANIZED STEEL
Pipe External Protection: PAINT/COATED

Pipe Containment: NONE

Pipe Leak Detection: VISUAL MONITORING

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

PARKWAY REDI MIX MASON SUPPLY (Continued)

A100383170

Date Next Tank Test: Not reported Fill: Not reported Not reported Date Removed:

Tank ID:

Tank Key: Not reported Not reported Year Installed: Content: KEROSENE Construction: STEEL/ IRON Dispenser: SUCTION Official Use: Not reported Not reported Permit to Operate: Tank Location: ABOVE - OUT IN SERVICE Tabk Status: Total Capacity: 275 gallons Date Permitted: Not reported Date Closed: Not reported Internal Protection: NONE

DIKE - CONCRETE Secondary Containment:

Extrenal Protection: NONE

VISUAL MONITORING (ABOVEGROUND TANK) Leak Detection:

Overfill Prevention: Not reported

SECONDARY CONTAINMENT Spill Prevention: ABOVEGROUND OUTDOORS ONLY Pipe Location:

GALVANIZED STEEL Pipe Type: Pipe External Protection: PAINT/COATED

Pipe Containment: NONE

VISUAL MONITORING Pipe Leak Detection:

Date Next Tank Test: Not reported Not reported Fill: Date Removed: Not reported

Tank ID: 5

Tank Key: Not reported Year Installed: Not reported Content: WASTE OIL STEEL/ IRON Construction: Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported Tank Location: ABOVE - IN IN SERVICE Tabk Status: **Total Capacity:** 250 gallons Date Permitted: Not reported Date Closed: Not reported Internal Protection: NONE

SECONDARY WALL - EPOXY COATED STEEL Secondary Containment:

Extrenal Protection: Not reported Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

PARKWAY REDI MIX MASON SUPPLY (Continued)

A100383170

EDR ID Number

Pipe Leak Detection:
Date Next Tank Test:
Not reported
Fill:
Not reported
Not reported
Not reported
Not reported

Tank ID: 6

Tank Key: Not reported Year Installed: Not reported Content: DIESEL STEEL/ IRON Construction: SUCTION Dispenser: Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: IN SERVICE Tabk Status: **Total Capacity:** 1000 gallons Date Permitted: Not reported Date Closed: Not reported NONE Internal Protection:

Secondary Containment: SECONDARY WALL - EPOXY COATED STEEL

Extrenal Protection: Not reported Not reported Leak Detection: Overfill Prevention: Not reported Not reported Spill Prevention: Not reported Pipe Location: Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

K.P. EDWARDS MATERIALS NY SHWS \$113916692

South 1580 5TH AVENUE < 1/8 BAY SHORE, NY 11706 0.091 mi.

479 ft. Site 2 of 6 in cluster E

Relative: Lower

Actual:

63 ft.

E15

SHWS:

Program: HW
Site Code: 375834
Classification: N
Region: 1
Acres: 1.300

Acres: 1.300
HW Code: 152210
Record Add: 01/09/2007
Record Upd: 02/07/2013
Updated By: RXSCHICK

Site Description: K.P. Edwards Materials (the Site) is located in town of Islip,

Suffolk County, New York. The site is an L-shaped lot occupying approximately 1.3 acres. It is bounded on the east by Fifth Avenue, on the north by Hubbard Power and Light, on the south by Americana Laundromat Cleaners and on the west by a vacant land. Hubbard Power and Light is a delisted State Superfund site. Americana Laundromat Cleaners has been investigated under the Voluntary Cleanup Program

N/A

Direction Distance

Elevation Site Database(s) EPA ID Number

K.P. EDWARDS MATERIALS (Continued)

S113916692

EDR ID Number

for PCE contamination in groundwater. In 2004, a remedial investigation of the Americana Laundromat identified elevated levels of tetrachloroethene (PCE) and trichloroethene (TCE) in groundwater and soil between KP Edwards and Americana. In 2009, a Preliminary Site Investigation completed on the KP Edwards property found no evidence of PCE disposal or impact to soil or groundwater on the

site. Owner letter sent 12/7/09 stating NFA.

Env Problem: Based upon the Site Characterization completed in 2009, PCE

concentrations in groundwater and soil have diminished to non-detectable levels. The site is up-gradient from the VCP site,

Americana Laundromat and Dry Cleaners.

Health Problem: Not reported Dump: Not reported Structure: Not reported Lagoon: Not reported Landfill: Not reported Not reported Pond: Disp Start: Not reported Disp Term: Not reported Lat/Long: Not reported Dell: Not reported Not reported Record Add: Not reported Record Upd: Updated By: Not reported Own Op: Not reported Sub Type: Not reported Owner Name: Not reported Owner Company: Not reported Owner Address: Not reported Owner Addr2: Not reported Owner City,St,Zip: Not reported Owner Country: Not reported HW Code: Not reported Waste Type: Not reported Not reported Waste Quantity: Waste Code: Not reported Crossref ID: Not reported Cross Ref Type Code: Not reported Cross Ref Type: Not reported Record Added Date: Not reported Record Updated: Not reported Updated By: Not reported

E16 FORMERLY AMERICANA LAUNDROMAT & CLEANER

South 1572 N 5TH AVE < 1/8 BAYSHORE, NY

0.109 mi.

576 ft. Site 3 of 6 in cluster E

Relative: RCRA NonGen / NLR:

Lower Date form received by agency: 01/01/2007

Facility name: AMERICANA LAUNDROMAT

Actual: Facility address: 1572 N 5TH AVE BAYSHORE, NY 11706

EPA ID: NYD981087380

Mailing address: N 5TH AVE

BAYSHORE, NY 11706

Contact: ROBERT FELICIANO

1000358735

NYD981087380

RCRA NonGen / NLR

NY MANIFEST

FINDS

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

Contact address: N 5TH AVE

BAYSHORE, NY 11706

US Contact country:

(516) 665-0871 Contact telephone: Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: **ROBERT FELICIANO**

Owner/operator address: 91 KOPF ST

BRENTWOOD, NY 11717

Owner/operator country: US

Owner/operator telephone: (516) 435-3064 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported

Owner/Op end date: Not reported

ROBERT FELICIANO Owner/operator name:

Owner/operator address: 91 KOPF ST

BRENTWOOD, NY 11717

Owner/operator country:

Owner/operator telephone: (516) 435-3064

Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: AMERICANA LAUNDROMAT Classification: Not a generator, verified

Date form received by agency: 11/04/1997

Facility name: AMERICANA LAUNDROMAT

Classification: Conditionally Exempt Small Quantity Generator

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

Violation Status: No violations found

FINDS:

Registry ID: 110004397812

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

HAZARDOUS WASTE BIENNIAL REPORTER

NY MANIFEST:

EPA ID: NYD981087380

Country: USA

Mailing Name: AMERICANA LAUNDROMAT Mailing Contact: AMERICANA LAUNDROMAT Mailing Address: 1572 NORTH FIFTH AVENUE

Mailing Address 2: Not reported Mailing City: BAYSHORE Mailing State: NY Mailing Zip: 11706 Mailing Zip4: Not reported Mailing Country: **USA**

Mailing Phone: 516-665-9658

Document ID: NYC5319077 Manifest Status: Not reported ILD984908202 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 07/13/1998 Trans1 Recv Date: 07/13/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 07/13/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981087380 Trans1 EPA ID: NYD000708198 Trans2 EPA ID: Not reported TSDF ID: **NYAT8756**

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00070 Units: P - Pounds 001

Number of Containers:

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 98 Year:

Document ID: NYC5434290

Direction Distance

Elevation Site Database(s) EPA ID Number

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

EDR ID Number

Manifest Status: Not reported Trans1 State ID: ILD984908202 Trans2 State ID: Not reported Generator Ship Date: 09/30/1998 Trans1 Recv Date: 09/30/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 09/30/1998 Part A Recy Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981087380 NYD000708198 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NYAT8756

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 98

Document ID: NYC2264229 Manifest Status: Completed copy Trans1 State ID: GE7532 Trans2 State ID: Not reported Generator Ship Date: 930419 930419 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 930419 Part A Recy Date: 930503 Part B Recv Date: 930428 Generator EPA ID: NYD981087380 ILD051060408 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00280
Units: P - Pounds
Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

NYC4092603 Document ID: Manifest Status: Completed copy Trans1 State ID: NYJE4744 Trans2 State ID: Not reported Generator Ship Date: 960516 960516 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 960516 960528 Part A Recv Date: Part B Recv Date: 960528

Direction Distance

Elevation Site Database(s) EPA ID Number

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

EDR ID Number

 Generator EPA ID:
 NYD981087380

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 96

Document ID: MIA4461077 Manifest Status: Not reported Trans1 State ID: NYD986969947 Trans2 State ID: Not reported Generator Ship Date: 07/11/2001 Trans1 Recv Date: 07/11/2001 Trans2 Recv Date: Not reported TSD Site Recv Date: 07/12/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD981557465 Generator EPA ID: MID048090633 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: 8922411NY

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 37920 Units: P - Pounds Number of Containers: 001

Container Type: DT - Dump trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 2001

Document ID: NYC1462904
Manifest Status: Completed copy

Trans1 State ID: AT8755 Trans2 State ID: Not reported Generator Ship Date: 920130 Trans1 Recv Date: 920130 Trans2 Recv Date: Not reported TSD Site Recv Date: 920130 Part A Recv Date: 920211 Part B Recv Date: 920211 Generator EPA ID: NYD981087380

 Generator EPA ID:
 NYD981087380

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00070
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Direction Distance

Elevation Site Database(s) EPA ID Number

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

EDR ID Number

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

NYC1933738 Document ID: Manifest Status: Completed copy Trans1 State ID: AT8756 Trans2 State ID: Not reported Generator Ship Date: 921110 Trans1 Recv Date: 921110 Trans2 Recv Date: Not reported TSD Site Recv Date: 921110 Part A Recv Date: 921124 Part B Recv Date: 921125 Generator EPA ID:

 Generator EPA ID:
 NYD981087380

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00070
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Document ID: NYA9741363

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: CT7869 Trans2 State ID: Not reported Generator Ship Date: 890922 Trans1 Recv Date: 890922 Trans2 Recv Date: Not reported TSD Site Recv Date: 890922 Part A Recv Date: 891116 Part B Recv Date: 890927 Generator EPA ID: NYD981087380 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140 Units: P - Pounds

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 89

Document ID: NYC0395921

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 000000000 Trans2 State ID: 000000000

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

Generator Ship Date: 900801 Trans1 Recv Date: 900801 Trans2 Recv Date: Not reported TSD Site Recv Date: 900801 Part A Recv Date: 900906 Part B Recv Date: 900817 NYD981087380 Generator EPA ID: Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708198

F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code:

Quantity: 00140 P - Pounds Units: Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 90

Document ID: NYC0830362 Manifest Status: Completed copy Trans1 State ID: AT8755 Trans2 State ID: Not reported 910308 Generator Ship Date: Trans1 Recv Date: 910308 Trans2 Recy Date: Not reported TSD Site Recv Date: 910308 Part A Recv Date: 910329 Part B Recv Date: 910320

NYD981087380 Generator EPA ID: Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

00140 Quantity: Units: P - Pounds Number of Containers: 002

DM - Metal drums, barrels Container Type:

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 91 Year:

Document ID: NYC0490792 Manifest Status: Completed copy Trans1 State ID: 00000000 Trans2 State ID: 00000000 Generator Ship Date: 900920 Trans1 Recy Date: 900920 Trans2 Recv Date: Not reported TSD Site Recv Date: 900920 901009 Part A Recv Date: Part B Recv Date: 900925

Generator EPA ID: NYD981087380 ILD051060408 Trans1 EPA ID: Trans2 EPA ID: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

EDR ID Number

TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 90

Document ID: NYC1105064 Manifest Status: Completed copy Trans1 State ID: AT8755 Trans2 State ID: Not reported Generator Ship Date: 910730 Trans1 Recy Date: 910730 Trans2 Recv Date: Not reported TSD Site Recv Date: 910730 910822 Part A Recv Date: Part B Recv Date: 910809

 Generator EPA ID:
 NYD981087380

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 91

Document ID: NYC1596802

Manifest Status: Completed copy

Trans1 State ID: GF1411

 Trans2 State ID:
 Not reported

 Generator Ship Date:
 920407

 Trans1 Recv Date:
 920407

 Trans2 Recv Date:
 Not reported

 TSD Site Recv Date:
 920407

 Part A Recv Date:
 920417

 Part B Recv Date:
 920417

 Generator EPA ID:
 NYD981087380

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00210
Units: P - Pounds
Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Direction Distance Elevation

Site Database(s) **EPA ID Number**

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

EDR ID Number

Document ID: NYA9176837 Manifest Status: Completed copy Trans1 State ID: AT8756 Trans2 State ID: Not reported Generator Ship Date: 880727 Trans1 Recv Date: 880727 Trans2 Recv Date: Not reported 880728 TSD Site Recy Date: Part A Recv Date: 880802 Part B Recv Date: 880802 NYD981087380 Generator EPA ID: Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00070 P - Pounds Units: 001 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 88

Document ID: NYC4963296 Manifest Status: Not reported Trans1 State ID: ILD984908202 Trans2 State ID: Not reported Generator Ship Date: 01/22/1998 Trans1 Recv Date: 01/22/1998 Not reported Trans2 Recv Date: TSD Site Recy Date: 01/22/1998 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD981087380 Generator EPA ID: NYD000708198 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: **NYAT8756**

F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code:

Quantity: 00140 Units: P - Pounds

Number of Containers: 002

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 98

Document ID: NYC4983197 Manifest Status: Not reported ILD984908202 Trans1 State ID: Trans2 State ID: Not reported 02/23/1998 Generator Ship Date: Trans1 Recv Date: 02/23/1998 Trans2 Recy Date: Not reported 02/23/1998 TSD Site Recy Date: Part A Recv Date: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

Part B Recv Date: Not reported NYD981087380 Generator EPA ID: Trans1 EPA ID: NYD000708198 Trans2 EPA ID: Not reported TSDF ID: **NYAT8756**

F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code:

00140 Quantity: P - Pounds Units: Number of Containers: 002

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 98

Document ID: NYC3901151 Manifest Status: Completed copy

JE4744 Trans1 State ID: Trans2 State ID: Not reported 950907 Generator Ship Date: Trans1 Recv Date: 950907 Trans2 Recy Date: Not reported TSD Site Recy Date: 950907 Part A Recv Date: 950919 Part B Recv Date: 950919

Generator EPA ID: NYD981087380 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

00140 Quantity: Units: P - Pounds Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Document ID: NYC1817381

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: GE7532 Trans2 State ID: Not reported 920818 Generator Ship Date: Trans1 Recv Date: 920818 Trans2 Recv Date: Not reported TSD Site Recv Date: 920818 Part A Recv Date: Not reported Part B Recv Date: 921019 Generator EPA ID: NYD981087380 ILD051060408 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00210 P - Pounds Units: Number of Containers: 003

Direction Distance

Elevation Site Database(s) EPA ID Number

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1000358735

EDR ID Number

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Document ID: NYC1958005 Completed copy Manifest Status: Trans1 State ID: GE7532 Trans2 State ID: Not reported Generator Ship Date: 921203 Trans1 Recv Date: 921203 Trans2 Recv Date: Not reported TSD Site Recv Date: 921203 Part A Recv Date: 921217 Part B Recv Date: 921215

 Generator EPA ID:
 NYD981087380

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140 Units: P - Pounds

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Document ID: NYC1703002 Manifest Status: Completed copy Trans1 State ID: GF1411 Trans2 State ID: Not reported 920713 Generator Ship Date: Trans1 Recv Date: 920713 Trans2 Recv Date: Not reported TSD Site Recv Date: 920713 Part A Recv Date: 920825 Part B Recv Date: 920722

 Generator EPA ID:
 NYD981087380

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD000708198

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00070
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Click this hyperlink while viewing on your computer to access 90 additional NY_MANIFEST: record(s) in the EDR Site Report.

Direction Distance

Distance EDR ID Number
Elevation Site EPA ID Number

E17 EDR US Hist Cleaners 1014999051

South 1572 5TH AVE N/A < 1/8 BAY SHORE, NY 11706

< 1/8 0.109 mi.

576 ft. Site 4 of 6 in cluster E

Relative:

EDR Historical Cleaners:

Lower N

Name: AMERICANA LAUNDROMAT

Year: 1999 Address: 1572

Actual: 61 ft.

1572 5TH AVE

Name: AMERICANA LAUNDROMAT

Year: 2000

Address: 1572 5TH AVE

Name: AMERICANA DRY CLEANERS

Year: 2007

Address: 1572 5TH AVE

Name: AMERICANA DRY CLEANERS

Year: 2009

Address: 1572 5TH AVE

Name: AMERICANA DRY CLEANERS

Year: 2011

Address: 1572 5TH AVE

Name: AMERICANA DRY CLEANERS

Year: 2012

Address: 1572 5TH AVE

E18 FORMERLY AMERICANA LAUNDROMAT & CLEANER RCRA NonGen / NLR 1010415692
South 1572 NORTH 5TH AVE NY MANIFEST NYD981557465

< 1/8 BAY SHORE, NY 11706

0.109 mi.

576 ft. Site 5 of 6 in cluster E

Relative: RCRA NonGen / NLR:

Relative: RCRA NonGen / NLR:
Lower Date form received by agency: 03/10/2008

Facility name: FORMERLY AMERICANA LAUNDROMAT & CLEANER

Actual: Facility address: 1572 NORTH 5TH AVE BAY SHORE, NY 11706

EPA ID: NYD981557465
Mailing address: NORTH 5TH AVE

SS: NORTH 5TH AVE BAY SHORE, NY 11706

Contact: ROBERT - FELICIANO
Contact address: NORTH 5TH AVE

BAY SHORE, NY 11706

Contact country: US

Contact telephone: (631) 484-1915 Contact email: Not reported

EPA Region: 02

Land type: Facility is not located on Indian land. Additional information is not known.

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No

Direction Distance

Elevation Site Database(s) EPA ID Number

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1010415692

EDR ID Number

Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 03/09/2008

Facility name: FORMERLY AMERICANA LAUNDROMAT & CLEANER

Classification: Not a generator, verified

Date form received by agency: 01/01/2006

Facility name: FORMERLY AMERICANA LAUNDROMAT & CLEANER

Site name: AMERICANA LAUNDROMAT & CLEANER

Classification: Not a generator, verified

Date form received by agency: 08/30/2002

Facility name: FORMERLY AMERICANA LAUNDROMAT & CLEANER

Site name: AMERICANA LAUNDROMAT & CLEANER

Classification: Large Quantity Generator

Date form received by agency: 05/24/2001

Facility name: FORMERLY AMERICANA LAUNDROMAT & CLEANER

Site name: AMERICANA LAUNDROMAT & CLEANER

Classification: Large Quantity Generator

Date form received by agency: 05/17/1995

Facility name: FORMERLY AMERICANA LAUNDROMAT & CLEANER

Site name: AMERICANA LAUNDROMAT & CLEANER

Classification: Not a generator, verified

Date form received by agency: 09/15/1986

Facility name: FORMERLY AMERICANA LAUNDROMAT & CLEANER

Site name: AMERICANA LAUNDROMAT & CLEANER

Classification: Large Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date: 12/06/2007

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:
Date achieved compliance:
Evaluation lead agency:

Not reported
Not reported
State

NY MANIFEST:

EPA ID: NYD981557465

Country: USA

Mailing Name: AMERICANA LAUNDROMAT & CLNRS

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

FORMERLY AMERICANA LAUNDROMAT & CLEANER (Continued)

1010415692

S113916691

N/A

NY SHWS

NY VCP

Mailing Contact: FRANK APARO Mailing Address: 1572 FIFTH AVE Mailing Address 2: Not reported Mailing City: BAY SHORE

Mailing State: NY Mailing Zip: 11706 Mailing Zip4: Not reported Mailing Country: **USA**

Mailing Phone: 631-435-3064

NY MANIFEST:

BAY SHORE, NY 11706

No Manifest Records Available

AMERICANA LAUNDROMAT AND DRY CLEANERS E19 South

1572 NORTH 5TH AVENUE

< 1/8 0.109 mi.

576 ft. Site 6 of 6 in cluster E

SHWS: Relative:

HW Program: Lower Site Code:

370039 Actual: Classification: Р 61 ft. Region: 1 Acres: .680 HW Code: 152208 Record Add: 09/11/2006

Record Upd: 10/23/2013 Updated By: **DJEVANS**

Site Description: Location: The Site is located at 1572 Fifth Avenue, Bay Shore, Town

of Islip, Suffolk County. The Site is 0.68 acres in area. Site Features: Currently the two story, slab-on-grade 5,000 ft2 building contains a hair cutting business, taxi stand and several unoccupied office type spaces. The remainder of the property is paved. Neighboring properties are commercial and residential in

nature.Current Zoning/Use: Current zoning and use is commercialPast

Use of the Site: The site was reportedly originally used as a residence in the 1940's or 1950's. The Dry cleaning operation started in the 1950s and stopped in 2000. In 2000 the laundromat and dry cleaning machines were removed and the dry cleaning operation became drop-off only. The dry cleaning business moved elsewhere in 2005.In June, 2002 the owner of the property applied to the voluntary cleanup program to conduct an investigation of the site and a voluntary

cleanup agreement was signed in November 2002 (see site # V00596 for details). Site Geology and Hydrogeology: Surficial deposits in the vicinity of the Site are mapped as outwash sand and gravel, consisting of stratified, well rounded, coarse to fine gravel with sand. Based on the Supplemental Sampling Report, tan-brown fine, medium to coarse sand and varying sizes of gravel were encountered to a depth of 20 feet below ground surface (bgs) at the Americana Laundromat site. Below the surficial deposits are coastal plain deposits, which consist of the Monmouth group, Matawan group, and Magothy formation. These groups and formation are generally composed

of silty clay, glauconitic sandy clay, sand, and/or grayel. Based on the reports, water levels in the vicinity of the Site are

approximately 22 to 24 feet bgs. In addition, based on a groundwater elevation map of the upper hydrogeologic zone, groundwater generally Map ID Direction Distance Elevation

Site

MAP FINDINGS

Database(s)

AMERICANA LAUNDROMAT AND DRY CLEANERS (Continued)

S113916691

EDR ID Number

EPA ID Number

Env Problem:

flows to the southeast both locally and regionally. Nature and Extent of Contamination: The only known source was the former on-site sanitary leaching pools. Pursuant to Suffolk County Department of Health Services (SCDHS) findings, this source was remediated in 2000. No other potential (on-site) sources other than the former on-site sanitary leaching pools were indentified; there were no investigations done inside the slab-on-grade building. The investigation has thus far revealed significant tetrachloroethene (PCE) contamination in on-site and off-site groundwater. The highest concentrations, in excess of 1000 ug/L in some cases, were found along the northern, upgradient, property line. Additionally, elevated PCE concentrations were found in indoor air in several on-site businesses. Mitigation actions have been implemented to address this problem and further sampling is planned to determine their efficacy. Soil The subsequent investigation revealed only minimal soil contamination on-site. Groundwater - The most recent groundwater sampling results show tetrachloroethene (PCE) concentrations as high as 540 ug/L and soil vapor concetrations as high as 440 ug/m3 for PCE at the downgradient boundary of the property. Elevated PCE concetrations were historically found at the upgradient property line at levels exceeding 1 ppm. More recent sampling events did not repeat those values. Data from a NYSDEC 2009 Site Characterization report for an upgradient site indicated a general absence of chlorinated VOCs in soil and groundwater samples collected at the KP Edwards property and at the former Hubbard Power and Light Co. The only soil detection of PCE at the KP Edwards property was at a concentration of 580 ug/kg (at 1-2 feet bgs) and PCE was detected in one groundwater sample at a concentration of 1.6 ug/l at the water table (depth ranged from 23-27 bgs). Soil Vapor and Indoor Air In 2002, Suffolk County Department of Health (SCDOH) collected a total of 13 indoor air samples from 8 locations on the site or in the vicinity of American Laundromat. Nine out of the 13 indoor air samples had none detectable levels of PCE. The remaining four indoor air samples had PCE concentrations ranging from 6 micrograms per cubic meter (ug/m3) [off-site downgradient basement sample] to 340 ug/m3 (off-site upgradient indoor air sample). Data from the 2009 SC report indicated that PCE was detected in all six soil vapor samples collected at the KP Edwards property, with concentrations ranging from 460 ug/m3 to 180,000 ug/m3. The highest concentration of PCE in soil vapor was sampled from a point located on the KP Edwards and Americana site property line. PCE was detected in two sub-slab soil vapor samples collected from beneath the KP Edwards building at a concentration of

Health Problem:

Contaminated groundwater at the site is not used for drinking or other purposes and the site is served by a public water supply that is not affected by this contamination. Volatile organic compounds in the contaminated groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Mitigative actions have been implemented to address impacts to indoor air quality in the on-site structure. However, these actions have not been evaluated for their effectiveness. Environmental sampling indicates soil vapor intrusion may be a concern for off-site buildings.

4.2 ug/m3 and 6, 100 ug/m3.

Dump: Not reported Not reported

Structure:

Direction Distance

Elevation Site Database(s) EPA ID Number

AMERICANA LAUNDROMAT AND DRY CLEANERS (Continued)

S113916691

EDR ID Number

Lagoon: Not reported Not reported Landfill: Pond: Not reported Disp Start: Not reported Disp Term: Not reported Not reported Lat/Long: Not reported Dell: Record Add: Not reported Record Upd: Not reported Updated By: Not reported Own Op: On-Site Operator

Sub Type: 01

Owner Name: ROBERT FELICIANO

Owner Company: GOODFELLOWS DRY CLEANER & LAUNDRY

Owner Address: 1572 NORTH 5TH AVENUE

Owner Addr2: Not reported

Owner City,St,Zip: BAY SHORE, NY 11706
Owner Country: United States of America

Own Op: Owner Sub Type: 01

Owner Name: ROBERT FELICIANO
Owner Company: MONSTROUS, INC.
Owner Address: P.O. BOX 1011
Owner Addr2: Not reported

Owner City,St,Zip: BAY SHORE, NY 11706
Owner Country: United States of America

HW Code: Not reported Waste Type: Not reported Waste Quantity: Not reported Waste Code: Not reported Crossref ID: Not reported Cross Ref Type Code: Not reported Cross Ref Type: Not reported Record Added Date: Not reported Not reported Record Updated: Updated By: Not reported

VCP:

VCP Program Type: Site Code: 57130 HW Code: V00596 Site Class: SWIS: 5228 Region: Town: Islip Acres: .680 06/13/2002 Date Record Added: Date Record Updated: 09/13/2006 **RHFILKIN** Updated By:

Site Description: The subsequent investigation revealed only minimal soil contamination

on-site. Groundwater samples taken in September 2003 at the same location as the 7,770 ppb of PCE sample from 11/01 were 18 ppb at the water table and 232 ppb of PCE and it's breakdown products 30 feet below the water table, with a similar result from a sample taken just upgradient of the leaching pool. A sample taken at the northern, hydraulically upgradient property line adjacent to the KP Edwards building had multiple shallow gorudwater samples with concentrations

Direction Distance

Elevation Site Database(s) EPA ID Number

AMERICANA LAUNDROMAT AND DRY CLEANERS (Continued)

S113916691

S108146759

N/A

EDR ID Number

of PCE in excess of 1,000 ppb without a source area in the on-site soils. Therefore a separate investigation for an upgradient source area has been begun by NYSDEC. An off-site groundwater investigation revealed no contamination beneath the church property immediately downgradient, but a sample taken approximately 200 feet downgradient of the site contained 164 ppb of PCE. Indoor air and sub-slab vapor sampling indicated elevated levels of PCE vapor in the on-site building. Adjustments were made to the HVAC system and the dry cleaning operation left the site. In November 2004 DEC and DOH requested that the volunteer resample the indoor air and sub-slab vapor in the on-site building. In the Fall of 2005, DEC requested that volunteer perform additional downgradient groundwater testing. The volunteer was unresponsive to these requests, and in June 2006 the voluntary agreement was terminated by DEC. This site will be addressed as an Inactive Hazardous Waste Disposal Site, # 152208.

Env Problem: The investigation has thus far revealed significant perchloroethene (PCE) contamination in on-site and off site groundwater. The highest

concentrations, in excess of 1000 parts per billion (ppb) in some cases, were found along the northern, upgradient, property line. Additionally, elevated PCE concentrations were found in indoor air in several on-site businesses. Mitigation actions have been

implemented to address this problem and further sampling is planned

to determine their efficacy.

Health Problem: Not reported

D20 HUBBARD WILSON LANDFILL NY HSWDS

NNE 1612 FIFTH AVENUE < 1/8 BAY SHORE, NY

0.110 mi.

580 ft. Site 3 of 9 in cluster D

Relative: HSWDS:

Higher Facility ID: Not reported Region: 1

Actual: Facility Status: None 69 ft. Owner Type: Puplic

Owner: Hubbard Sand and Gravel Corp.

Owner Address: 1612 Fifth Ave.
Owner Phone: Unknown
Operator Type: Same
Operator: Unknown
Operator: Unknown
Operator Phone: Unknown
EPA ID: NYD005923677

EPA ID: NYD005923677
Registry: D
Registry Site ID: 152008
RCRA Permitted: Unknown
Site Code: Municipal Landfill
Owner City State: Bay Shore
Operator City State: Not reported

Quadrange: Unknown Latitude: Unknown Longitude: Unknown Acres: 19.00 Operator Date: 1963 Close Date: 1986 Completed: Phase 2 Active: Nο

Direction Distance Elevation

tion Site Database(s) EPA ID Number

HUBBARD WILSON LANDFILL (Continued)

S108146759

EDR ID Number

PCB's Disposed: No Pesticides Disposed: Yes Metals Disposed: Yes Asbestos Disposed: No

Volatile Organic Compounds Disposed: Yes Semi Volatile Organic Compounds Disposed: Yes

Not reported Analytical Info Exists for Air: Analytical Info Exists for Ground: Groundwater Analytical Info Exists for Surface: Not reported Analytical Info Exists for Sediments: Not reported Analytical Info Exists for Surface: Surface Soil Analytical Info Exists for Substance: Subsurface Analytical Info Exists for Waste: Not reported Analytical Info Exists for Leachate: Not reported Analytical Info Exists for EP Toxicity: Not reported Analytical Info Exists for TCLP: Not reported Threat to Environment/Public Health: Unknown Surface Water Contamination: Unknown Surface Water Body Class: Unknown Groundwater Contamination: Unknown Groundwater Classification: Unknown **Drinking Water Contamination:** Unknown Drinking Water Supply is Active: Unknown Any Known Fish or Wildlife: No Hazardous Exposure: Yes Site Has Controlled Acess: Unknown Ambient Air Contamination: Unknown **Direct Contact:** Yes EPA Hazardous Ranking System Score: 1.8

Inventory: F

Nefrap: Not reported Mailing: Not reported Tax Map No: Not reported

Qualify: 0

Next Action: Not reported Not reported Agencies: Not reported Air: Building: Not reported Site Desc: Not reported Drink: Not reported Eptox: Not reported Fish: Not reported Ground: Not reported Not reported Ground Desc: Not reported Hazardous Threat: Haz Threat Desc: Not reported Leachate: Not reported Preparer: Not reported Sediment: Not reported Not reported Soil: Not reported Surface: Status: Not reported Not reported Surface Soil: Surface: Not reported TCLP: Not reported Waste: Not reported

Direction Distance

Distance EDR ID Number
Elevation Site EPA ID Number

D21 HUBBARD POWER AND LIGHT NY Spills S104499634
NNE 1612 5TH AVENUE N/A

1612 5TH AVENUE BAY SHORE, NY

0.110 mi.

< 1/8

580 ft. Site 4 of 9 in cluster D

Relative: SPILLS:

 Higher
 Facility ID:
 9503233

 DER Facility ID:
 185000

 Actual:
 Facility Type:
 ER

 69 ft.
 Site ID:
 223777

 DEC Region:
 1

Spill Date: 6/15/1995

Spill Number/Closed Date: 9503233 / 5/22/2000

Spill Cause: Housekeeping

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Unknown Responsible Party. Corrective action taken. (ISR)

SWIS: 5200
Investigator: WJPARISH
Referred To: Not reported
Reported to Dept: 6/14/1995
CID: Not reported
Water Affected: Not reported

Spill Source: Institutional, Educational, Gov., Other

Spill Notifier: DEC

Cleanup Ceased: Not reported Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: Date Entered In Computer: 6/16/1995 Spill Record Last Update: 1/27/2003 Spiller Name: Not reported

Spiller Company: HUBBARD POWER AND LIGHT

Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"PARISH/DECANDIA"SEE 94-12773 FACILITY CLOSURE BY SOLID WASTE/SCHD

Remarks: Not reported

Material:

 Site ID:
 223777

 Operable Unit ID:
 1017739

 Operable Unit:
 01

 Material ID:
 368283

 Material Code:
 0066A

Material Name: UNKNOWN PETROLEUM

Case No.:

Material FA:

Quantity:

Units:

Recovered:

Not reported

Petroleum

O

Gallons

No

Resource Affected: Not reported Oxygenate: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HUBBARD POWER AND LIGHT (Continued)

S104499634

U003538197

N/A

Tank Test:

HUBBARD ENTERPRISES D22 NNE **1612 5TH AVENUE** BAYSHORE, NY 11706 < 1/8

NY SHWS NY SWF/LF NY SWRCY

0.110 mi.

580 ft. Site 5 of 9 in cluster D

Relative:

SHWS:

Higher

Program: HW Site Code: 55811 Classification: Ν

Actual: 69 ft. Region: 38.000 Acres: HW Code: 152008

Record Add: 11/18/1999 Record Upd: 08/22/2005 Updated By: **EMZUK**

Site Description: This site is approximately 38 acres in size and is bordered by Fifth

Avenue to the east, a residential neighborhood to the west and industry to the north and south. The site has been the source of sand and gravel mining and C&D landfilling. There is also a co-generation plant at the site which burns wood pallets and produces electricity for sale to the local utility. Groundwater analysis from on -site monitoring wells has demonstrated high VOC levels coming onto this site from an upgradient source. There has been no documented disposal of hazardous waste at this site. The site did not qualify for addition

to the Registry of Inactive Hazardous Disposal Sites

Env Problem: There appears to be VOC contaminated groundwater coming onto this

site from an upgradient source. There are no environmental problems

associated with the disposal of hazardous waste on this site.

Health Problem: Not reported Not reported Dump: Structure: Not reported Lagoon: Not reported Landfill: Not reported Pond: Not reported Not reported Disp Start: Not reported Disp Term: Lat/Long: Not reported Not reported Dell: Not reported Record Add: Record Upd: Not reported Updated By: Not reported Own Op: Disp. Owner Sub Type: NNN

Not reported Owner Name: MARK KENNEDY Owner Company: Owner Address: Not reported Not reported Owner Addr2:

Owner City, St, Zip:

Owner Country: United States of America

Own Op: On-Site Operator

Sub Type:

Owner Name: Not reported MARK KENNEDY Owner Company:

Direction Distance

Elevation Site Database(s) EPA ID Number

HUBBARD ENTERPRISES (Continued)

U003538197

EDR ID Number

Owner Address: 1612 NORTH 5TH AVE.

Owner Addr2: Not reported

Owner City,St,Zip: BAY SHORE, NY 11706 Owner Country: United States of America

Own Op: Owner Sub Type: E

Owner Name: Not reported
Owner Company: Mark Kennedy
Owner Address: 1612 FIFTH AVENUE

Owner Addr2: Not reported

Owner City,St,Zip: BAY SHORE, NY 11706
Owner Country: United States of America
Own Op: On-Site Operator

Sub Type: NNN

Owner Name: Not reported

Owner Company: Hubbard Sand & Gravel Corp.
Owner Address: 1612 North 5th Avenue

Owner Addr2: Not reported

Owner City,St,Zip: Bay Shore, NY 11706
Owner Country: United States of America

HW Code: Not reported Waste Type: Not reported Waste Quantity: Not reported Waste Code: Not reported Crossref ID: Not reported Cross Ref Type Code: Not reported Cross Ref Type: Not reported Record Added Date: Not reported Record Updated: Not reported Updated By: Not reported

SWF/LF:

Flag: INACTIVE

Region Code: 1

Phone Number: 6319691401

Owner Name: Hubbard Sand & Gravel Corp.

Owner Type: Private
Owner Address: 1612 Fifth Ave.
Owner Addr2: Not reported
Owner City,St,Zip: Bayshore, NY 11706
Owner Email: Not reported
Owner Phone: 6319691401
Contact Name: Theodore Hubbard

Contact Name: Theodore Hubbard
Contact Address: 1612 Fifth Ave.
Contact Addr2: Not reported
Contact City,St,Zip: Bayshore, NY 11706

Contact Email: Not reported Contact Phone: 6319691401

Activity Desc: Landfill - construction and demolition debris

Activity Number: [52D19] Active: No

East Coordinate: Not reported North Coordinate: Not reported Accuracy Code: Not reported Regulatory Status: Waste Type: Not reported

Authorization #: 31

Direction Distance

Elevation Site Database(s) **EPA ID Number**

HUBBARD ENTERPRISES (Continued)

Authorization Date: 07/11/1980 07/11/1983 **Expiration Date:**

SWRCY:

Region:

Facility Address 2: Not reported 6319691401 Phone Number: Owner Type: Private

Owner Name: Hubbard Sand & Gravel Corp.

Owner Address: 1612 Fifth Ave. Owner Address 2: Not reported Owner City, St, Zip: Bayshore, NY 11706 Not reported Owner Email: Owner Phone: 6319691401 Contact Name: Theodore Hubbard Contact Address: 1612 Fifth Ave. Contact Address 2: Not reported

Contact City, St, Zip: Bayshore, NY 11706 Contact Email: Not reported 6319691401 Contact Phone: RHRF - registration Activity Desc:

Activity Number: [52M08] Active: No

East Coordinate: Not reported North Coordinate: Not reported Accuracy Code: Not reported Closure Order Regulatory Status: Permit #: Not reported Auth. Date: Not reported **Expiration Date:** Not reported Not reported Waste Types:

D23 **HUBBARD SAND & GRAVEL CORP**

NNE 1612 5TH AVE BAY SHORE, NY 11706 < 1/8

0.110 mi.

580 ft. Site 6 of 9 in cluster D

AST_SUFFOLK: Relative: Region: Higher

SUFFOLK Site Ref#: 03540 Actual: **ACTIVE** Status: 69 ft. **PBS** Site Type:

Operating Permit Expires: 02/28/2017 Owner/Storage Information: **AVAILABLE**

Facility Info:

Site Ref#: 03540

Billing Contact: **HUBBARD SAND & GRAVEL CORP**

Billing Address: 1612 FIFTH AVE Billing Address: **BAY SHORE**

Billing State: NY 11706 Billing Address:

Storage Owner: **HUBBARD SAND & GRAVEL CORP**

Storage Owner Address: 1612 FIFTH AVE **BAY SHORE** Storage Owner City:

Storage Owner State: NY Storage Owner Zip: 11706 NY AST A100383205

N/A

EDR ID Number

U003538197

Direction Distance Elevation

Site Database(s) **EPA ID Number**

HUBBARD SAND & GRAVEL CORP (Continued)

A100383205

EDR ID Number

Tank Info:

Facility ID: 03540 Facility Reference #: Not reported Township: Not reported Tax Map No: Not reported **SUFFOLK** Region:

Tank ID:

Tank Key: Not reported Year Installed: Not reported Content: DIESEL Construction: STEEL/ IRON SUCTION Dispenser: Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: **REMOVED** Tabk Status: **Total Capacity:** 500 gallons Date Permitted: Not reported Date Closed: 12/31/1989 Internal Protection: NONE Secondary Containment: NONE **Extrenal Protection:** Not reported Not reported Leak Detection: Not reported Overfill Prevention: Spill Prevention: Not reported Not reported Pipe Location: Pipe Type: Not reported Pipe External Protection: Not reported Not reported Pipe Containment: Pipe Leak Detection: Not reported Not reported Date Next Tank Test: Fill: Not reported

Tank ID: 12

Date Removed:

Tank Key: Not reported Not reported Year Installed: Content: DIESEL STEEL/ IRON Construction: Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported ABOVE - IN Tank Location: IN SERVICE Tabk Status: **Total Capacity:** 1000 gallons 05/25/2000 Date Permitted: Not reported Date Closed: Internal Protection: NONE Secondary Containment: **DIKE - STEEL Extrenal Protection:** PAINTED / COATED

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Not reported

Overfill Prevention: - Sight/Level Gauge

SECONDARY CONTAINMENT Spill Prevention:

Pipe Location: **NO PIPING** Pipe Type: NONE

Direction Distance Elevation

ion Site Database(s) EPA ID Number

HUBBARD SAND & GRAVEL CORP (Continued)

A100383205

EDR ID Number

Pipe External Protection: NONE
Pipe Containment: NONE

Pipe Leak Detection: NONE (NON-EXEMPT)

Date Next Tank Test:

Fill:

Not reported

Not reported

Not reported

Not reported

Tank ID: 13

Tank Key: Not reported Year Installed: Not reported Content: DIESEL STEEL/ IRON Construction: Dispenser: Not reported Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location:

Tabk Status: UNREGISTERED - REMOVED

Total Capacity: 750 gallons Date Permitted: Not reported Date Closed: 05/21/2010 Internal Protection: NONE Secondary Containment: NONE **Extrenal Protection:** Not reported Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Not reported Fill: Date Removed: Not reported

Tank ID: 14

Tank Key: Not reported Year Installed: Not reported

Content: USED OIL FOR HEATING

Construction: STEEL/ IRON Dispenser: SUCTION Official Use: Not reported Not reported Permit to Operate: ABOVE - IN Tank Location: Tabk Status: IN SERVICE **Total Capacity:** 150 gallons Date Permitted: 01/28/2011 Date Closed: Not reported NONE Internal Protection: Secondary Containment: **DIKE - STEEL** NONE **Extrenal Protection:**

Leak Detection: VISUAL MONITORING (ABOVEGROUND TANK)

Overfill Prevention: - Sight/Level Gauge

Spill Prevention: SPILL/FILL BOX AND/OR SUMP
Pipe Location: ABOVEGROUND INDOORS ONLY

Direction Distance Elevation

Site Database(s) EPA ID Number

HUBBARD SAND & GRAVEL CORP (Continued)

A100383205

EDR ID Number

Pipe Type: BLACK STEEL
Pipe External Protection: NONE

Pipe Containment: NONE

NONE

Pipe Leak Detection: VISUAL MONITORING

Date Next Tank Test:

Fill:

Not reported

Not reported

Not reported

Not reported

Tank ID: 2

Tank Key: Not reported Not reported Year Installed: DIESEL Content: Construction: STEEL/ IRON Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: Tabk Status: REMOVED **Total Capacity:** 500 gallons Not reported Date Permitted: Date Closed: 12/23/1996 Internal Protection: NONE Secondary Containment: NONE **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported

Pipe Location:

Not reported
Pipe Type:

Not reported
Pipe External Protection:

Not reported
Pipe Containment:

Not reported
Pipe Leak Detection:

Not reported
Date Next Tank Test:

Not reported
Not reported
Pill:

Not reported
Not reported
Not reported
Not reported
Not reported

Tank ID: 3

Tank Key: Not reported Year Installed: Not reported Content: DIESEL Construction: STEEL/ IRON SUCTION Dispenser: Not reported Official Use: Permit to Operate: Not reported Tank Location: ABOVE - IN Tabk Status: REMOVED **Total Capacity:** 1000 gallons Date Permitted: Not reported Date Closed: 03/20/2000 Internal Protection: NONE NONE Secondary Containment: **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported

Direction Distance Elevation

n Site Database(s) EPA ID Number

HUBBARD SAND & GRAVEL CORP (Continued)

Pipe Location:

Pipe External Protection:

Pipe Containment:

Date Removed:

Tank Key:

Pipe Leak Detection:

Date Next Tank Test:

Pipe Type:

Fill:

Not reported

Not reported

Not reported

Not reported

Tank ID: 5

Not reported Year Installed: Content: MOTOR OIL Construction: STEEL/ IRON Dispenser: SUCTION Not reported Official Use: Permit to Operate: Not reported Tank Location: ABOVE - IN REMOVED Tabk Status: **Total Capacity:** 275 gallons Date Permitted: Not reported Date Closed: 05/21/2010 Internal Protection: NONE NONE Secondary Containment: Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Not reported Fill:

Tank ID: 6

Date Removed:

Tank Key: Not reported Year Installed: Not reported Content: WASTE OIL STEEL/ IRON Construction: SUCTION Dispenser: Official Use: Not reported Permit to Operate: Not reported Tank Location: ABOVE - IN Tabk Status: REMOVED Total Capacity: 275 gallons Not reported Date Permitted: Date Closed: 05/21/2010 NONE Internal Protection: Secondary Containment: NONE Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported

A100383205

EDR ID Number

Direction Distance Elevation

tion Site Database(s) EPA ID Number

HUBBARD SAND & GRAVEL CORP (Continued)

A100383205

EDR ID Number

Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Tank ID: 8

Tank Key: Not reported Year Installed: Not reported Content: DIESEL

Construction: REFER TO PAPER FILE

Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: Tabk Status: **REMOVED** Total Capacity: 1000 gallons Date Permitted: 07/12/1995 Date Closed: 12/23/1996 Internal Protection: NONE

Secondary Containment: REFER TO PAPER FILE

Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Not reported Pipe Location: Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Tank ID: 9

Tank Key: Not reported Year Installed: Not reported #2 FUEL OIL Content: STEEL/ IRON Construction: Dispenser: Not reported Official Use: Not reported Permit to Operate: Not reported Tank Location: ABOVE - IN Tabk Status: REMOVED 275 gallons **Total Capacity:** Date Permitted: Not reported 11/04/2009 Date Closed: Internal Protection: NONE Secondary Containment: NONE Extrenal Protection: Not reported Leak Detection: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HUBBARD SAND & GRAVEL CORP (Continued)

A100383205

Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Not reported Fill: Date Removed: Not reported

D24 HUBBARD SAND & GRAVEL CERC-NFRAP 1003863591 1612 FIFTH AVE NNE **US MINES** NYD005923677

< 1/8 BAY SHORE, NY 11706

0.110 mi.

580 ft. Site 7 of 9 in cluster D

Relative:

CERC-NFRAP:

Higher

0201486 Site ID:

Federal Facility: Not a Federal Facility Actual: NPL Status: Not on the NPL

69 ft. Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

CERCLIS-NFRAP Site Alias Name(s):

Alias Name: HUBBARD-WILSON (NYD980534481)

Alias Address: Not reported

NY

CERCLIS-NFRAP Assessment History:

ARCHIVE SITE Action:

Date Started: / / Date Completed: 01/23/96 Priority Level: Not reported

Action: HAZARD RANKING SYSTEM PACKAGE

Date Started: 04/01/83 Date Completed: Priority Level: Not reported

Action: SITE INSPECTION

04/01/83 Date Started: Date Completed: 04/01/83

Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

DISCOVERY Action: Date Started: 11 04/01/83 Date Completed: Priority Level: Not reported

PRELIMINARY ASSESSMENT Action:

Date Started: 04/01/83 Date Completed:

Priority Level: Low priority for further assessment

US MINES:

Direction Distance

Elevation Site Database(s) **EPA ID Number**

HUBBARD SAND & GRAVEL (Continued)

Mine ID: 3001117

14410 00000 00000 00000 00000 00000 SIC code(s):

HUBBARD SAND & GRAVE Entity name: Company: **HUBBARD SAND & GRAVEL**

State FIPS code: NY County FIPS code: SUFFOLK Status: 2

Status date:

20090417 Operation Class: non-Coal Mining

Number of shops: Number of plants: 0 Latitude: 40 45 25 Longitude: 073 15 52

Violations Details:

8573596 Violation Number: Date Issued: 08/10/2010 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(g)(1) 08/20/2010 Date Abated: Citation/Order: Order Sig and Sub Designation: Proposed Penalty: 1,052.00 Paid Penalty: 1,052.00 Assessment Status code: Closed Assess. Case Status code: Proposed Assessment Amount: 1,052.00 Year: 2010

Violation Number: 8573597 Date Issued: 08/10/2010 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(a) Date Abated: 08/11/2010 Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 100.00 Paid Penalty: 100.00 Assessment Status code: Closed Assess. Case Status code: Proposed Assessment Amount: 100.00 Year: 2010

Violation Number: 8573599 Date Issued: 08/10/2010 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(a) Date Abated: 08/20/2010 Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 176.00 Paid Penalty: 176.00 Assessment Status code: Closed Assess. Case Status code: Proposed

1003863591

EDR ID Number

Direction Distance Elevation

tance EDR ID Number vation Site Database(s) EPA ID Number

HUBBARD SAND & GRAVEL (Continued)

1003863591

Assessment Amount: 176.00 Year: 2010

Violation Number: 8573598 Date Issued: 08/10/2010 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(a) Date Abated: 08/11/2010 Citation/Order: Citation Sig and Sub Designation: Proposed Penalty: 117.00 Paid Penalty: 117.00 Assessment Status code: Closed Assess. Case Status code: Proposed Assessment Amount: 117.00 2010 Year:

Violation Number: 8656737 Date Issued: 05/23/2012 Mine Status: Intermittent Status Date: 04/17/2009 104(a) Action Type: Date Abated: 05/23/2012 Citation/Order: Citation Sig and Sub Designation: Υ Proposed Penalty: 108 Paid Penalty: 108 Assessment Status code: Closed Assess. Case Status code: Proposed Assessment Amount: 108 Year: 2012

Violation Number: 8656735 Date Issued: 05/23/2012 Mine Status: Intermittent 04/17/2009 Status Date: Action Type: 104(a) 05/25/2012 Date Abated: Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 100 Paid Penalty: 100 Assessment Status code: Closed Assess. Case Status code: Proposed Assessment Amount: 100 Year: 2012

Violation Number: 8656736 Date Issued: 05/23/2012 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(a) Date Abated: 05/23/2012 Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 100

Direction Distance Elevation

Site Database(s) **EPA ID Number**

HUBBARD SAND & GRAVEL (Continued)

1003863591

EDR ID Number

Paid Penalty: 100 Assessment Status code: Closed Assess. Case Status code: Proposed Assessment Amount: 100 Year: 2012

Violation Number: 6536101 Date Issued: 05/07/2009 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(b) Date Abated: 05/27/2009 Citation/Order: Order Sig and Sub Designation: Not reported Proposed Penalty: Not reported Paid Penalty: Not reported Not reported Assessment Status code: Assess. Case Status code: Not reported Assessment Amount: Not reported 2009

Year:

Violation Number: 6536102 05/07/2009 Date Issued: Mine Status: Intermittent 04/17/2009 Status Date: Action Type: 104(b) Date Abated: 08/03/2009 Citation/Order: Order Sig and Sub Designation: Not reported Proposed Penalty: Not reported Paid Penalty: Not reported Assessment Status code: Not reported Assess. Case Status code: Not reported Assessment Amount: Not reported Year: 2009

Violation Number: 6534900 Date Issued: 05/07/2009 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(b) Date Abated: 05/27/2009 Citation/Order: Order Sig and Sub Designation: Not reported Proposed Penalty: Not reported Paid Penalty: Not reported Assessment Status code: Not reported Assess. Case Status code: Not reported Assessment Amount: Not reported 2009 Year:

Violation Number: 6534896 Date Issued: 05/06/2009 Mine Status: Intermittent 04/17/2009 Status Date: Action Type: 104(b) Date Abated: 05/27/2009

Direction Distance Elevation

Site Database(s) EPA ID Number

HUBBARD SAND & GRAVEL (Continued)

1003863591

EDR ID Number

Citation/Order: Order
Sig and Sub Designation: Not reported
Proposed Penalty: Not reported
Paid Penalty: Not reported
Assessment Status code: Not reported
Assess. Case Status code: Not reported
Assessment Amount: Not reported
Year: 2009

Violation Number: 6534887 Date Issued: 05/06/2009 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(a) Date Abated: 05/07/2009 Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 100.00 Paid Penalty: 100.00 Assessment Status code: Closed Assess. Case Status code: Proposed Assessment Amount: 100.00 2009 Year:

Violation Number: 6534899 Date Issued: 05/06/2009 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(b) Date Abated: 05/28/2009 Citation/Order: Order Sig and Sub Designation: Not reported Proposed Penalty: Not reported Paid Penalty: Not reported Not reported Assessment Status code: Assess. Case Status code: Not reported Not reported Assessment Amount: Year: 2009

Violation Number: 6534898
Date Issued: 05/06/2009
Mine Status: Intermittent
Status Date: 04/17/2009
Action Type: 104(b)
Date Abated: 05/28/2009
Citation/Order: Order

Sig and Sub Designation: Not reported Proposed Penalty: Not reported Paid Penalty: Not reported Assessment Status code: Assess. Case Status code: Not reported Assessment Amount: Not reported Year: 2009

Violation Number: 6534897
Date Issued: 05/06/2009
Mine Status: Intermittent

Map ID MAP FINDINGS
Direction

Direction Distance Elevation

Site Database(s) EPA ID Number

HUBBARD SAND & GRAVEL (Continued)

1003863591

EDR ID Number

Status Date: 04/17/2009 Action Type: 104(b) Date Abated: 05/27/2009 Citation/Order: Order Sig and Sub Designation: Not reported Proposed Penalty: Not reported Paid Penalty: Not reported Assessment Status code: Not reported Assess. Case Status code: Not reported Assessment Amount: Not reported 2009 Year:

Violation Number: 6534886 Date Issued: 05/06/2009 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(a) 05/07/2009 Date Abated: Citation/Order: Citation Sig and Sub Designation: Ν Proposed Penalty: 100.00 Paid Penalty: 100.00 Assessment Status code: Closed Assess. Case Status code: Proposed Assessment Amount: 100.00

Year:

2009

Violation Number: 6534895 Date Issued: 05/06/2009 Mine Status: Intermittent 04/17/2009 Status Date: Action Type: 104(b) Date Abated: 05/27/2009 Citation/Order: Order Sig and Sub Designation: Not reported Not reported Proposed Penalty: Paid Penalty: Not reported Assessment Status code: Not reported Assess. Case Status code: Not reported Assessment Amount: Not reported Year: 2009

Violation Number: 6534894 Date Issued: 05/06/2009 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(b) Date Abated: 05/27/2009 Citation/Order: Order Sig and Sub Designation: Not reported Proposed Penalty: Not reported Paid Penalty: Not reported Assessment Status code: Not reported Assess. Case Status code: Not reported Assessment Amount: Not reported Year: 2009

Map ID MAP FINDINGS Direction

Distance Elevation Site Database(s)

HUBBARD SAND & GRAVEL (Continued)

1003863591

EDR ID Number

EPA ID Number

Violation Number: 6534893 Date Issued: 05/06/2009 Mine Status: Intermittent Status Date: 04/17/2009 Action Type: 104(b) Date Abated: 05/27/2009 Citation/Order: Order Sig and Sub Designation: Not reported

Proposed Penalty: Not reported Paid Penalty: Not reported Assessment Status code: Not reported Assess. Case Status code: Not reported Not reported Assessment Amount:

Year: 2009

Violation Number: 6534892 Date Issued: 05/06/2009 Mine Status: Intermittent Status Date: 04/17/2009 104(b) Action Type: 05/27/2009 Date Abated: Citation/Order: Order

Sig and Sub Designation: Not reported Proposed Penalty: Not reported Paid Penalty: Not reported Assessment Status code: Not reported Assess. Case Status code: Not reported Assessment Amount: Not reported 2009

Year:

Direction Distance

Elevation Site Database(s) **EPA ID Number**

HUBBARD SAND & GRAVEL (Continued)

1003863591

EDR ID Number

Click this hyperlink while viewing on your computer to access 37 additional US_MINES: record(s) in the EDR Site Report.

NORTHEAST RECYCLING CORP. NY SWF/LF S106123018 **1612 FIFTH AVENUE** N/A

NNE < 1/8 BAYSHORE, NY 11706

0.110 mi.

D25

580 ft. Site 8 of 9 in cluster D

SWF/LF: Relative:

ACTIVE Higher Flag: Region Code: 1

Actual: Phone Number: 6319690282 69 ft. William Zorn Owner Name:

Owner Type: Private Owner Address: 1612 Fifth Avenue

Owner Addr2: Not reported Owner City, St, Zip: Bayshore, NY 11706 Owner Email: Not reported Owner Phone: 6319690282 Contact Name: Carl Zorn Contact Address: Not reported Contact Addr2: Not reported

Contact City,St,Zip: NY

Contact Email: ZI245@yahoo.com Contact Phone: 6319690282

Activity Desc: C&D processing - registration

Activity Number: [52W96R] Active: Yes 646664 East Coordinate: North Coordinate: 4513257

Accuracy Code: 4.3 - Utilization of Digital Orthophoto Quads

Regulatory Status: Registration

Waste Type: Asphalt; Brick; Concrete; Rock; Soil (Clean); Wood (Brush/ Branches/ Trees/

Stumps) Authorization #: 52W96R 05/22/2001

Authorization Date: **Expiration Date:** Not reported

D26 UNK **NY Spills** S104786776 NNE **1612 5TH AVENUE** N/A

< 1/8 **BRENTWOOD, NY**

0.110 mi.

580 ft. Site 9 of 9 in cluster D

SPILLS: Relative:

Facility ID: 0407289 Higher DER Facility ID: 267213 Actual: Facility Type: ER 69 ft. Site ID: 332066 DEC Region:

> Spill Date: 9/30/2004

Spill Number/Closed Date: 0407289 / 10/15/2008 Spill Cause: Traffic Accident

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Direction Distance

Elevation Site Database(s) EPA ID Number

UNK (Continued) S104786776

SWIS: 5228
Investigator: BXDONOVA
Referred To: Not reported
Reported to Dept: 9/30/2004
CID: 408

Water Affected: Not reported Spill Source: Commercial Vehicle Spill Notifier: Fire Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: Date Entered In Computer: 10/7/2004 Spill Record Last Update: 6/2/2009

Spiller Name: CHIEF WINNING

Spiller Company: SAND AND GRAVEL PIT

Spiller Address: 1612 5TH AVE.
Spiller City,St,Zip: BRENTWOOD, NY
Spiller Company: 001

Contact Name: CHIEF WINNING
Contact Phone: (631) 273-7080

DEC Memo: BRENTWOOD FD PUT DOWN ABSORBANTS, SOME FUEL HAS ALREADY SOAKED INTO

GROUND. NO PUDDLES, TRUCK OPERATED BY MAE MATERIALS 605 EAST MAIN STREET KINGS PARK, 917-597-8720, FACILITY WHERE SPILL OCCURRED IS ASSOCIATED WITH NORTHEAST RECYCLING PO BOX 638 YAPHANK 11980, CONTACT: CARL ZORN, 631-969-0282NO CLEANUP DOCUMENTED, GW IMPACT

UNLIKELY, ADMINISTRATIVE CLOSURE

Remarks: A TRUCK TURNED OVER AND IS LEAKING DIESEL FUEL. CLEAN UP IS NOT IN

PROCESS YET.

332066

Material: Site ID:

> Operable Unit ID: 1094326 Operable Unit: 01 Material ID: 574439 Material Code: 8000 Material Name: Diesel Not reported Case No.: Petroleum Material FA: Quantity: 50 Units: Gallons Recovered: No Resource Affected: Not reported

Oxygenate: False

Tank Test:

 Facility ID:
 9506509

 DER Facility ID:
 283600

 Facility Type:
 ER

 Site ID:
 223778

 DEC Region:
 1

Spill Date: 8/26/1995

Spill Number/Closed Date: 9506509 / 8/31/1995

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

UNK (Continued) S104786776

Spill Cause: Unknown

Spill Class: Known release that creates a file or hazard. DEC Response. Willing

Responsible Party. Corrective action taken.

SWIS: 5200
Investigator: AYLEUNG
Referred To: Not reported
Reported to Dept: 8/26/1995
CID: Not reported
Water Affected: Not reported

Spill Source: Commercial/Industrial
Spill Notifier: Fire Department
Cleanup Ceased: 8/31/1995
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/29/1

Date Entered In Computer: 8/29/1995
Spill Record Last Update: 8/31/1995
Spiller Name: Not reported
Spiller Company: UNK

Spiller Address:
Spiller City,St,Zip:
Spiller Company:

Not reported
UPDATE, ZZ
999

Contact Name: Not reported Contact Phone: Not reported

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"LEUNG"08/31/95: REQUESTED DEC RESPONSE, REFERRED TO AIR & SCHD FOR

FOLLOWUP.

Remarks: WOOD CHIPS CONTAMINATED WITH UNK MATERIAL BURNING,

Material:

 Site ID:
 223778

 Operable Unit ID:
 1017271

 Operable Unit:
 01

 Material ID:
 364473

 Material Code:
 0066A

Material Name: UNKNOWN PETROLEUM

Case No.:

Material FA:

Quantity:

Units:

Recovered:

Not reported

Petroleum

O

Gallons

No

Resource Affected:

Not reported

Resource Affected: Not reported Oxygenate: False

Tank Test:

EDR ID Number

Direction Distance

Elevation Site Database(s) **EPA ID Number**

F27 **UNK/CLOSED FACTORY** NY Spills S104499376 **ENE 12 DRAYTON AVENUE**

N/A

EDR ID Number

BAY SHORE, NY < 1/8

0.114 mi.

604 ft. Site 1 of 3 in cluster F

Relative:

SPILLS:

9304210 Lower Facility ID: DER Facility ID: 256920

Facility Type: Actual: ER 67 ft. Site ID: 318719 DEC Region:

> Spill Date: 7/2/1993

Spill Number/Closed Date: 9304210 / 7/13/2004

Spill Cause: Unknown

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Unable/unwilling Responsible Party. Corrective action taken. (ISR)

SWIS: 5200 Investigator: **RDDECAND** Referred To: Not reported Reported to Dept: 7/2/1993 CID: Not reported Water Affected: Not reported Spill Source: Unknown Spill Notifier: DEC Cleanup Ceased: Not reported Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False

UST Trust: False Remediation Phase: Date Entered In Computer: 7/6/1993 Spill Record Last Update: 7/14/2004 Spiller Name: Not reported

Spiller Company: UNK/CLOSED FACTORY

Not reported Spiller Address:

Spiller City, St, Zip: 77 Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"DECANDIA"07/02/93: DWHR PAYING FOR DISPOSAL OF 28 ABANDONED DRUMS AT

FACTORY #8 WHICH IS A SUPERFUND SITE.

OIL IN AND AROUND DRYWELL BEHIND FACTORY #12 DRAYTON ACCESS AROUND Remarks:

EAST SIDE OF #8 ODHWR WORKING ON DRUMS,

Material:

Site ID: 318719 Operable Unit ID: 982660 Operable Unit: 01 397724 Material ID: Material Code: 0022

Waste Oil/Used Oil Material Name: Not reported Case No.: Material FA: Petroleum Quantity: n Units: Gallons

Recovered: No

Resource Affected: Not reported Oxygenate: False

Direction Distance

Elevation Site Database(s) **EPA ID Number**

UNK/CLOSED FACTORY (Continued)

S104499376

EDR ID Number

Tank Test:

MACHINERY VALVES F28 RCRA NonGen / NLR 1000872862

ENE 12 DRAYTON AVE **BAY SHORE, NY 11706** < 1/8

NYD987040813

0.114 mi.

Site 2 of 3 in cluster F 604 ft.

RCRA NonGen / NLR: Relative:

Date form received by agency: 01/01/2007 Lower

Facility name: MACHINERY VALVES

Actual: Facility address: 12 DRAYTON AVE 67 ft. BAY SHORE, NY 117063030

EPA ID: NYD987040813 Mailing address: W JOHN ST

HICKSVILLE, NY 11801

Contact: Not reported

Contact address: W JOHN ST

HICKSVILLE, NY 11801

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Handler: Non-Generators do not presently generate hazardous waste Description:

Owner/Operator Summary:

MACHINERY VALVES Owner/operator name: Owner/operator address: 520 W JOHN ST

HICKSVILLE, NY 11801

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

MACHINERY VALVES Owner/operator name: Owner/operator address: 520 W JOHN ST

HICKSVILLE, NY 11801

Owner/operator country: US

Owner/operator telephone: (212) 555-1212 Legal status: Private

Owner/Operator Type: Operator Not reported Owner/Op start date: Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Nο

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MACHINERY VALVES (Continued)

1000872862

Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

MACHINERY VALVES Facility name: Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: MACHINERY VALVES Classification: Not a generator, verified

Date form received by agency: 09/10/1993

Facility name: MACHINERY VALVES Classification: Small Quantity Generator

Violation Status: No violations found

F29 **MACHINERY VALUES INC RCRA NonGen / NLR** 1000890233 **ENE** 12 DRAYTON AVE **FINDS** NY0000286682

< 1/8 **BAY SHORE, NY**

0.114 mi.

Site 3 of 3 in cluster F 604 ft.

RCRA NonGen / NLR: Relative:

Date form received by agency: 01/01/2007 Lower

MACHINERY VALUES INC Facility name: Actual: Facility address: 12 DRAYTON AVE

67 ft.

BAY SHORE, NY 117063030

NY0000286682 EPA ID: Mailing address: W JOHN ST

HICKSVILLE, NY 11801

Contact: Not reported Contact address: W JOHN ST

HICKSVILLE, NY 11801

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: **GENE VALITT** Owner/operator address: 520 W JOHN ST

HICKSVILLE, NY 11801

US Owner/operator country:

Owner/operator telephone: (516) 938-5100 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Distance

Elevation Site Database(s) EPA ID Number

MACHINERY VALUES INC (Continued)

1000890233

EDR ID Number

Owner/operator name: GENE VALITT
Owner/operator address: 520 W JOHN ST

HICKSVILLE, NY 11801

Owner/operator country: US

Owner/operator telephone: (516) 938-5100
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Nο Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: MACHINERY VALUES INC Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: MACHINERY VALUES INC Classification: Not a generator, verified

Date form received by agency: 05/16/1994

Facility name: MACHINERY VALUES INC Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110009483415

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Direction Distance

Elevation Site Database(s) **EPA ID Number**

G30 **GERSHOW RECYCLING** NY Spills S104652834 North

MCADAM STREET & FIFTH AVE N/A

BAY SHORE, NY < 1/8

0.117 mi.

617 ft. Site 1 of 2 in cluster G

Relative: Higher

SPILLS: 0025056 Facility ID:

Actual: 69 ft.

DER Facility ID: 131742 Facility Type: ER Site ID: 155536 DEC Region:

Spill Date: 4/17/2000

Spill Number/Closed Date: 0025056 / 11/14/2007

Spill Cause: Unknown Spill Class: Known release that creates potential for fire or hazard. (Highly

Improbable)

SWIS: 5228

Investigator: **UNASSIGNED** Referred To: Not reported Reported to Dept: 5/16/2000 CID: Not reported Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Health Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: Date Entered In Computer: 5/16/2000

Spill Record Last Update: 5/23/2012 Spiller Name: IRA GERSHOWITZ Spiller Company: **GERSHOW RECYCLING** Spiller Address: 655 MUNCY AVE & COURT

Spiller City, St, Zip: WEST BABYLON, NY

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"UNASSIGNED 00-032"

DURING INVESTIGATION UNDER SCDHS OVERSIGHT THEY FOUND MTBE Remarks:

CONTAMINATION IN GROUNDWATER; SCDHS TO CONTINUE OVERSIGHT OF

INVESTIGATION AT THIS TIME.

Material:

Site ID: 155536 Operable Unit ID: 835883 Operable Unit: 01 Material ID: 540474 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

GERSHOW RECYCLING (Continued)

S104652834

Tank Test:

GERSHOW RECYCLING NY Spills S102099886 31

NNW **61 MCADAM STREET** N/A

< 1/8 **BAY SHORE, NY**

0.120 mi. 636 ft.

SPILLS: Relative:

9404922 Facility ID: Lower

DER Facility ID: 103262 Actual: Facility Type: ER 67 ft. Site ID: 118838 DEC Region:

> Spill Date: 4/20/1994

Spill Number/Closed Date: 9404922 / 10/19/2011

Spill Cause: Deliberate

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

SWIS: 5228

Investigator: Unassigned Not reported Referred To: Reported to Dept: 7/11/1994 CID: Not reported Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Health Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: n

7/12/1994 Date Entered In Computer: Spill Record Last Update: 10/20/2011 Spiller Name: Not reported

GERSHOW RECYCLING Spiller Company:

Spiller Address: Not reported

Spiller City, St, Zip: ZZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Memo: 8/9/07 FILE REASSIGNEDWELLS NOT INSTALLED UNDER DEC OVERSIGHT.

INVESTIGATION HANDLED BY SCHD

DISCOVERED THROUGH BORINGS TAKEN ON 4/20/94, AUTO CRUSHER ON SITE, Remarks:

ALLOWED GASOLINE & WASTE OIL TO SOAK INTO GROUND, FOR A LONG TIME,

Material:

Site ID: 118838 Operable Unit ID: 999206 Operable Unit: 01 Material ID: 381524 Material Code: 0013 Material Name: Lube Oil Case No.: Not reported Material FA: Petroleum Quantity: 0

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

GERSHOW RECYCLING (Continued)

S102099886

NY SWF/LF

S108146058

N/A

Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: False 118838 Site ID: Operable Unit ID: 999206 Operable Unit: 01 Material ID: 381525 Material Code: 0022

Material Name: Waste Oil/Used Oil Case No.: Not reported Petroleum Material FA: Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported

False Oxygenate:

Tank Test:

G32 **PHOENIX AUTO PARTS 7 MCADAM STREET** North < 1/8 **BAYSHORE, NY 11706** 0.125 mi.

660 ft. Site 2 of 2 in cluster G

Relative: Higher

SWF/LF: Flag:

ACTIVE Region Code:

Actual: 70 ft.

Phone Number: 6316660630 Owner Name: Charles Spitaliere

Owner Type: Private Owner Address: 41 Tide Court Owner Addr2: Not reported

Owner City, St, Zip: Wading River, NY 11792 www.PhoenixAutoParts.com Owner Email:

Owner Phone: 6316660630 Contact Name: Not reported Contact Address: Not reported Contact Addr2: Not reported Contact City,St,Zip: Not reported Contact Email: Not reported Contact Phone: Not reported Activity Desc: Vehicle Dismantling

Activity Number: [52J49] Active: Yes

East Coordinate: 646637 North Coordinate: 4513290 Accuracy Code: Not reported Regulatory Status: Not reported Waste Type: Not reported Authorization #: Not reported Authorization Date: Not reported **Expiration Date:** Not reported

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

H33 USA INDUSTRIES NY MANIFEST S108982842
South 1560 FIFTH AVENUE NY Spills N/A

1/8-1/4 BAY SHORE, NY 11706

0.141 mi.

744 ft. Site 1 of 2 in cluster H

Relative: Lower NY MANIFEST:

EPA ID: NYR000045385

Country: USA

Actual: 60 ft.

Mailing Name:

Mailing Contact:

Mailing Address:

Mailing Address 2:

Mailing City:

Mailing City:

Mailing State:

Mailing Zip:

Mailing Zip

Mailing Zip4: Not reported Mailing Country: USA

Mailing Phone: 516-231-3330

Document ID: Not reported Manifest Status: Not reported TXR000050930 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2010-09-15 2010-09-15 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 2010-09-20 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000045385 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported

Quantity: 110.0 Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 2.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 000337056CEX

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
H020

Document ID: Not reported Manifest Status: Not reported

Direction Distance Elevation

EDR ID Number

n Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

S108982842

Trans1 State ID: TXR000050930 Trans2 State ID: Not reported Generator Ship Date: 2010-02-17 Trans1 Recv Date: 2010-02-17 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-02-22 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000045385 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD002182897 TSDF ID: Waste Code: Not reported

Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 002231598SKS

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Not reported Document ID: Manifest Status: Not reported Trans1 State ID: TXR000050930 Trans2 State ID: Not reported 2010-04-28 Generator Ship Date: Trans1 Recv Date: 2010-04-28 Not reported Trans2 Recv Date: TSD Site Recv Date: 2010-05-03 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000045385 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD002182897 TSDF ID: Waste Code: Not reported 110.0 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 2.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 002270120SKS

Direction Distance Elevation

n Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

S108982842

EDR ID Number

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: TXR000050930 Trans2 State ID: Not reported 2010-03-03 Generator Ship Date: Trans1 Recv Date: 2010-03-03 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-03-08 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000045385 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0
Year: 2010

Manifest Tracking Num: 002316812SKS

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: TXR000050930 Trans2 State ID: Not reported Generator Ship Date: 2010-03-17 Trans1 Recv Date: 2010-03-17 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-03-22

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

USA INDUSTRIES (Continued)

S108982842

Part A Recv Date: Not reported Not reported Part B Recv Date: NYR000045385 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported Quantity: 165.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 3.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 002383345SKS

Import Ind: Ν **Export Ind:** Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Not reported Manifest Ref Num: Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H020

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: TXR000050930 Trans2 State ID: Not reported Generator Ship Date: 2010-07-21 Trans1 Recv Date: 2010-07-21 Not reported Trans2 Recv Date: 2010-07-26 TSD Site Recv Date: Not reported Part A Recv Date: Part B Recv Date: Not reported NYR000045385 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported

Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 2010 Year:

002415545SKS Manifest Tracking Num:

Import Ind: Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν

Direction Distance Elevation

Site Database(s) **EPA ID Number**

USA INDUSTRIES (Continued)

S108982842

EDR ID Number

Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H020

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: TXR000050930 Trans2 State ID: Not reported 2010-05-12 Generator Ship Date: 2010-05-12 Trans1 Recv Date: Trans2 Recv Date: Not reported 2010-05-17 TSD Site Recv Date: Part A Recv Date: Not reported Not reported Part B Recv Date: NYR000045385 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported 55.0

Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 003286672FLE

Import Ind: N **Export Ind:** Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: H020

Document ID: Not reported Not reported Manifest Status: TXR000050930 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2010-07-07 Trans1 Recv Date: 2010-07-07 Trans2 Recy Date: Not reported 2010-07-12 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000045385 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

S108982842

Waste Code: Not reported Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 003361554FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: TXR000050930
Trans2 State ID: Not reported
Generator Ship Date: 2010-08-04

Trans1 Recv Date: 2010-08-04 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-08-09 Not reported Part A Recv Date: Part B Recv Date: Not reported Generator EPA ID: NYR000045385 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897

Quantity: 55.0

Waste Code:

Units: G - Gallons (liquids only)* (8.3 pounds)

Not reported

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 003361708FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Direction Distance Elevation

nce EDR ID Number ation Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

S108982842

Document ID: Not reported Not reported Manifest Status: Trans1 State ID: TXR000050930 Trans2 State ID: Not reported Generator Ship Date: 2010-12-22 Trans1 Recv Date: 2010-12-22 Trans2 Recv Date: Not reported TSD Site Recy Date: 2010-12-30 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000045385 Generator EPA ID: Not reported Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported

Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 003627439FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H020

Document ID: Not reported Manifest Status: Not reported TXR000050930 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2010-11-24 Trans1 Recv Date: 2010-11-24 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-12-02 Not reported Part A Recv Date: Part B Recv Date: Not reported Generator EPA ID: NYR000045385 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported Quantity: 110.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 2.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0

Distance

Elevation Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

S108982842

EDR ID Number

Year: 2010

Manifest Tracking Num: 003668416FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported Manifest Status: Not reported TXR000050930 Trans1 State ID: Trans2 State ID: Not reported 2010-10-13 Generator Ship Date: Trans1 Recv Date: 2010-10-13 Trans2 Recv Date: Not reported TSD Site Recy Date: 2010-10-18 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000045385 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported Quantity: 110.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 2.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 004277186FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported

Manifest Status: Not reported

Trans1 State ID: TXR000081205

Trans2 State ID: Not reported

Generator Ship Date: 27-Mar-2013 00:00:00
Trans1 Recv Date: 27-Mar-2013 00:00:00

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

USA INDUSTRIES (Continued)

S108982842

Trans2 Recv Date: Not reported

01-Apr-2013 00:00:00 TSD Site Recv Date:

Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000045385 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported

Quantity: 55

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 2013

Manifest Tracking Num: 003308010SKS

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind:

Manifest Ref Num: Not reported Not reported Alt Fac RCRA Id: Alt Fac Sign Date: Not reported Mgmt Method Type Code: H020

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: TXR000081205 Trans2 State ID: Not reported

10-Apr-2013 00:00:00 Generator Ship Date: Trans1 Recv Date: 10-Apr-2013 00:00:00

Trans2 Recv Date: Not reported

TSD Site Recv Date: 15-Apr-2013 00:00:00

Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000045385 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported

Quantity: 55

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 2013

Manifest Tracking Num: 003308071SKS

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν

Direction Distance Elevation

Site Database(s) **EPA ID Number**

USA INDUSTRIES (Continued)

S108982842

EDR ID Number

Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: N

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H020

Document ID: Not reported Manifest Status: Not reported TXR000081205 Trans1 State ID: Trans2 State ID: Not reported

Generator Ship Date: 22-May-2013 00:00:00 22-May-2013 00:00:00 Trans1 Recv Date:

Trans2 Recv Date: Not reported

TSD Site Recy Date: 23-May-2013 00:00:00

Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000045385 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported 45

Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1 2013 Year:

Manifest Tracking Num: 003308245SKS

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H020

Document ID: Not reported Manifest Status: Not reported TXR000081205 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 16-Jan-2013 00:00:00

16-Jan-2013 00:00:00 Trans1 Recv Date: Trans2 Recv Date: Not reported

21-Jan-2013 00:00:00 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000045385 Generator EPA ID:

Not reported

Trans1 EPA ID:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

USA INDUSTRIES (Continued)

S108982842

Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Not reported Waste Code:

Quantity: 55

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 2013

003308531SKS Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H020

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: TXR000081205 Trans2 State ID: Not reported

27-Feb-2013 00:00:00 Generator Ship Date: Trans1 Recv Date: 27-Feb-2013 00:00:00

Trans2 Recv Date: Not reported

TSD Site Recy Date: 04-Mar-2013 00:00:00

Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000045385 Generator EPA ID: Not reported Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported

Quantity: 55

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity:

2013 Year:

Manifest Tracking Num: 003308877SKS

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Not reported Manifest Ref Num: Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

S108982842

EDR ID Number

Mgmt Method Type Code: H020

Document ID: Not reported

Manifest Status: Not reported

Trans1 State ID: TXR000081205

Trans2 State ID: Not reported

Generator Ship Date: 14-Aug-2013 00:00:00 Trans1 Recv Date: 14-Aug-2013 00:00:00

Trans2 Recv Date: Not reported

TSD Site Recv Date: 19-Aug-2013 00:00:00

Part A Recv Date:
Part B Recv Date:
Generator EPA ID:
Trans1 EPA ID:
Not reported
NyR000045385
Not reported
NyD002182897
Waste Code:
Not reported

Quantity: 55

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity:

Year: 2013

Manifest Tracking Num: 003309608SKS

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H020

Document ID: Not reported

Manifest Status: Not reported

Trans1 State ID: TXR000081205

Trans2 State ID: Not reported

 Generator Ship Date:
 18-Sep-2013 00:00:00

 Trans1 Recv Date:
 18-Sep-2013 00:00:00

Trans2 Recv Date: Not reported

TSD Site Recv Date: 23-Sep-2013 00:00:00

Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000045385
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NJD002182897
Waste Code: Not reported

Quantity: 55

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

USA INDUSTRIES (Continued)

S108982842

Container Type: DM - Metal drums, barrels

R Material recovery of more than 75 percent of the total material. Handling Method:

Specific Gravity: 1 Year: 2013

003309755SKS Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H141

Document ID: Not reported Not reported Manifest Status: Trans1 State ID: TXR000081205 Trans2 State ID: Not reported

Generator Ship Date: 05-Jul-2013 00:00:00 Trans1 Recv Date: 05-Jul-2013 00:00:00

Trans2 Recv Date: Not reported

TSD Site Recv Date: 11-Jul-2013 00:00:00

Part A Recy Date: Not reported Part B Recv Date: Not reported NYR000045385 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: Not reported

Quantity: 55

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 2013

003696888SKS Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H020

> Click this hyperlink while viewing on your computer to access 25 additional NY_MANIFEST: record(s) in the EDR Site Report.

Direction Distance

Elevation Site Database(s) **EPA ID Number**

USA INDUSTRIES (Continued)

S108982842

EDR ID Number

SPILLS:

0751279 Facility ID: DER Facility ID: 341288 Facility Type: ER Site ID: 391687 DEC Region:

Spill Date: 1/2/2008

Spill Number/Closed Date: 0751279 / 10/19/2011

Spill Cause: Other

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

SWIS: 5228 JLPITKEW Investigator: Referred To: Not reported Reported to Dept: 1/2/2008 CID: Not reported Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: Date Entered In Computer: 1/2/2008 Spill Record Last Update: 10/21/2011 Spiller Name: Not reported Spiller Company: Not reported

Spiller Address: Not reported Spiller City, St, Zip: Not reported Spiller Company: Not reported Contact Name: **GREG COLLINS** Contact Phone: (516) 680-6348

DEC Memo: TELECON FROM GREG COLLINS, TANK REMOVED, CONTAMINATION FOUND WILL TRY TO DIG OUT AND TAKE AN ENDPOINT, CANNOT LEAVE OPEN DUE TO STRUCTURAL

CONCERNS, (BD)4/28/08 SPILL REPORTED ON 1/2/08 DURING TANK REMOVAL CONTAMINATED SOIL ENCOUNTERED. APPROX 40 YDS OF SOIL REMOVED, DISPOSAL MANIFEST REC'VD. CLEAN ENDPOINT UNABLE TO BE REACHED DUE TO

PROXIMITY TO THE BUILDING. ON MARCH 27, 2008 SURBSURFACE

INVESTIGATION CONDUCTED. SOIL BORINGS INDICATED XYLENES ABOVE

STANDARDS AND GW SLIGHTLY ABOVE STANDARDS. AREA IS INDUSTRIAL WITH NO OBSERVED SENSITIVE RECEPTORS DOWN GRADIENT. UNLIKELY TO REPRESENT

SIGNIFICANT ENV THREAT2/29/08 FILE REASSIGNED

Remarks: Soil contamination was found during removal of a 1000-gal #2 fuel oil

tank

Material:

Site ID: 391687 Operable Unit ID: 1148730 Operable Unit: 01 Material ID: 2139225 0001A Material Code: #2 Fuel Oil Material Name: Case No.: Not reported Petroleum Material FA:

Quantity:

Direction Distance

Elevation Site **EPA ID Number** Database(s)

USA INDUSTRIES (Continued) S108982842

Units: Gallons No Recovered: Resource Affected: Not reported

Oxygenate: False

Tank Test:

H34 **USA INDUSTRIES** RCRA-LQG 1001215438 South **1560 FIFTH AVENUE FINDS** NYR000045385

BAY SHORE, NY 1/8-1/4 0.141 mi.

Site 2 of 2 in cluster H 744 ft.

RCRA-LQG: Relative:

Date form received by agency: 03/03/2010 Lower

> Facility name: **USA INDUSTRIES** Facility address: 1560 FIFTH AVENUE

Actual: 60 ft. BAY SHORE, NY 11706

> EPA ID: NYR000045385 Mailing address: FIFTH AVENUE

BAY SHORE, NY 11706

Contact: CAROL MONETTE Contact address: Not reported

Not reported Contact country: Not reported Contact telephone: (631) 647-3308 Contact email: CAM@USAIND.COM

EPA Region: 02 Land type: Private

Classification: Large Quantity Generator

Description: Handler: generates 1,000 kg or more of hazardous waste during any

calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than

100 kg of that material at any time

Owner/Operator Summary:

VINCENT TRAPANI Owner/operator name:

Owner/operator address: FIFTH AVE

BAY SHORE, NY 11706

Owner/operator country: US

Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Owner Owner/Op start date: 01/01/1997 Owner/Op end date: Not reported

Owner/operator name: **USA INDUSTRIES** Owner/operator address: 215 CANDLEWOOD RD **EDR ID Number**

RI MANIFEST

Direction Distance

Elevation Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

1001215438

EDR ID Number

BAY SHORE, NY 11706

Owner/operator country: Not reported Owner/operator telephone: (516) 231-3330

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: VINCENT TRAPANI

Owner/operator address: FIFTH AVE

BAY SHORE, NY 11706

Owner/operator country: US

Owner/operator telephone: Not reported Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 01/01/1997
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 02/29/2008
Facility name: USA INDUSTRIES
Classification: Large Quantity Generator

Date form received by agency: 01/01/2007

Facility name: USA INDUSTRIES
Site name: USA INDUSTRIES
Classification: USA INDUSTRIES
Small Quantity Generator

Date form received by agency: 01/01/2006
Facility name: USA INDUSTRIES
Site name: U S A INDUSTRIES
Classification: Small Quantity Generator

Date form received by agency: 02/25/2004
Facility name: USA INDUSTRIES
Site name: U S A INDUSTRIES
Classification: Large Quantity Generator

Date form received by agency: 02/26/2002

Direction Distance

Elevation Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

1001215438

EDR ID Number

Facility name: USA INDUSTRIES
Classification: Large Quantity Generator

Date form received by agency:01/01/2001
Facility name: USA INDUSTRIES
Classification: Large Quantity Generator

Date form received by agency: 02/26/1998
Facility name: USA INDUSTRIES
Classification: Large Quantity Generator

Date form received by agency: 09/29/1997
Facility name: USA INDUSTRIES
Classification: Small Quantity Generator

Hazardous Waste Summary:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF

LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF

LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Facility Has Received Notices of Violations: Regulation violated: Not reported

Area of violation: Generators - Pre-transport

Date violation determined: 03/15/2011
Date achieved compliance: 06/07/2011
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 05/03/2011

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 06/27/2011 Enforcement lead agency: State Proposed penalty amount: Not reported

Final penalty amount: Not reported Not reported Not reported Not reported Not reported

Regulation violated: Not reported

Area of violation: State Statute or Regulation

Date violation determined: 03/15/2011
Date achieved compliance: 06/07/2011
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 05/03/2011

Direction Distance

Elevation Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

1001215438

EDR ID Number

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 06/27/2011
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - Records/Reporting

Date violation determined: 07/05/2007
Date achieved compliance: 11/20/2007
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 09/07/2007

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 12/06/2007
Enforcement lead agency: State
Proposed penalty amount: Not reported
Paid penalty amount: Not reported
Not reported

Regulation violated: Not reported

Area of violation: Generators - Pre-transport

Date violation determined: 07/05/2007
Date achieved compliance: 11/20/2007
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 09/07/2007

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 12/06/2007
Enforcement lead agency: State
Proposed penalty amount: Not reported
Paid penalty amount: Not reported
Not reported

Regulation violated: Not reported

Area of violation: Universal Waste - Small Quantity Handlers

Date violation determined: 07/05/2007
Date achieved compliance: 11/20/2007
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 09/07/2007

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 12/06/2007
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - Manifest

Date violation determined: 07/05/2007
Date achieved compliance: 11/20/2007
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 09/07/2007

Enf. disposition status: Action Satisfied (Case Closed)

Direction Distance

Elevation Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

1001215438

EDR ID Number

Enf. disp. status date: 12/06/2007
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: SR - 373-3.2(g)(1),(2),(3)
Area of violation: Generators - General

Date violation determined: 08/07/2003 Date achieved compliance: 09/12/2003 Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 09/12/2003
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: SR - 372.2(b)(5)(i),(ii),(iii)
Area of violation: Generators - General

Date violation determined: 08/07/2003
Date achieved compliance: 09/12/2003
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 09/12/2003
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 03/15/2011

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: State Statute or Regulation

Date achieved compliance: 06/07/2011 Evaluation lead agency: State

Evaluation date: 03/15/2011

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - Pre-transport

Date achieved compliance: 06/07/2011 Evaluation lead agency: State

Evaluation date: 07/05/2007

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - Records/Reporting

Date achieved compliance: 11/20/2007 Evaluation lead agency: State

Evaluation date: 07/05/2007

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - Pre-transport

Date achieved compliance: 11/20/2007

Direction Distance Elevation

vation Site Database(s) EPA ID Number

USA INDUSTRIES (Continued)

1001215438

EDR ID Number

Evaluation lead agency: State

Evaluation date: 07/05/2007

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - Manifest

Date achieved compliance: 11/20/2007 Evaluation lead agency: State

Evaluation date: 07/05/2007

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Universal Waste - Small Quantity Handlers

Date achieved compliance: 11/20/2007 Evaluation lead agency: State

Evaluation date: 08/07/2003

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 09/12/2003 Evaluation lead agency: State

Evaluation date: 01/18/1999

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

EPA

FINDS:

Registry ID: 110000877659

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

HAZARDOUS WASTE BIENNIAL REPORTER

RI MANIFEST:

GEN Cert Date: 11/4/1998 Transporter Receipt Date: Not reported

Number Of Containers: 0

Container Type: Not reported
Waste Code1: D001
Waste Code2: NONE
Waste Code3: Not reported
Comment: Not reported
Fee Exempt Code: Not reported

TSDF Name: UNITED OIL RECOVERY INC

TSDF ID: CTD021816889
TSDF Date: Not reported
Transporter 2 Name: Not reported
Transporter 2 ID: Not reported

Manifest Docket Number: CTF0744074

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

USA INDUSTRIES (Continued)

1001215438

S109060670

N/A

NY SWF/LF

NY Spills

Waste Description: PET DIST 275 Quantity: WT/Vol Units: G Item Number: 1

Transporter Name: UNITED IND SVS Transporter EPA ID: CTD021816889 GEN Cert Date: 11/4/1998 Transporter Recpt Date: Not reported Transporter 2 Recpt Date: Not reported TSDF Recpt Date: Not reported NYR000045385 EPA ID: Transporter 2 ID: Not reported

135 SALVAGE YARD **1 MACADAM AVENUE** NNE 1/8-1/4 **BAY SHORE, NY** 0.158 mi.

832 ft. Site 1 of 2 in cluster I

Relative: Higher

SWF/LF:

Flag: **ACTIVE**

Region Code: Actual:

Phone Number: 6319685700 69 ft. Owner Name: Kenneth Hillman Sr.

> Owner Type: Private

Owner Address: 1 Macadam Street Owner Addr2: Not reported

Owner City,St,Zip: Bayshore;, NY 11706 Owner Email: bicountyauto@aol.com

Owner Phone: 6319685700 Contact Name: Not reported Not reported Contact Address: Contact Addr2: Not reported Contact City,St,Zip: Not reported Not reported Contact Email: Contact Phone: Not reported

Activity Desc: Vehicle Dismantling

Activity Number: [52J16] Active: Yes East Coordinate: 646675 North Coordinate: 4513321 Accuracy Code: Not reported Regulatory Status: Not reported Not reported Waste Type: Authorization #: Not reported Authorization Date: Not reported **Expiration Date:** Not reported

SPILLS:

Facility ID: 0713272 DER Facility ID: 344541 Facility Type: ER Site ID: 394998 DEC Region:

3/15/2008 Spill Date:

0713272 / 10/8/2010 Spill Number/Closed Date:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SALVAGE YARD (Continued)

S109060670

Spill Cause: Other

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

SWIS: 5228 Investigator: wxprzylo Referred To: Not reported Reported to Dept: 3/15/2008 CID: 41

Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Fire Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase:

3/15/2008 Date Entered In Computer: Spill Record Last Update: 10/12/2010 Not reported Spiller Name: Spiller Company: SALVAGE YARD Spiller Address: Not reported

Spiller City, St, Zip: ZZ -Spiller Company: 001 Contact Name: **ABOVE** Not reported Contact Phone:

DEC Memo: 3/15/08 15:00 VALDI ON THE SCENE, TO CATCH BASINS AFFECTED, SOME AREA

ON THE PAVED GROUND AFFECTED BY MIXTURE OF HYDRAULIC OIL AND WATER. TOWN OF ISLIP, ROBERT POWERS HAZMAT FD ON THE SCENE, KEVIN MILLMAN,

BI COUNTY RECYCLERS PHONE #631-968-5700, 516-322-9457 HIRED TRADEWINDS, 16:00 TRADEWINDS, ON THE SCENE (VP)3/21/08 @10:00

re-inspectedAll previously affected areas appeared to be free of product, cleanup has been completed, no further action required (VP)

LEAKING INTO STORM DRAIN - FORKLIFT FIRE ON SIDE OF COMPACTOR -Remarks:

CLEANUP PENDING - FIRE UNDER CONTROL - TOWN OF ISLIP HAZMAT REP

NOTIFIED - FD STILL ON SCENE

Material:

Site ID: 394998 Operable Unit ID: 1151945 Operable Unit: 01 Material ID: 2142713 Material Code: 0015 Material Name: Motor Oil Case No.: Not reported Material FA: Petroleum Quantity: Not reported Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False Site ID: 394998 Operable Unit ID: 1151945 Operable Unit: 01 Material ID: 2142712 Material Code: 0010 Material Name: Hydraulic Oil Case No.: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

SALVAGE YARD (Continued) S109060670

Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported

Our reported False

Oxygenate: False

Tank Test:

I36 EDR US Hist Auto Stat 1015115589

NNE 1 MACADAM ST N/A

1/8-1/4 BAY SHORE, NY 11706

0.158 mi.

832 ft. Site 2 of 2 in cluster I

Relative: EDR Historical Auto Stations:

Higher Name: COUNTYWIDE AUTO I

Year: 2007

Actual: Address: 1 MACADAM ST

69 ft.

37 MILLER'S USED TRUCK PARTS NY SWF/LF S108145998
NW 18 MCADAM STREET N/A

NW 18 MCADAM STREET 1/8-1/4 BAYSHORE, NY 11706

0.162 mi. 858 ft.

Relative: SWF/LF: Higher Flag:

Higher Flag: INACTIVE Region Code: 1

Actual: Phone Number: Not reported
68 ft. Owner Name: Not reported
Owner Type: Not reported

Owner Address: Not reported Owner Addr2: Not reported Not reported Owner City, St, Zip: Not reported Owner Email: Owner Phone: Not reported Contact Name: Not reported Contact Address: Not reported Contact Addr2: Not reported Contact City,St,Zip: Not reported Contact Email: Not reported Contact Phone: Not reported

Activity Desc: Vehicle Dismantling

Activity Number: [52J43] Active: No East Coordinate: 646467 North Coordinate: 4513297 Accuracy Code: Not reported Regulatory Status: Not reported Waste Type: Not reported Authorization #: Not reported Authorization Date: Not reported **Expiration Date:** Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

38 **EDR US Hist Auto Stat** 1015177707

N/A

SSE 12 WALBRIDGE AVE BAY SHORE, NY 11706 1/8-1/4

0.163 mi. 860 ft.

EDR Historical Auto Stations: Relative:

SKY COACH REPAIRS Lower Name:

> Year: 2001

Actual: Address: 12 WALBRIDGE AVE

62 ft.

SUFFOLK

J39 **S & I INDUSTRIES INC GERSHOW**

NY AST A100264742

N/A

NNW 33 MCADAM ST 1/8-1/4 BAY SHORE, NY 11706

0.164 mi.

867 ft. Site 1 of 2 in cluster J

Relative: Higher

AST SUFFOLK: Region: Site Ref#:

03004 Actual: ACTIVE Status: 70 ft. **PBS** Site Type: Operating Permit Expires: 04/30/2018

Owner/Storage Information: AVAILABLE

Facility Info:

Site Ref#: 03004

Billing Contact: S & I INDUSTRIES INC Billing Address: 33 MC ADAMS ST Billing Address: **BAY SHORE**

Billing State: NY Billing Address: 11706

Storage Owner: S & I INDUSTRIES INC Storage Owner Address: 33 MC ADAMS ST Storage Owner City: **BAY SHORE**

Storage Owner State: NY Storage Owner Zip: 11706

Tank Info:

Facility ID: 03004 Facility Reference #: Not reported Township: Not reported Tax Map No: Not reported Region: **SUFFOLK**

Tank ID:

Tank Key: Not reported Year Installed: Not reported WASTE OIL Content: STEEL/ IRON Construction: Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: IN SERVICE Tabk Status: **Total Capacity:** 275 gallons Date Permitted: 04/06/1997 Date Closed: Not reported Internal Protection: NONE Secondary Containment: NONE

Direction Distance Elevation

tion Site Database(s) EPA ID Number

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

EDR ID Number

Extrenal Protection: Not reported Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

 Tank ID:
 1

 Tank Key:
 30421

 Year Installed:
 89

Content: WASTE OIL
Construction: STEEL
Dispenser: SUCTION

Official Use: Permitted Tank. Permit Runs Out. 02

Permit to Operate: 040697 Tank Location: ABOVE-OUT Tabk Status: Not reported **Total Capacity:** 0000000275 Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported **Extrenal Protection:** Not reported Leak Detection: Not reported Not reported Overfill Prevention: Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: **GRAVITY**

Tank ID: 10
Tank Key: 43702
Year Installed: Not reported
Content: GASOLINE
Construction: Not reported
Dispenser: SUCTION

Date Removed:

Official Use: Plans have been approved and awaiting construction

Not reported

Permit to Operate: Not reported Tank Location: ABOVE-OUT Tabk Status: Not reported Total Capacity: 0000000660 Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported

Direction Distance Elevation

tion Site Database(s) EPA ID Number

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

EDR ID Number

Secondary Containment: Not reported Extrenal Protection: Not reported Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Not reported Pipe Location: Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported **GRAVITY** Fill: Date Removed: Not reported

Tank ID: 11

Tank Key: Not reported Year Installed: Not reported Content: GASOLINE

Construction: REFER TO PAPER FILE

Dispenser: Not reported Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: UNREGISTERED Tabk Status: **Total Capacity:** 500 gallons Date Permitted: Not reported Date Closed: Not reported NONE Internal Protection: Secondary Containment: NONE Not reported **Extrenal Protection:** Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Not reported Pipe Location: Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported

Not reported

Tank ID: 2

Date Removed:

Tank Key: Not reported Year Installed: Not reported WASTE OIL Content: Construction: STEEL/ IRON SUCTION Dispenser: Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: Tabk Status: IN SERVICE **Total Capacity:** 275 gallons Date Permitted: 04/06/1997 Date Closed: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

EDR ID Number

NONE Internal Protection: NONE Secondary Containment: Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Not reported Pipe Location: Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Date Removed: Not reported

 Tank ID:
 2

 Tank Key:
 30422

 Year Installed:
 89

Content: WASTE OIL
Construction: STEEL
Dispenser: SUCTION

Official Use: Permitted Tank. Permit Runs Out. 02

Not reported

Permit to Operate: 040697 ABOVE-OUT Tank Location: Tabk Status: Not reported **Total Capacity:** 000000275 Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported Not reported Spill Prevention: Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Not reported Pipe Containment: Pipe Leak Detection: Not reported Date Next Tank Test: Not reported **GRAVITY**

Tank ID: 3

Date Removed:

Tank Key: Not reported Year Installed: Not reported Content: DIESEL Construction: STEEL/ IRON SUCTION Dispenser: Official Use: Not reported Not reported Permit to Operate: ABOVE - OUT Tank Location: **REMOVED** Tabk Status: Total Capacity: 510 gallons Date Permitted: Not reported

Direction Distance Elevation

vation Site Database(s) EPA ID Number

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

EDR ID Number

Date Closed: 11/29/1993 Internal Protection: NONE Secondary Containment: NONE Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Not reported Pipe Containment: Not reported Pipe Leak Detection: Date Next Tank Test: Not reported Not reported Date Removed: Not reported

Tank ID: 3
Tank Key: 30423
Year Installed: Not reported
Content: DIESEL
Construction: STEEL
Dispenser: SUCTION

Official Use: Removed Tank. 93 Permit to Operate: Not reported Tank Location: ABOVE-OUT Tabk Status: Not reported Total Capacity: 000000510 Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported PUMPED Fill:

Tank ID: 30424 Tank Key: Year Installed: Not reported Content: **GASOLINE** Construction: STEEL Dispenser: SUCTION Removed Tank. 93 Official Use: Permit to Operate: Not reported ABOVE-OUT Tank Location: Tabk Status: Not reported **Total Capacity:** 000000486

112993

Date Removed:

Direction Distance Elevation

tion Site Database(s) EPA ID Number

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

EDR ID Number

Date Permitted: Not reported Not reported Date Closed: Internal Protection: Not reported Secondary Containment: Not reported **Extrenal Protection:** Not reported Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Date Next Tank Test: Not reported **GRAVITY** Date Removed: 112993

Tank ID: 4

Not reported Tank Key: Not reported Year Installed: GASOLINE Content: Construction: STEEL/ IRON Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: Tabk Status: **REMOVED** 486 gallons Total Capacity: Date Permitted: Not reported Date Closed: 11/29/1993 Internal Protection: NONE Secondary Containment: NONE **Extrenal Protection:** Not reported Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Not reported Fill: Date Removed: Not reported

Tank ID: 5

Tank Key: Not reported Year Installed: Not reported DIESEL Content: STEEL/ IRON Construction: SUCTION Dispenser: Official Use: Not reported Permit to Operate: Not reported Tank Location: ABOVE - OUT Tabk Status: IN SERVICE

Direction Distance

Elevation Site Database(s) EPA ID Number

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

EDR ID Number

Total Capacity: 1000 gallons Date Permitted: 11/29/1993 Date Closed: Not reported Internal Protection: NONE **DIKE - STEEL** Secondary Containment: **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Tank ID: 5
Tank Key: 30425
Year Installed: Not reported
Content: DIESEL
Construction: STEEL / STEEL
Dispenser: SUCTION

Official Use: Permitted Tank. Permit Runs Out. 98

Permit to Operate: 112993 Tank Location: ABOVE-OUT Tabk Status: Not reported 000001000 Total Capacity: Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported Not reported **Extrenal Protection:** Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Not reported Date Next Tank Test: PUMPED Fill: Date Removed: Not reported

Tank ID: 6

Tank Key: Not reported Year Installed: Not reported Content: **GASOLINE** STEEL/ IRON Construction: Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported Tank Location: ABOVE - OUT

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

Tabk Status: REMOVED 550 gallons **Total Capacity:** Date Permitted: Not reported Date Closed: 05/14/1993 Internal Protection: NONE NONE Secondary Containment: **Extrenal Protection:** Not reported Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Not reported Pipe Location: Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Tank ID: 6 30427 Tank Key: Year Installed: Not reported GASOLINE Content: Construction: STEEL Dispenser: SUCTION

Removed Tank. 93 Official Use: Permit to Operate: Not reported ABOVE-OUT Tank Location: Tabk Status: Not reported Total Capacity: 000000550 Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Not reported Pipe Leak Detection: Not reported Date Next Tank Test: GRAVITY

Tank ID: 7 Tank Key: 30428 Year Installed: Not reported GASOLINE Content: Construction: STEEL SUCTION Dispenser:

Date Removed:

Removed Tank. 93 Official Use: Permit to Operate: Not reported

051493

Direction Distance Elevation

n Site Database(s) EPA ID Number

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

EDR ID Number

Tank Location: ABOVE-OUT Tabk Status: Not reported Total Capacity: 000000550 Date Permitted: Not reported Date Closed: Not reported Not reported Internal Protection: Secondary Containment: Not reported **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Not reported Pipe Leak Detection: Date Next Tank Test: Not reported **GRAVITY** Fill: Date Removed: 050493

Tank ID: 7

Tank Kev: Not reported Year Installed: Not reported GASOLINE Content: STEEL/ IRON Construction: Dispenser: SUCTION Official Use: Not reported Permit to Operate: Not reported ABOVE - OUT Tank Location: Tabk Status: **REMOVED Total Capacity:** 550 gallons Date Permitted: Not reported Date Closed: 05/04/1993 NONE Internal Protection: Secondary Containment: NONE Extrenal Protection: Not reported Leak Detection: Not reported Not reported Overfill Prevention: Spill Prevention: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Not reported Pipe Containment: Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

Tank ID: 8

Tank Key:
Year Installed:
Content:
Construction:
Dispenser:
Official Use:
Not reported
Not reported
STEEL/ IRON
STEEL/ IRON
Not reported

Direction Distance Elevation

ration Site Database(s) EPA ID Number

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

EDR ID Number

Permit to Operate: Not reported ABOVE - OUT Tank Location: Tabk Status: **REMOVED** Total Capacity: 1000 gallons Date Permitted: Not reported 08/12/1993 Date Closed: NONE Internal Protection: NONE Secondary Containment: Extrenal Protection: Not reported Leak Detection: Not reported Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

 Tank ID:
 8

 Tank Key:
 30426

 Year Installed:
 Not reported

 Content:
 DIESEL

 Construction:
 STEEL

 Dispenser:
 SUCTION

Official Use: Removed Tank. 93 Permit to Operate: Not reported Tank Location: ABOVE-OUT Tabk Status: Not reported Total Capacity: 0000001000 Date Permitted: Not reported Date Closed: Not reported Internal Protection: Not reported Secondary Containment: Not reported **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Not reported Pipe External Protection: Not reported Pipe Containment: Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: **GRAVITY**

Tank ID: 9
Tank Key: 30429
Year Installed: Not reported
Content: DRUM STORAGE
Construction: Not reported
Dispenser: Not reported

081293

Date Removed:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

S & I INDUSTRIES INC GERSHOW (Continued)

A100264742

NY SWF/LF

S108468073

N/A

Official Use: Approved Plan for Upgrade of existing non-complying tank, awaiting construction for compliance insp

Permit to Operate: Not reported Tank Location: ABOVE-IN Tabk Status: Not reported **Total Capacity:** 000000660 Date Permitted: Not reported Date Closed: Not reported Not reported Internal Protection: Secondary Containment: Not reported **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Not reported Pipe Containment: Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

J40 **BAYSHORE RECYCLING (GERSHOW RECYCLING)** NNW

33 MCADAM STREET 1/8-1/4 BAYSHORE, NY 11706

0.164 mi.

867 ft. Site 2 of 2 in cluster J

SWF/LF: Relative:

Higher Flag: **ACTIVE** Region Code:

Actual: 6312341022 Phone Number: 70 ft. Not reported Owner Name:

Owner Type: Not reported Owner Address: Not reported Owner Addr2: Not reported Owner City, St, Zip: Not reported Not reported Owner Email: Owner Phone: Not reported Contact Name: Peter Bertuccio Contact Address: 33 McAdams Street Contact Addr2: Not reported

Bay Shore;, NY 11706 Contact City, St, Zip: Contact Email: decinfo@gershow.com

Contact Phone: 6312341022 **Activity Desc:** Vehicle Dismantling

Activity Number: [52J66] Active: Yes East Coordinate: 646604 North Coordinate: 4513361

Accuracy Code: 1 - No accuracy stated

Regulatory Status: Not reported Waste Type: Not reported Authorization #: Not reported Authorization Date: Not reported **Expiration Date:** Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

K41 **BAYSHORE TRUCK REPAIR** NY AST A100383716 NNE 1629 5TH AVE N/A

1/8-1/4 BAY SHORE, NY 11706

0.186 mi.

981 ft. Site 1 of 4 in cluster K

AST_SUFFOLK: Relative: Higher Region:

SUFFOLK Site Ref#: 18599 Actual: ACTIVE Status: 69 ft. Site Type: PBS

Operating Permit Expires: Not reported **AVAILABLE** Owner/Storage Information:

Facility Info:

Site Ref#: 18599

Billing Contact: SAM ROBLES Billing Address: 1631 5TH AVE Billing Address: **BAY SHORE** Billing State: NY

Billing Address: 11706

Storage Owner: SAM ROBLES Storage Owner Address: 1631 5TH AVE Storage Owner City: **BAY SHORE**

Storage Owner State: NY Storage Owner Zip: 11706

Tank Info:

Facility ID: 18599 Facility Reference #: Not reported Township: Not reported Tax Map No: Not reported SUFFOLK Region:

Tank ID:

Tank Key: Not reported Not reported Year Installed: MOTOR OIL Content: Construction: STEEL/ IRON Dispenser: Not reported Official Use: Not reported Permit to Operate: Not reported Tank Location: ABOVE - IN Tabk Status: UNREGISTERED Total Capacity: 280 gallons Not reported Date Permitted: Date Closed: Not reported NONE Internal Protection: Secondary Containment: NONE **Extrenal Protection:** Not reported Leak Detection: Not reported Not reported Overfill Prevention: Spill Prevention: Not reported

Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported **EDR ID Number**

Direction Distance

Elevation Site Database(s) **EPA ID Number**

Not reported

BAYSHORE TRUCK REPAIR (Continued)

Fill:

A100383716

EDR ID Number

Date Removed: Not reported

Tank ID:

Not reported Tank Key: Year Installed: Not reported WASTE OIL Content: Construction: STEEL/ IRON Dispenser: Not reported Official Use: Not reported Not reported Permit to Operate: ABOVE - IN Tank Location: Tabk Status: UNREGISTERED Total Capacity: 275 gallons Date Permitted: Not reported Date Closed: Not reported NONE Internal Protection: Secondary Containment: NONE Extrenal Protection: Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Date Removed: Not reported

K42 **BAYSHORE TRUCK REPAIR NY UST** U004200467 NNE 1629 5TH AVE N/A

SUFFOLK

18599

ACTIVE

1/8-1/4 BAY SHORE, NY 11706

0.186 mi.

981 ft. Site 2 of 4 in cluster K

Relative: Higher

SUFFOLK CO. UST:

Region:

Site Ref#: Actual: Status: 69 ft. Site Type:

PBS Operating Permit Expires: Not reported

Owner/Storage Information: AVAILABLE

Facility Info:

Site Ref#: 18599

Billing Contact: SAM ROBLES Billing Address: 1631 5TH AVE Billing Address: **BAY SHORE**

Billing State: NY Billing Address: 11706

Storage Owner: SAM ROBLES Storage Owner Address: 1631 5TH AVE Storage Owner City: **BAY SHORE**

Storage Owner State: NY

Direction Distance

Elevation Site Database(s) **EPA ID Number**

11706

BAYSHORE TRUCK REPAIR (Continued)

U004200467

EDR ID Number

Storage Owner Zip:

Tank Info: Facility ID: 18599 Facility Reference #: Not reported Not reported Official Use: Township: Not reported Tax Map No: Not reported Region: **SUFFOLK** Permit to Operate: Not reported

Tank ID: 3

Tank Key: Not reported Installed: Not reported Capacity: 501 gallons #2 FUEL OIL Content: Not reported Date Removed: Construction: STEEL/ IRON Dispenser: Not reported Not reported Fill Type: **UNDER - OUT** Tank Location: UNREGISTERED Tabk Status: **Total Capacity:** 501 gallons Date Permitted: Not reported Date Closed: Not reported Internal Protection: NONE Secondary Containment: NONE **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Fill: Not reported Not reported Date Removed: Year Installed: Not reported Not reported Description of drop records:

K43 SUFFOLK COUNTY POLICE 3RD PCT

NNE 1630 5TH AVE

BAY SHORE, NY 11706 1/8-1/4

0.191 mi.

1009 ft. Site 3 of 4 in cluster K

SUFFOLK CO. UST: Relative:

Region: **SUFFOLK** Higher Site Ref#: 10548 Actual: ACTIVE Status: 69 ft. Site Type: **PBS** Operating Permit Expires: 06/30/2014 Owner/Storage Information: **AVAILABLE**

TC3812742.2s Page 152

U004200100

N/A

NY UST

Direction Distance

Elevation Site Database(s) EPA ID Number

SUFFOLK COUNTY POLICE 3RD PCT (Continued)

U004200100

EDR ID Number

Facility Info:

Site Ref#: 10548

Billing Contact: SUFFOLK COUNTY DPW Billing Address: 335 YAPHANK AVE

Billing Address: YAPHANK
Billing State: NY
Billing Address: 11980

Storage Owner: SUFFOLK COUNTY DPW Storage Owner Address: 335 YAPHANK AVE

Storage Owner City: YAPHANK
Storage Owner State: NY
Storage Owner Zip: 11980

Tank Info:

Fill:

Date Removed:

Description of drop records:

Year Installed:

Facility ID: 10548
Facility Reference #: Not reported
Official Use: Not reported
Township: Not reported
Tax Map No: Not reported
Region: SUFFOLK
Permit to Operate: Not reported

Tank ID:

Tank Key: Not reported Installed: Not reported Capacity: 3000 gallons Content: #2 FUEL OIL Date Removed: Not reported STEEL/ IRON Construction: SUCTION Dispenser: Fill Type: Not reported UNDER - OUT Tank Location: REMOVED Tabk Status: **Total Capacity:** 3000 gallons Date Permitted: Not reported Date Closed: 12/15/1993 Internal Protection: NONE NONE Secondary Containment: **Extrenal Protection:** Not reported Leak Detection: Not reported Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported

Tank ID: 2

Tank Key: Not reported

Not reported

Not reported

Not reported

Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

SUFFOLK COUNTY POLICE 3RD PCT (Continued)

U004200100

EDR ID Number

Installed: Not reported
Capacity: 20000 gallons
Content: GASOLINE
Date Removed: Not reported

Construction: FIBER REINFORCED PLASTIC

SUCTION Dispenser: Not reported Fill Type: Tank Location: UNDER - OUT Tabk Status: **REMOVED Total Capacity:** 20000 gallons Date Permitted: Not reported Date Closed: 12/15/1993 NONE Internal Protection: Secondary Containment: NONE **Extrenal Protection:** Not reported Not reported Leak Detection: Overfill Prevention: Not reported Spill Prevention: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe External Protection: Not reported Pipe Containment: Not reported Pipe Leak Detection: Not reported Date Next Tank Test: Not reported Not reported Fill: Date Removed: Not reported Year Installed: Not reported Description of drop records: Not reported

Tank ID: 3

Tank Key: Not reported Installed: Not reported Capacity: 20000 gallons Content: GASOLINE Date Removed: Not reported

Construction: FIBER REINFORCED PLASTIC

Dispenser: SUCTION Fill Type: Not reported UNDER - OUT Tank Location: Tabk Status: IN SERVICE Total Capacity: 20000 gallons Date Permitted: 11/09/1995 Date Closed: Not reported NONE Internal Protection:

Secondary Containment: SECONDARY WALL - FIBERGLASS

Extrenal Protection: NONE

Leak Detection: (DWP) ELECTRONIC LEAK PROBES

Overfill Prevention: - Electronic Leak Alarm

Spill Prevention: SPILL/FILL BOX AND/OR SUMP

Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported

Pipe Leak Detection: ELECTRONIC LEAK PROBE ONLY

Date Next Tank Test: Not reported Fill: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

SUFFOLK COUNTY POLICE 3RD PCT (Continued)

U004200100

EDR ID Number

Date Removed: Not reported Year Installed: Not reported Description of drop records: Not reported

Tank ID: 4

Tank Key: Not reported Installed: Not reported Capacity: 6000 gallons Content: #2 FUEL OIL Date Removed: Not reported

Construction: FIBER REINFORCED PLASTIC

SUCTION Dispenser: Fill Type: Not reported UNDER - OUT Tank Location: IN SERVICE Tabk Status: **Total Capacity:** 6000 gallons Date Permitted: 11/09/1995 Date Closed: Not reported NONE Internal Protection:

Secondary Containment: SECONDARY WALL - FIBERGLASS

Extrenal Protection: Not reported

Leak Detection: (DWP) ELECTRONIC LEAK PROBES

Overfill Prevention: - Electronic Leak Alarm

Spill Prevention: SPILL/FILL BOX AND/OR SUMP

Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported

Pipe Leak Detection: ELECTRONIC LEAK PROBE ONLY

Date Next Tank Test:

Fill:

Not reported

Not reported

Not reported

Not reported

Not reported

Year Installed:

Description of drop records:

Not reported

Not reported

Tank ID: 5

Tank Key: Not reported Installed: Not reported Capacity: 2500 gallons Content: DIESEL Date Removed: Not reported

Construction: FIBER REINFORCED PLASTIC

Dispenser: SUCTION Fill Type: Not reported Tank Location: **UNDER - OUT** Tabk Status: IN SERVICE **Total Capacity:** 2500 gallons Date Permitted: 11/09/1995 Date Closed: Not reported Internal Protection: NONE

Secondary Containment: SECONDARY WALL - FIBERGLASS

Extrenal Protection: Not reported

Leak Detection: (DWP) ELECTRONIC LEAK PROBES

Overfill Prevention: - Electronic Leak Alarm

Spill Prevention: SPILL/FILL BOX AND/OR SUMP

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUFFOLK COUNTY POLICE 3RD PCT (Continued)

U004200100

Pipe Location: Not reported Pipe Type: Not reported Pipe External Protection: Not reported Pipe Containment: Not reported

ELECTRONIC LEAK PROBE ONLY Pipe Leak Detection:

Date Next Tank Test: Not reported Fill: Not reported Not reported Date Removed: Year Installed: Not reported Description of drop records: Not reported

K44 **EDR US Hist Auto Stat** 1015258229 N/A

NNE 1631 5TH AVE

1/8-1/4 BAY SHORE, NY 11706

0.199 mi.

Site 4 of 4 in cluster K 1053 ft.

EDR Historical Auto Stations: Relative:

FRIENDLY MUFFLER & EXHST SYSTM Name: Higher

Year: 2002

Actual: Address: 1631 5TH AVE

70 ft.

V & C AUTO CTR INC Name:

Year: 2005

Address: 1631 5TH AVE

Name: V & C AUTO CENTER INC

2006 Year:

Address: 1631 5TH AVE

Name: V & C AUTO CENTER INC

2007 Year:

1631 5TH AVE Address:

Name: V & C AUTO CENTER

Year: 2008

1631 5TH AVE Address:

Name: V & C AUTO CENTER

Year: 2009

Address: 1631 5TH AVE

V & C AUTO CTR Name:

2010 Year:

Address: 1631 5TH AVE

V & C AUTO CENTER Name:

Year: 2011

Address: 1631 5TH AVE

V & C AUTO CENTER Name:

2012 Year:

Address: 1631 5TH AVE

Direction Distance

Elevation Site Database(s) EPA ID Number

45 TELEMECHANICS INC RCRA NonGen / NLR 1000205980
NNE 1636 5TH AVE FINDS NYD052782752

1/8-1/4 BAYSHORE, NY

0.216 mi. 1138 ft.

Relative: RCRA NonGen / NLR:

Higher Date form received by agency: 01/01/2007

Facility name: TELEMECHANICS INC

Actual: Facility address: 1636 5TH AVE

BAYSHORE, NY 11706

EPA ID: NYD052782752

Mailing address: 5TH AVE

BAYSHORE, NY 11706

Contact: Not reported Contact address: 5TH AVE

BAYSHORE, NY 11706

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: GEORGE NAGRODSKY

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: GEORGE NAGRODSKY
Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported

Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No

EDR ID Number

NY MANIFEST

Direction Distance Elevation

Site Database(s) **EPA ID Number**

TELEMECHANICS INC (Continued)

1000205980

EDR ID Number

Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

TELEMECHANICS INC Facility name: Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: TELEMECHANICS INC Classification: Not a generator, verified

Date form received by agency: 10/30/1987

Facility name: **TELEMECHANICS INC** Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004358720

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD052782752

Country: USA

Mailing Name: **TELEMECHANICS** Mailing Contact: **TELEMECHANICS** Mailing Address: 1636 FIFTH AVE Mailing Address 2: Not reported Mailing City: **BAY SHORE**

Mailing State: NY Mailing Zip: 11706 Mailing Zip4: Not reported

Mailing Country: USA

Mailing Phone: 516-231-3833

Document ID: NJA2073316 Manifest Status: Completed copy

Trans1 State ID: 08690 Trans2 State ID: Not reported Generator Ship Date: 950727 Trans1 Recv Date: 950727 Trans2 Recy Date: Not reported TSD Site Recy Date: 950801 Part A Recv Date: 950804 Part B Recv Date: 950817

Direction Distance

Elevation Site Database(s) EPA ID Number

TELEMECHANICS INC (Continued)

1000205980

EDR ID Number

 Generator EPA ID:
 NYD052782752

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD002182897

 Waste Code:
 F001 - UNKNOWN

Quantity: 00431 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Document ID: NJA2697442

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 08690 Trans2 State ID: Not reported Generator Ship Date: 970626 970626 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 970627 Part A Recy Date: 970710 Part B Recv Date: 970724

 Generator EPA ID:
 NYD052782752

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD002182897

 Waste Code:
 F001 - UNKNOWN

Quantity: 00431 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

NJA1086370 Document ID: Manifest Status: Completed copy Trans1 State ID: Not reported Trans2 State ID: NJDEPS869 Generator Ship Date: 910107 Trans1 Recv Date: 910107 Trans2 Recv Date: 910107 TSD Site Recv Date: 910108 Part A Recv Date: 910130 Part B Recv Date: 910129

Generator EPA ID: NYD052782752

Trans1 EPA ID: ILD051060408

Trans2 EPA ID: ILD051060408

TSDF ID: NJD002182897

Waste Code: F001 - UNKNOWN

Quantity: 01000
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TELEMECHANICS INC (Continued)

1000205980

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 91 Year:

Document ID: NJA1073127 Manifest Status: Completed copy Trans1 State ID: Not reported Trans2 State ID: Not reported Generator Ship Date: 910501 910501 Trans1 Recv Date: Trans2 Recv Date: Not reported 910502 TSD Site Recv Date: Part A Recv Date: 910510 Part B Recv Date: 910516 Generator EPA ID: NYD052782752 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported

F001 - UNKNOWN Waste Code: Quantity: 01500 Units: P - Pounds

Number of Containers: 003

TSDF ID:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

NJD002182897

Specific Gravity: 100 Year: 91

Document ID: NJA1130542

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: ET4217 Trans2 State ID: Not reported Generator Ship Date: 920519 920519 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 920527 Part A Recv Date: Not reported 920619 Part B Recv Date: Generator EPA ID: NYD052782752 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: F001 - UNKNOWN

01305 Quantity: P - Pounds Units:

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Document ID: NJA1635505 Completed copy Manifest Status: NJDEPS869 Trans1 State ID: Trans2 State ID: Not reported

Direction Distance Elevation

evation Site Database(s) EPA ID Number

TELEMECHANICS INC (Continued)

1000205980

EDR ID Number

Generator Ship Date: 930728 930728 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 930729 Part A Recv Date: 930806 Part B Recv Date: 930811 Generator EPA ID: NYD052782752 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NJD002182897

Waste Code: F001 - UNKNOWN
Quantity: 04737
Units: P - Pounds
Number of Containers: 011

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Document ID: NJA0715311

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: Not reported Trans2 State ID: NJDEPS869 Generator Ship Date: 900502 Trans1 Recv Date: 900502 Trans2 Recy Date: 900503 TSD Site Recv Date: 900503 Part A Recv Date: 900614 Part B Recv Date: 900626 Generator EPA ID:

 Generator EPA ID:
 NYD052782752

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD002182897

 Waste Code:
 F001 - UNKNOWN

Quantity: 01500 Units: P - Pounds

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 90

Document ID: NJA0931502 Completed copy Manifest Status: Trans1 State ID: Not reported Trans2 State ID: NJDEPS869 Generator Ship Date: 901004 Trans1 Recv Date: 901004 901011 Trans2 Recv Date: TSD Site Recv Date: 901011 Part A Recv Date: 901024 Part B Recv Date: 901023 Generator EPA ID: NYD052782752 ILD051060408 Trans1 EPA ID: Trans2 EPA ID: ILD051060408

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TELEMECHANICS INC (Continued)

1000205980

TSDF ID: NJD002182897 F001 - UNKNOWN Waste Code:

01000 Quantity: Units: P - Pounds Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 90 Year:

NJA1802410 Document ID: Completed copy Manifest Status: Trans1 State ID: NJDEPE086 Trans2 State ID: Not reported Generator Ship Date: 940428 940428 Trans1 Recy Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 940503 Part A Recv Date: Not reported Part B Recv Date: 940516 Generator EPA ID: NYD052782752 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NJD002182897 Waste Code: F001 - UNKNOWN

Quantity: 01723 Units: P - Pounds Number of Containers: 004

DM - Metal drums, barrels Container Type:

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Document ID: NYA6401403

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: PLATE# 9082GF Trans2 State ID: 871204 Generator Ship Date: Trans1 Recv Date: 871204 Trans2 Recv Date: Not reported TSD Site Recv Date: 871204 Part A Recv Date: 880120 Part B Recv Date: 871218 Generator EPA ID:

NYD052782752 Trans1 EPA ID: NYD000824334 Trans2 EPA ID: Not reported TSDF ID: NYD000824334 Waste Code: F003 - UNKNOWN

Quantity: 00330

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 87

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TELEMECHANICS INC (Continued)

1000205980

Document ID: NJA1951280 Completed copy Manifest Status: Trans1 State ID: NJDEPE086 Trans2 State ID: Not reported Generator Ship Date: 950403 Trans1 Recv Date: 950403 Trans2 Recv Date: Not reported TSD Site Recy Date: 950407 Part A Recv Date: 950411 Part B Recv Date: 950421 Generator EPA ID: NYD052782752

Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NJD002182897 F001 - UNKNOWN Waste Code:

Quantity: 00861 Units: P - Pounds 002 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Document ID: NJA1807898 Manifest Status: Completed copy

Trans1 State ID: 8690 Trans2 State ID: Not reported 940201 Generator Ship Date: 940201 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 940207 Part A Recv Date: Not reported Part B Recv Date: 940223 NYD052782752 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported

F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code:

NJD002182897

Quantity: 00306 P - Pounds Units:

Number of Containers: 001

TSDF ID:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 94 Year:

NJA2550074 Document ID:

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

08690 Trans1 State ID: Trans2 State ID: Not reported 961115 Generator Ship Date: Trans1 Recv Date: 961115 Trans2 Recy Date: Not reported TSD Site Recy Date: 961115 Part A Recv Date: 961203

Direction Distance Elevation

ation Site Database(s) EPA ID Number

TELEMECHANICS INC (Continued)

1000205980

EDR ID Number

Part B Recv Date: 961211

 Generator EPA ID:
 NYD052782752

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD002182897

 Waste Code:
 F001 - UNKNOWN

Quantity: 00867
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 96

Document ID: NJA0661856 Manifest Status: Completed copy NJSWAS300 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 890711 Trans1 Recv Date: 890711 Trans2 Recv Date: Not reported TSD Site Recy Date: 890711 Part A Recv Date: 890717 Part B Recv Date: 890719 Generator EPA ID:

 Generator EPA ID:
 NYD052782752

 Trans1 EPA ID:
 NJD991291105

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD991291105

 Waste Code:
 F001 - UNKNOWN

Quantity: 00165

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 89

NJA0661720 Document ID: Completed copy Manifest Status: Trans1 State ID: 00000000 Trans2 State ID: 00000000 Generator Ship Date: 890705 Trans1 Recv Date: 890705 Trans2 Recv Date: Not reported TSD Site Recv Date: 890705 Part A Recv Date: 890717 Part B Recv Date: 890714

 Generator EPA ID:
 NYD052782752

 Trans1 EPA ID:
 NJD991291105

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD991291105

 Waste Code:
 F001 - UNKNOWN

Quantity: 00330

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 006

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TELEMECHANICS INC (Continued)

1000205980

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 89 Year:

NY DEL SHWS \$105973015 L46 RITE OFF, INC. N/A

SSW 1/8-1/4

BAY SHORE, NY 11706

DEL SHWS:

Epa Id Number:

0.218 mi.

1153 ft. Site 1 of 4 in cluster L

Relative: Lower

Actual:

59 ft.

Year: 1996 Site Code Id: 152129 Site Classification: Not reported Region: Not reported

Not reported Site Type - Dump: No Site Type - Structure: Yes Site Type - Lagoon: No Site Type - Landfill: No Site Type - Treat Pond: No

Site Size (Acres): Not reported Site Size Comment: Not reported Period Assoc/HW Start: Unknown Period Assoc/HW End: Unknown Lat/Long: Not reported Lat/Long Decimal: Not reported

40 45 80.0 / 73 15 570.0 Lat/Long (dms):

Hazardous Waste Code: Not reported

Hazard Waste Disposed: 1,1,1- Trichloroethane {(TCA) (F001)}

Quantity: unknown

Trichloroethylene {(TCE) (F001)} unknown

Tetrachloroethylene {(PCE or "perc.") (F001)}

unknown

1,1-Dichloroethylene (FOO1)

unknown No

SW Std Contravention: No GW Std Contravention: Yes Soil Type: Sediment Data Available: Yes GW Std Contravention: Yes DW Std Contravention: Yes SW Std Contravention: No Air Stand Contraventions: No

Air Data Available:

Legal Action Type: Not reported

State Legal Action: Yes Federal Legal Action: No Enforce Status Code: os Remedial Act Proposed: No Rem Act Under Design: Yes Rem Act In Progress: No Rem Act Completed: No

Remedial Action Type: Not reported

Soil Type: Not reported

Depth To Groundwater: Approximately 36 feet

Distance EDR ID Number
Elevation Site EDR ID Number
Database(s) EPA ID Number

RITE OFF, INC. (Continued)

S105973015

Owner Name: Not reported Owner Address: Not reported Not reported Owner City,St,Zip: Not reported Owner Phone: Owner Contact Name: **Howard Rapps** Owner During Disposal: Not reported Owner During Use: Howard Rapps Operator Name: Howard Rapps Not reported Operator Address: Operator City, St, Zip: Not reported Operator Phone: Not reported Operator Contact Name: Howard Rapps Oper During Disposal: Not reported Site Type: Not reported HW Disposal Period: Not reported Analytical Data Available: Not reported Applicable Std Exceeded: Not reported Geotech Info: Not reported Depth To Groundwater: Not reported Status: Not reported Nature Of Action: Not reported

Env Prob Assessment: Groundwater contamination far above guidelines has occurred at thissite. Soil

contamination by organic solvents has also been noted. This site poses a

significant environmental threat to groundwater.

Site Description: Not reported Confirmed HW: Not reported **Environment Assesment:** Not reported Health Assesment: Not reported Disposal Start Date: Not reported Not reported Disposal Term Date: Air Violation: Not reported Groundwater Violation: Not reported Drink Water Violation: Not reported Surface Water Violation: Not reported Not reported Legal New York State: Not reported Legal Federal: Legal State: Not reported Remedial Action Active: Not reported Remedial Action Done: Not reported NPL Status: Not reported Not reported Count Operator: Count Owner: Not reported NYTM X: Not reported NYTM Y: Not reported Co Name: Not reported Co Addr: Not reported Operator Addr: Not reported Operator Addr 2: Not reported Operator Addr 3: Not reported Not reported Operator Addr 4: HWDP From: Not reported From To: Not reported Assessment of Health: Not reported Not reported Description: Env Assessment: Not reported HW Disposed/Quantity: Not reported

Not reported

Assess/Env Prog:

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

RITE OFF, INC. (Continued) S105973015

Assess/Health Prob: Not reported Site Description: Not reported

L47 RITE OFF AEROSAL NY VAPOR REOPENED \$106905127 SSW 1545 5TH INDUSTRIAL COURT NY LTANKS N/A

1/8-1/4 BAY SHORE, NY

0.225 mi.

1189 ft. Site 2 of 4 in cluster L

Relative: VAPOR REOPENED: Lower Site Code: 152129

Facility Status: Underway (Mitigate)

Actual: 60 ft.

LTANKS:

Site ID: 234292

Spill Number/Closed Date: 9709669 / 1/30/1998

Spill Date: 11/19/1997
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Cleanup Ceased: Not reported

Cleanup Meets Standard: True
SWIS: 5200
Investigator: T/T/F
Referred To: Not reported
Reported to Dept: 11/19/1997
CID: 323

Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 11/19/1997

Spill Record Last Update: 10/17/2000
Spiller Name: HOWARD RAPP
Spiller Company: FINISH TECHNOLOGY

Spiller Address: 1545 5TH INDUSTRIAL COURT

Spiller City, St, Zip: BAY SHORE, ZZ

Spiller County: 001

Spiller Contact: HOWARD RAPP
Spiller Phone: (516) 422-3969
Spiller Extention: Not reported
DEC Region: 1

DER Facility ID: 193013
DEC Memo: Not reported

Remarks: WOULD NOT HOLD RATE.

Material:

 Site ID:
 234292

 Operable Unit ID:
 1056001

 Operable Unit:
 01

 Material ID:
 328004

 Material Code:
 0001A

 Material Name:
 #2 Fuel Oil

 Case No.:
 Not reported

NY Spills

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RITE OFF AEROSAL (Continued)

S106905127

Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: 234292 Spill Tank Test: 1545477 Tank Number: Tank Size: 5000 Test Method: 03 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004

Test Method: Horner EZ Check I or II

SPILLS:

Facility ID: 9007628 **DER Facility ID:** 365823 Facility Type: ER Site ID: 191078 DEC Region:

Spill Date: 10/11/1990 Spill Number/Closed Date: 9007628 / 10/22/1990

Spill Cause: **Equipment Failure**

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Unable/unwilling Responsible Party. Corrective action taken. (ISR)

SWIS: 5228 Investigator: LUCE Not reported Referred To: Reported to Dept: 10/12/1990 CID: Not reported Water Affected: Not reported

Institutional, Educational, Gov., Other Spill Source:

Spill Notifier: Responsible Party Cleanup Ceased: 10/22/1990 Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase:

Date Entered In Computer: 10/15/1990 Spill Record Last Update: 7/20/2009 Spiller Name: Not reported Spiller Company: RITE OFF INC

Spiller Address: 1545 5TH INDUSTRIAL CT

Spiller City, St, Zip: BAY SHORE, NY

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Memo: CLEANUP SATISFACTORY

Remarks: PIPE BROKE IN BOILER ROOM/HOLDING TANK PUMP BACKED UP, CLEANED UP,

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RITE OFF AEROSAL (Continued)

S106905127

THERE IS A DRUM IN DRAIN WHICH THEY PUMPED UP

Material:

191078 Site ID: Operable Unit ID: 948273 Operable Unit: Material ID: 431475 Material Code: 0001A #2 Fuel Oil Material Name: Case No.: Not reported Material FA: Petroleum Quantity: 8 Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Facility ID: 9010995 DER Facility ID: 365823 Facility Type: ER Site ID: 234291 DEC Region: Spill Date: 1/15/1991

Spill Number/Closed Date: 9010995 / 1/18/1991

Spill Cause:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Unknown Responsible Party. Corrective action taken. (ISR)

SWIS: 5228 Investigator: **KMYAGER** Referred To: Not reported Reported to Dept: 1/15/1991 CID: Not reported Water Affected: Not reported Spill Source: Tank Truck Spill Notifier: Responsible Party

Cleanup Ceased: 1/18/1991 Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: 0

Date Entered In Computer: 1/16/1991 Spill Record Last Update: 7/30/2009 Spiller Name: Not reported

Spiller Company: RITE OFF AEROSAL

1545 5TH INDUSTRIAL COURT Spiller Address:

Spiller City, St, Zip: BAY SHORE, NY

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"DEROSA"01/18/91: NO FURTHER ACTION.10/10/95: This is additional

information about material spilled from the translation of the old

spill file: MINERAL OIL/SOLVENTS.

Direction Distance

Elevation Site Database(s) EPA ID Number

RITE OFF AEROSAL (Continued)

S106905127

NY SHWS

NY CBS

NY MANIFEST

EDR ID Number

Remarks: TRUCK DELIVERING CHEMICALS, BINS LEAKING IN TRUCK, BOTTOM OF TRUCK

WET, PULLED & PUMPED OUT, TRUCK DRIPPED INTO LOADING PIT, DUG UP DIRT

UNTIL CLEAN 1-2 GALS THAT SPILLED, FINISHED CLEANING UP

Material:

Tank Test:

 L48
 FINISH LINE TECHNOLOGIES
 RCRA-SQG
 1001090441

 SSW
 1545 5TH INDUSTRIAL COURT
 FINDS
 NYR000022780

1/8-1/4 BAY SHORE, NY 0.225 mi.

1189 ft. Site 3 of 4 in cluster L

Relative: RCRA-SQG:

Actual:

60 ft.

Lower Date form received by agency: 03/10/2008

Facility name: FINISH LINE TECHNOLOGIES
Facility address: 1545 5TH INDUSTRIAL COURT

BAY SHORE, NY 117063401

EPA ID: NYR000022780

Mailing address: 5TH INDUSTRIAL COURT

BAY SHORE, NY 117063401

Contact: HENRY J KRAUSE

Contact address: 5TH INDUSTRIAL COURT

BAY SHORE, NY 117063401

Contact country: US

Contact telephone: (631) 666-7300

Telephone ext.: 210

Contact email: HKRAUSE@FINISHLINEUSA.COM

EPA Region: 02 Land type: Private

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: FINISH LINE TECHNOLOGIES INC

Owner/operator address: Not reported Not reported

Owner/operator country: US

Owner/operator telephone: Not reported Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 11/01/1995
Owner/Op end date: Not reported

Owner/operator name: HJK REALTY CO
Owner/operator address: Not reported

Not reported

Owner/operator country: US

Owner/operator telephone: Not reported Legal status: Private

Owner/Operator Type: Owner

Direction Distance

Elevation Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Owner/Op start date: 08/19/2004
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: Nο Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 03/09/2008

Facility name: FINISH LINE TECHNOLOGIES
Classification: Large Quantity Generator

Date form received by agency: 04/27/2006

Facility name: FINISH LINE TECHNOLOGIES

Site name: H J K REALTY INC
Classification: Small Quantity Generator

Date form received by agency: 04/26/2006

Facility name: FINISH LINE TECHNOLOGIES

Site name: H J K REALTY INC
Classification: Small Quantity Generator

Date form received by agency: 07/08/1999

Facility name: FINISH LINE TECHNOLOGIES
Site name: FINISH LINE TECHNOLOGIES INC

Classification: Not a generator, verified

Date form received by agency: 04/25/1996

Facility name: FINISH LINE TECHNOLOGIES
Site name: FINISH LINE TECHNOLOGIES INC

Classification: Large Quantity Generator

Hazardous Waste Summary:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF

LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Violation Status: No violations found

Direction Distance Elevation

Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Evaluation Action Summary:

Evaluation date: 12/20/2007

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

State

Evaluation date: 09/03/1996

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

EPA

FINDS:

Registry ID: 110009485155

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

SHWS:

Program: HW
Site Code: 57896
Classification: COMPLETED

 Region:
 1

 Acres:
 3.000

 HW Code:
 152129

 Record Add:
 11/18/1999

 Record Upd:
 12/27/2007

 Updated By:
 JAYAVOND

Site Description:

The site is located in an industrial section of the Town of Islip, Suffolk County. This industrial facility is downgradient from several inactive hazardous waste sites. Rite Off, Inc. blended and packaged spray lubricants, solvents, and insecticides for the retail market. The company paid a fine for the illegal on-site disposal of hazardous wastes, and has signed a Consent Order with the DEC to conduct a field investigation at the site. A PRP field investigation showed substantial contamination by various solvents in the groundwater. The following contaminants have been noted: 1,1,1-trichloroethane at 4200 ppb, trichloroethylene at 590 ppb, tetrachloroethylene at 1900 ppb and 1,1-dichloroethene at 320 ppb. In 1993, a new Consent Order was signed with the DEC. A Remedial Investigation report and an Off-Site Groundwater Investigation was performed. These indicated that the Interim Remedial Measure (IRM) to remove the storm drain sediments has removed the remaining soil contamination at the site. In 1996, another Consent Order for the Remedial Design was signed with the DEC. A Record of Decision was issued for a soil vapor extraction/air sparging (SVE/AS) system to treat the groundwater contamination. The construction of the SVE/AS system was completed in January 1997, and was operating until October 1998 when permission was given to shut down the system. Analytical data demonstrated that further operation

Map ID MAP FINDINGS
Direction

Distance Elevation

Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

of the remedial system is no longer beneficial. In October 2000, the existing air sparging/soil vapor extraction system was dismantled. Considering the sample data from monitoring wells that show numerous non-detectable results , the site was delisted from the Registry of Inactive Hazardous Waste Sites.On February 4, 2005 the site was included on the List of Inactive Hazardous Waste Sites with Pre-2003 Remedial Decisions where Disposal of Chlorinated Hydrocarbons Occurred. A soil vapor intrusion evaluation shall be performed to determine if remedial efforts undertaken to date are protective of human health. In May 2007, the current owner of the property voluntarily agreed to undertake a soil vapor evaluation of the property as the site was listed on the Department's "Legacy List"

Env Problem: The contaminants of concern at the site are trichloroethane, dichloroethane, trichloroethene and tetrachloroethylene.

Investigations indicated soil and groundwater contamination on site. Exceedances of standards, criteria, and guidance include the VOCs listed above in the soils and groundwater. An air sparging/soil vapor extraction system was constructed and operated until clean up objectives were met. At this time, there are no remaining

environmental problems associated with the disposal of hazardous waste at this site. Therefore, the site no longer presents a

significant threat to the environment.

Health Problem: The area is served by public water, so exposures to contaminated

groundwater are not expected. Routine monitoring of the public drinking water supply wells will detect contamination, and if needed, appropriate measures will be taken to prevent the distribution of contaminated drinking water. Groundwater at the site was contaminated with volatile organic compounds at levels above standards for public

drinking water supplies. However, the groundwater has been remediated to levels slightly above applicable drinking water standards In addition, the Air Sparge/Soil Vapor Extraction (remediation) system installed at the site in 1997 has removed contamination from on-site soils, eliminating the potential for exposure. The site building located at 1545 Fifth Industrial Court property will be re-evaluated

for potential vapor intrusion pathways.

Dump: False
Structure: True
Lagoon: False
Landfill: False
Pond: False
Disp Start: unknown
Disp Term: unknown

Lat/Long: 40:45:08:0 / 73:15:57:0

Dell: False

Record Add: 11/18/1999 12:00:00 PM Record Upd: 11/18/1999 12:00:00 PM

Updated By: INITIAL
Own Op: Disp. Owner
Sub Type: NNN

Owner Name: Not reported
Owner Company: HOWARD RAPPS
Owner Address: Not reported
Owner Addr2: Not reported

Owner City,St,Zip: ZZ

Owner Country: United States of America
Own Op: On-Site Operator

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FINISH LINE TECHNOLOGIES (Continued)

1001090441

Sub Type:

HOWARD RAPPS Owner Name: Owner Company: Howard Rapps

Owner Address: 1545 5TH INDUSTRIAL COURT

Owner Addr2: Not reported

Owner City, St, Zip: BAYSHORE, NY 11706 United States of America Owner Country:

Own Op: Owner Sub Type: NNN Owner Name: Not reported **Howard Rapps** Owner Company:

Owner Address: 1545 5th Industrial Court

Owner Addr2: Not reported

Owner City, St, Zip: Bay Shore, NY 11706 Owner Country: United States of America

HW Code: 152129

Waste Type: TETRACHLOROETHYLENE (PCE)

Waste Quantity: **UNKNOWN** Waste Code: Not reported HW Code: 152129

Waste Type: 1,1,1- TRICHLOROETHANE {(TCA) (F001)}

Waste Quantity: UNKNOWN Waste Code: Not reported

HW Code: 152129 TRICHLOROETHYLENE {(TCE) (F001)} Waste Type:

Waste Quantity: UNKNOWN Waste Code: Not reported HW Code: 152129

TETRACHLOROETHYLENE {(PCE OR "PERC.") (F001)} Waste Type:

Waste Quantity: UNKNOWN Not reported Waste Code: HW Code: 152129

Waste Type: 1,1-DICHLOROETHYLENE (FOO1)

Waste Quantity: UNKNOWN Waste Code: Not reported 152129 HW Code:

1,2-DICHLOROETHANE Waste Type:

Waste Quantity: **UNKNOWN** Waste Code: Not reported HW Code: 152129 Waste Type: 1,1,1 TCA Waste Quantity: UNKNOWN Waste Code: Not reported HW Code: 152129

Waste Type: TRICHLOROETHENE (TCE)

Waste Quantity: UNKNOWN Waste Code: Not reported NYD000726786 Crossref ID:

Cross Ref Type Code: 05

Cross Ref Type: **EPA Site ID**

11/18/1999 12:00:00 PM Record Added Date: Record Updated: 5/10/2001 4:31:00 PM

Updated By: **REGTRANS**

NY MANIFEST:

EPA ID: NYD000726786

Country: **USA**

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

Mailing Name: RITE OFF INCORPORATED
Mailing Contact: HOWARD RAPPS PRES.
Mailing Address: 1545 5TH INDUSTRIAL COURT

Mailing Address 2: Not reported
Mailing City: BAYSHORE
Mailing State: NY
Mailing Zip: 11706
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 516-665-6868

Document ID: Not reported Manifest Status: Not reported NJD054126164 Trans1 State ID: Trans2 State ID: NYR000134957 Generator Ship Date: 2007-04-20 2007-04-20 Trans1 Recv Date: Trans2 Recv Date: 2007-04-26 TSD Site Recv Date: 2007-05-21 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000022780 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: OHD066060609 Waste Code: Not reported

Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2007

Manifest Tracking Num: 002771064JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H061

Document ID: CTF1177240 Manifest Status: Not reported NJD054126164 Trans1 State ID: Trans2 State ID: Not reported 05/15/2006 Generator Ship Date: Trans1 Recv Date: 05/15/2006 Trans2 Recy Date: Not reported TSD Site Recy Date: 05/15/2006 Part A Recv Date: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Part B Recv Date: Not reported NYR000022780 Generator EPA ID: Trans1 EPA ID: 1637862ME Trans2 EPA ID: Not reported TSDF ID: CTD021816889

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 01500

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 2006

Document ID: NYG3346587 Manifest Status: Not reported OHD077772895 Trans1 State ID: Trans2 State ID: Not reported 06/29/2006 Generator Ship Date: Trans1 Recv Date: 06/29/2006 Trans2 Recv Date: Not reported TSD Site Recy Date: 06/30/2006 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000022780 Trans1 EPA ID: OH121 Trans2 EPA ID: Not reported

TSDF ID: OHD066060609

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

00055 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 2006

Document ID: NJA2565744 Completed copy Manifest Status:

Trans1 State ID: S5811 Trans2 State ID: Not reported 960605 Generator Ship Date: Trans1 Recv Date: 960605 Trans2 Recv Date: Not reported TSD Site Recv Date: 960605 Part A Recv Date: Not reported Part B Recv Date: 960617 Generator EPA ID: NYR000022780 NJ0000027193 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NJD002200046

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00005

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 001

Direction Distance Elevation

vation Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 080
Waste Code: Not reported
Quantity: 00165

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 080 Year: 96

Document ID: NYG5019507 Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: Not reported Generator Ship Date: 06/21/2006 Trans1 Recv Date: 06/21/2006 Trans2 Recv Date: Not reported TSD Site Recv Date: 06/22/2006 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000022780 Trans1 EPA ID: 1638063ME Trans2 EPA ID: Not reported TSDF ID: OHD066060609

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 02805

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 051

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00220

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 004

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 2006

Document ID: NJA2565745
Manifest Status: Completed copy

Trans1 State ID: S5811 Trans2 State ID: Not reported Generator Ship Date: 960605 Trans1 Recy Date: 960605 Trans2 Recv Date: Not reported TSD Site Recv Date: 960605 Part A Recv Date: Not reported Part B Recv Date: 960617

 Part B Recv Date:
 960617

 Generator EPA ID:
 NYR000022780

 Trans1 EPA ID:
 NJ0000027193

 Trans2 EPA ID:
 Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

TSDF ID: NJD002200046

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 080
Waste Code: Not reported
Quantity: 00165

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 080
Waste Code: Not reported
Quantity: 00385

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 007

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 080 Year: 96

Document ID: 06

Manifest Status: CTF1177240 Trans1 State ID: NYR000022780 Trans2 State ID: Not reported Generator Ship Date: CTD021816889 Trans1 Recv Date: Not reported Trans2 Recv Date: NJD054126164 TSD Site Recv Date: Not reported Part A Recv Date: Not reported Not reported Part B Recv Date:

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 1
Number of Containers: TT
Container Type: 1500
Handling Method: G
Specific Gravity: 1
Waste Code: B

Quantity: Not reported Units: Not reported Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported Specific Gravity: Not reported Year: Not reported

Document ID: 06

Direction Distance Elevation

Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Manifest Status: NYG3346587 Trans1 State ID: NYR000022780 Trans2 State ID: Not reported Generator Ship Date: OHD066060609 Trans1 Recv Date: Not reported OHD077772895 Trans2 Recv Date: TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 1
Number of Containers: DM
Container Type: 55
Handling Method: G
Specific Gravity: 1
Waste Code: B

Quantity: Not reported
Units: Not reported
Number of Containers: Not reported
Container Type: Not reported
Handling Method: Not reported
Specific Gravity: Not reported
Year: Not reported

Document ID: 06

Manifest Status: NYG5019507 Trans1 State ID: NYR000022780 Trans2 State ID: Not reported OHD066060609 Generator Ship Date: Trans1 Recv Date: Not reported Trans2 Recv Date: NJD054126164 TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 4
Number of Containers: DF
Container Type: 220
Handling Method: G
Specific Gravity: 1
Waste Code: B

Quantity: Not reported Units: Not reported Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported

Distance Elevation

Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

Specific Gravity:

1001090441

EDR ID Number

Year: Not reported

Not reported

Document ID: 06

Manifest Status: NYG5019507 Trans1 State ID: NYR000022780 Trans2 State ID: Not reported Generator Ship Date: OHD066060609 Trans1 Recv Date: Not reported NJD054126164 Trans2 Recv Date: TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Waste Code. IN

Quantity: Not reported Units: 51
Number of Containers: DM

Container Type: 2805
Handling Method: G
Specific Gravity: 1
Waste Code: B

Quantity: Not reported Units: Not reported Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported Specific Gravity: Not reported Year: Not reported

Document ID: 07

Manifest Status: 002771064JJK Trans1 State ID: NYR000022780 Trans2 State ID: Not reported OHD066060609 Generator Ship Date: Trans1 Recv Date: Not reported Trans2 Recv Date: NJD054126164 TSD Site Recv Date: Not reported Part A Recv Date: NYR000134957 Part B Recv Date: 2007-04-26

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 1
Number of Containers: DF
Container Type: 55
Handling Method: G
Specific Gravity: 1
Waste Code: B

Direction Distance Elevation

Site Database(s) **EPA ID Number**

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Quantity: Not reported Not reported Units: Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported Specific Gravity: Not reported Not reported Year:

Document ID: Not reported Manifest Status: Not reported NJD054126164 Trans1 State ID: Trans2 State ID: NYR000134957 Generator Ship Date: 4/20/2007 Trans1 Recv Date: 4/20/2007 Trans2 Recv Date: 4/26/2007 TSD Site Recy Date: 5/21/2007 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000022780 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: OHD066060609 Waste Code: Not reported 55

Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 2007 Year:

Manifest Tracking Num: 002771064JJK

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H061

Document ID: Not reported Manifest Status: Not reported NJD054126164 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 11/15/2007 Trans1 Recv Date: 11/15/2007 Trans2 Recv Date: Not reported TSD Site Recv Date: 11/30/2007 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000022780 Generator EPA ID: Trans1 EPA ID: Not reported

Direction Distance Elevation

on Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Trans2 EPA ID: Not reported
TSDF ID: OHD066060609
Waste Code: Not reported
Quantity: 500
Units: P - Pounds

Number of Containers: 2

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 1
Year: 2007

Manifest Tracking Num: 003109727JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: Not reported Generator Ship Date: 11/15/2007 11/15/2007 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 11/30/2007 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000022780 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: OHD066060609 Waste Code: Not reported Quantity: 500

Number of Containers: 2

Units:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

P - Pounds

Specific Gravity: 1

Year: 2007

Manifest Tracking Num: 003109727JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported

Direction Distance Elevation

evation Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Mgmt Method Type Code: H061

EPA ID: NYR000022780

Country: USA

Mailing Name: FINISHLINE TECHNOLOGIES INC

Mailing Contact: RICK HERMAN

Mailing Address: 1545 5TH INDUSTRIAL COURT

Mailing Address 2: Not reported
Mailing City: BAYSHORE
Mailing State: NY
Mailing Zip: 11706
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 516-666-7300

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: NYR000134957 Generator Ship Date: 2007-04-20 Trans1 Recv Date: 2007-04-20 Trans2 Recv Date: 2007-04-26 TSD Site Recv Date: 2007-05-21 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000022780 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: OHD066060609 Waste Code: Not reported

Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2007

Manifest Tracking Num: 002771064JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H061

Document ID: CTF1177240

Manifest Status: Not reported

Trans1 State ID: NJD054126164

Trans2 State ID: Not reported

Generator Ship Date: 05/15/2006

Direction Distance Elevation

n Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Trans1 Recv Date: 05/15/2006 Not reported Trans2 Recv Date: TSD Site Recv Date: 05/15/2006 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000022780 Generator EPA ID: Trans1 EPA ID: 1637862ME Trans2 EPA ID: Not reported TSDF ID: CTD021816889

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 01500

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 2006

Document ID: NYG3346587 Manifest Status: Not reported Trans1 State ID: OHD077772895 Trans2 State ID: Not reported Generator Ship Date: 06/29/2006 Trans1 Recv Date: 06/29/2006 Trans2 Recv Date: Not reported TSD Site Recy Date: 06/30/2006 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000022780 Generator EPA ID: Trans1 EPA ID: OH121 Trans2 EPA ID: Not reported TSDF ID: OHD066060609

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

S5811

NJD002200046

Specific Gravity: 01.00 Year: 2006

Trans1 State ID:

TSDF ID:

Document ID: NJA2565744
Manifest Status: Completed copy

Trans2 State ID: Not reported 960605 Generator Ship Date: Trans1 Recv Date: 960605 Trans2 Recv Date: Not reported 960605 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: 960617 Generator EPA ID: NYR000022780 Trans1 EPA ID: NJ0000027193 Trans2 EPA ID: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 080
Waste Code: Not reported
Quantity: 00165

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 080 Year: 96

NYG5019507 Document ID: Manifest Status: Not reported NJD054126164 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 06/21/2006 Trans1 Recy Date: 06/21/2006 Trans2 Recv Date: Not reported TSD Site Recv Date: 06/22/2006 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000022780 1638063ME Trans1 EPA ID: Not reported Trans2 EPA ID: TSDF ID: OHD066060609

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 02805

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 051

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00220

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 004

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 2006

Document ID: NJA2565745 Manifest Status: Completed copy Trans1 State ID: S5811 Trans2 State ID: Not reported Generator Ship Date: 960605 Trans1 Recv Date: 960605 Trans2 Recy Date: Not reported 960605 TSD Site Recy Date: Part A Recv Date: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FINISH LINE TECHNOLOGIES (Continued)

1001090441

Part B Recv Date: 960617 NYR000022780 Generator EPA ID: NJ0000027193 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NJD002200046

F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code:

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

B Incineration, heat recovery, burning. Handling Method:

Specific Gravity: 080 Waste Code: Not reported Quantity: 00165

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 080

Not reported Waste Code: Quantity: 00385

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 007

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 080 Year: 96

Document ID: 06

Manifest Status: CTF1177240 Trans1 State ID: NYR000022780 Trans2 State ID: Not reported CTD021816889 Generator Ship Date: Trans1 Recv Date: Not reported Trans2 Recv Date: NJD054126164 TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

Generator EPA ID: Ν Trans1 EPA ID: Ν Trans2 EPA ID: Ν TSDF ID: Ν Waste Code: Ν

Quantity: Not reported

Units: Number of Containers: TT Container Type: 1500 Handling Method: G Specific Gravity: 1 Waste Code: В

Quantity: Not reported Not reported Units: Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported Specific Gravity: Not reported

Direction Distance Elevation

ance EDR ID Number vation Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

Year:

1001090441

Document ID: 06

Manifest Status: NYG3346587 Trans1 State ID: NYR000022780 Trans2 State ID: Not reported OHD066060609 Generator Ship Date: Trans1 Recv Date: Not reported Trans2 Recv Date: OHD077772895 TSD Site Recv Date: Not reported Not reported Part A Recv Date: Part B Recv Date: Not reported

Not reported

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 1
Number of Containers: DM
Container Type: 55
Handling Method: G
Specific Gravity: 1
Waste Code: B

Quantity: Not reported
Units: Not reported
Number of Containers: Not reported
Container Type: Not reported
Handling Method: Not reported
Specific Gravity: Not reported
Year: Not reported

Document ID: 06

Manifest Status: NYG5019507 Trans1 State ID: NYR000022780 Trans2 State ID: Not reported Generator Ship Date: OHD066060609 Trans1 Recv Date: Not reported NJD054126164 Trans2 Recv Date: TSD Site Recv Date: Not reported Part A Recv Date: Not reported Not reported Part B Recv Date:

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 4
Number of Containers: DF
Container Type: 220
Handling Method: G
Specific Gravity: 1
Waste Code: B

Quantity: Not reported

Direction Distance Elevation

Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Units: Not reported Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported Specific Gravity: Not reported Year: Not reported

Document ID: 06

Manifest Status: NYG5019507 NYR000022780 Trans1 State ID: Trans2 State ID: Not reported OHD066060609 Generator Ship Date: Trans1 Recv Date: Not reported NJD054126164 Trans2 Recv Date: TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported Units: 51

Units: 51
Number of Containers: DM
Container Type: 2805
Handling Method: G
Specific Gravity: 1
Waste Code: B

Quantity: Not reported Units: Not reported Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported Specific Gravity: Not reported Year: Not reported

Document ID: 07

002771064JJK Manifest Status: Trans1 State ID: NYR000022780 Trans2 State ID: Not reported OHD066060609 Generator Ship Date: Trans1 Recv Date: Not reported Trans2 Recv Date: NJD054126164 TSD Site Recv Date: Not reported Part A Recv Date: NYR000134957 Part B Recv Date: 2007-04-26

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 1
Number of Containers: DF

Direction Distance Elevation

tion Site Database(s) EPA ID Number

FINISH LINE TECHNOLOGIES (Continued)

1001090441

EDR ID Number

Container Type: 55
Handling Method: G
Specific Gravity: 1
Waste Code: B

Quantity: Not reported
Units: Not reported
Number of Containers: Not reported
Container Type: Not reported
Handling Method: Not reported
Specific Gravity: Not reported
Year: Not reported

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: NYR000134957 Generator Ship Date: 4/20/2007 Trans1 Recv Date: 4/20/2007 Trans2 Recv Date: 4/26/2007 TSD Site Recv Date: 5/21/2007 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000022780 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: OHD066060609 Waste Code: Not reported

Quantity: 55

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1 Year: 2007

Manifest Tracking Num: 002771064JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H061

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: Not reported Generator Ship Date: 11/15/2007 Trans1 Recv Date: 11/15/2007 Trans2 Recy Date: Not reported TSD Site Recv Date: 11/30/2007

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FINISH LINE TECHNOLOGIES (Continued)

1001090441

Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYR000022780 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: OHD066060609 Not reported Waste Code: Quantity: 500

Units: P - Pounds

Number of Containers: Container Type:

DM - Metal drums, barrels Handling Method: L Landfill.

Specific Gravity: Year: 2007

003109727JJK Manifest Tracking Num:

Import Ind: Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Not reported Manifest Ref Num: Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H141

Not reported Document ID: Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: Not reported Generator Ship Date: 11/15/2007 Trans1 Recv Date: 11/15/2007 Not reported Trans2 Recv Date: TSD Site Recv Date: 11/30/2007 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000022780 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: OHD066060609 Waste Code: Not reported Quantity: 500

P - Pounds Units: Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

1

Specific Gravity:

2007 Year:

Manifest Tracking Num: 003109727JJK

Import Ind: Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FINISH LINE TECHNOLOGIES (Continued)

1001090441

NY CBS AST

Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H061

CBS:

CBS Number: 1-000062 Program Type: CBS Facility Status: Unregulated **Expiration Date:** N/A

Dec Region:

UTMX: 646478.67737000 UTMY: 4512755.56941

L49 RITE-OFF INC. CERCLIS 1000197805 SSW 1545 5TH INDUSTRIAL COURT RCRA NonGen / NLR NYD000726786

1/8-1/4 BAY SHORE, NY 11706

0.225 mi.

1189 ft. Site 4 of 4 in cluster L

CERCLIS: Relative:

Site ID: 0202968 Lower NYD000726786 EPA ID: Actual: Facility County: SUFFOLK 60 ft. Short Name: RITE-OFF INC.

Congressional District: 02

IFMS ID: Not reported SMSA Number: 5380 USGC Hydro Unit: 02030202

Federal Facility: Not a Federal Facility

DMNSN Number: 0.00000 Site Orphan Flag: Ν RCRA ID:

USGS Quadrangle: Not reported Site Init By Prog: Not reported NFRAP Flag: Not reported Parent ID: Not reported RST Code: Not reported

EPA Region: 02

Classification: Not reported Site Settings Code: Not reported NPL Status: Not on the NPL DMNSN Unit Code: Not reported RBRAC Code: Not reported RResp Fed Agency Code: Not reported

Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

Non NPL Status Date: 08/04/06 Site Fips Code: 36103 CC Concurrence Date:

CC Concurrence FY: Not reported Alias EPA ID: Not reported Site FUDS Flag: Not reported

CERCLIS Site Alias Name(s):

101 Alias ID:

Alias Name: RITE-OFF INC.

Direction Distance

Elevation Site Database(s) EPA ID Number

RITE-OFF INC. (Continued) 1000197805

Alias Address: Not reported

SUFFOLK, NY

Alias Comments: Not reported

Site Description: Not reported CERCLIS Assessment History:

Action Code: 001

Action: DISCOVERY
Date Started: //
Date Completed: 02/01/89
Priority Level: Not reported
Operable Unit: SITEWIDE

Primary Responsibility: EPA Fund-Financed Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

Action Code: 001

Action: PRELIMINARY ASSESSMENT

Date Started: 02/28/89 Date Completed: 03/31/89

Priority Level: Higher priority for further assessment

Operable Unit: SITEWIDE
Primary Responsibility: EPA Fund-Financed

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

Action Code: 001

Action: SITE REASSESSMENT

Date Started: / /

Date Completed: 04/11/04

Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

Operable Unit: SITEWIDE
Primary Responsibility: State, Fund Financed

Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported

RCRA NonGen / NLR:

Date form received by agency: 01/01/2007
Facility name: RITE OFF INC

Facility address: 1545 5TH INDUSTRIAL CT

BAYSHORE, NY 11706

EPA ID: NYD000726786

Mailing address: 5TH INDUSTRIAL CT
BAYSHORE, NY 11706

Contact: Not reported

Contact address: 5TH INDUSTRIAL CT

BAYSHORE, NY 11706

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RITE-OFF INC. (Continued)

1000197805

EPA Region: 02

Facility is not located on Indian land. Additional information is not known. Land type:

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: Not reported OWNERSTREET Owner/operator address:

OWNERCITY, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

OPERNAME Owner/operator name: Owner/operator address: **OPERSTREET**

OPERCITY, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006 Facility name: RITE OFF INC

Classification: Not a generator, verified

Date form received by agency: 03/23/1995 Facility name: RITE OFF INC

Classification: Not a generator, verified

Date form received by agency: 03/10/1994 Facility name: RITE OFF INC Site name: RITE-OFF INC

Classification: Large Quantity Generator

Direction Distance

Elevation Site Database(s) EPA ID Number

RITE-OFF INC. (Continued)

1000197805

EDR ID Number

Date form received by agency: 02/27/1992
Facility name: RITE OFF INC

Classification: Large Quantity Generator

Date form received by agency: 11/19/1980
Facility name: RITE OFF INC

Classification: Not a generator, verified

Date form received by agency: 09/02/1980
Facility name: RITE OFF INC

Classification: Not a generator, verified

Facility Has Received Notices of Violations:

Regulation violated:

Area of violation:

Generators - General

Date violation determined: 12/17/1986
Date achieved compliance: 06/26/1987
Violation lead agency: State

Enforcement action: INITIAL 3008(A) COMPLIANCE

Enforcement action date: 04/06/1987
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: 12500
Final penalty amount: 12500

Final penalty amount: 12500 Paid penalty amount: 12500

Evaluation Action Summary:

Evaluation date: 09/03/1996

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

EPA

Evaluation date: 09/01/1995

Evaluation: CASE DEVELOPMENT INSPECTION

Area of violation: Not reported Date achieved compliance: Not reported

Evaluation lead agency: EPA

Evaluation date: 12/17/1986

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 06/26/1987 Evaluation lead agency: State

CBS AST:

1-000062 CBS Number: ICS Number: 1-179755 PBS Number: Not reported MOSF Number: Not reported SPDES Number: Not reported **ACTIVE FACILITY** Facility Status: Facility Type: MANUFACTURING Telephone: (516) 665-6868

Facility Town: ISLIP
Region: STATE

Direction Distance

Elevation Site Database(s) EPA ID Number

RITE-OFF INC. (Continued) 1000197805

Expiration Date: 05/12/1995

Total Capacity of All Active Tanks(gal): 0

Operator: RITE OFF INC.
Emergency Contact: T. CUNNIFFE
Emergency Phone: (914) 763-3341
Owner Name: RITE OFF INC.
Owner Address: 1545 5TH INDUS CT.
Owner City,St,Zip: BAY SHORE, NY 11706

Owner Telephone: (516) 665-6868 Owner Type: Corporate/Commercial

Owner Sub Type:

Mail Name:

Mail Contact Addr:

Mail Contact Addr:

Mail Contact Addr2:

Not reported

Not reported

Not reported

Mail Contact Addr2: Not reported Mail Contact Contact: T. CUNNIFFE

Mail Contact City, St, Zip: BAY SHORE, NY 11706

Mail Phone: (516) 665-6868

Tank Id: 12
CAS Number: 75456
Federal ID: Not reported

 Tank Status:
 0

 Install Date:
 09/88

 Tank Closed:
 09/93

 Capacity (Gal):
 1850

Chemical: Chlorodifluoromethane
Tank Location: ABOVEGROUND
Tank Type: Steel/carbon steel

Total Tanks: 0
Tank Secret: False
Tank Containment: Diking

Tank Error Status: No Missing Data
Date Entered: 05/12/1989
Certified Date: 05/19/1993

Substance: Single Hazardous Substance on DEC List

Internal Protection: None

External Protection: Painted/Asphalt Coating

Pipe Location:

Pipe Type:

STEEL/IRON

Pipe Internal:

Pipe External:

Pipe Containment:

Pipe Flag:

Leak Detection:

Aboveground

Aboveground

Aboveground

Aboveground

STEEL/IRON

None

Overfill Protection: Float Vent Valve

Haz Percent: 100

Last Test: Not reported
Due Date: Not reported
SWIS Code: 4728

Lat/Long: Not reported Is Updated: False Renew Date: 02/01/93 Is It There: False Delinquent: False Date Expired: 05/12/95 Owner Mark: 1
Certificate Needs to be Printed: False

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

RITE-OFF INC. (Continued) 1000197805

Fiscal Amt for Registration Fee Correct: True Renewal Has Been Printed for Facility: True Pre-Printed Renewal App Last Printed: 02/01/1993

Tank Id: 13
CAS Number: 75456
Federal ID: Not reported

 Tank Status:
 0

 Install Date:
 09/88

 Tank Closed:
 09/93

 Capacity (Gal):
 1850

Chemical: Chlorodifluoromethane
Tank Location: ABOVEGROUND
Tank Type: Steel/carbon steel

Total Tanks: 0
Tank Secret: False
Tank Containment: Diking

Tank Error Status: No Missing Data
Date Entered: 05/12/1989
Certified Date: 05/19/1993

Substance: Single Hazardous Substance on DEC List

Internal Protection: None

External Protection: Painted/Asphalt Coating

Pipe Location: Aboveground
Pipe Type: STEEL/IRON

Pipe Internal:
Pipe External:
1
Pipe Containment:
Diking
Pipe Flag:
Diking
Leak Detection:
None

Overfill Protection: Float Vent Valve

Haz Percent: 100 Last Test: Not

Not reported Due Date: Not reported SWIS Code: 4728 Not reported Lat/Long: Is Updated: False Renew Date: 02/01/93 Is It There: False Delinquent: False Date Expired: 05/12/95 Owner Mark: Certificate Needs to be Printed: False Fiscal Amt for Registration Fee Correct: True Renewal Has Been Printed for Facility: True Pre-Printed Renewal App Last Printed: 02/01/1993

Tank Id: 10
CAS Number: 71556
Federal ID: Not reported

 Tank Status:
 0

 Install Date:
 03/89

 Tank Closed:
 09/93

 Capacity (Gal):
 6000

Chemical: 1,1,1-Trichloroethane

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

RITE-OFF INC. (Continued)

1000197805

EDR ID Number

Tank Location: ABOVEGROUND Tank Type: Stainless steel alloy

Total Tanks: 0
Tank Secret: False
Tank Containment: Diking

Tank Error Status: No Missing Data
Date Entered: 05/12/1989
Certified Date: 05/19/1993

Substance: Single Hazardous Substance on DEC List

Internal Protection: None

External Protection: Painted/Asphalt Coating

Pipe Location: Aboveground

Pipe Type: STAINLESS STEEL ALLOY

Pipe Internal:

Pipe External:

Pipe Containment:

Pipe Flag:

Diking

Diking

Leak Detection:

None

Overfill Protection: High Level Alarm

Haz Percent: 100

Last Test: Not reported Due Date: Not reported SWIS Code: 4728 Lat/Long: Not reported Is Updated: False Renew Date: 02/01/93 Is It There: False Delinguent: False Date Expired: 05/12/95 Owner Mark: Certificate Needs to be Printed: False Fiscal Amt for Registration Fee Correct: True Renewal Has Been Printed for Facility: True

Tank Id: 3
CAS Number: 75092
Federal ID: Not reported

Pre-Printed Renewal App Last Printed: 02/01/1993

 Tank Status:
 0

 Install Date:
 01/87

 Tank Closed:
 00/00

 Capacity (Gal):
 550

Chemical: Methylene chloride
Tank Location: ABOVEGROUND
Tank Type: Steel/carbon steel

Total Tanks: 0
Tank Secret: False
Tank Containment: Diking

Tank Error Status: Minor Data Missing
Date Entered: 05/12/1989
Certified Date: 05/19/1993

Substance: Single Hazardous Substance on DEC List

Internal Protection: None

External Protection: Painted/Asphalt Coating

Pipe Location: Aboveground Pipe Type: STEEL/IRON

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RITE-OFF INC. (Continued)

1000197805

Pipe Internal: None Pipe External: Pipe Containment: Diking Pipe Flag: Diking Leak Detection: None

Overfill Protection: High Level Alarm

Haz Percent:

Last Test: Not reported Due Date: Not reported SWIS Code: 4728 Lat/Long: Not reported Is Updated: False 02/01/93 Renew Date: Is It There: False Delinquent: False Date Expired: 05/12/95 Owner Mark: Certificate Needs to be Printed: False Fiscal Amt for Registration Fee Correct: True Renewal Has Been Printed for Facility: True Pre-Printed Renewal App Last Printed: 02/01/1993

Tank Id: CAS Number: 127184 Federal ID: Not reported

Tank Status: 0 Install Date: 01/87 09/93 Tank Closed: Capacity (Gal): 550

Chemical: Tetrachloroethylene Tank Location: **ABOVEGROUND** Tank Type: Steel/carbon steel

Total Tanks: Tank Secret: False Tank Containment: Diking

No Missing Data Tank Error Status: Date Entered: 05/12/1989 Certified Date: 05/19/1993

Substance: Single Hazardous Substance on DEC List

Internal Protection: None

External Protection: Painted/Asphalt Coating

Pipe Location: Aboveground STEEL/IRON Pipe Type: Pipe Internal: None Pipe External: Pipe Containment: Diking

Pipe Flag: Diking Leak Detection: None Overfill Protection:

High Level Alarm

Haz Percent: 100

Last Test: Not reported Due Date: Not reported SWIS Code: 4728 Lat/Long: Not reported Is Updated: False Renew Date: 02/01/93

Direction Distance

Elevation Site Database(s) EPA ID Number

RITE-OFF INC. (Continued) 1000197805

Is It There:

Delinquent:

Date Expired:

Owner Mark:

Certificate Needs to be Printed:

False

Fiscal Amt for Registration Fee Correct:

Renewal Has Been Printed for Facility:

Pre-Printed Renewal App Last Printed:

02/01/1993

<u>Click this hyperlink</u> while viewing on your computer to access 4 additional NY_AST_CBS: record(s) in the EDR Site Report.

M50 EDR US Hist Auto Stat 1015467519

North 4 SWEENEYDALE AVE N/A

1/8-1/4 BAY SHORE, NY 11706

0.245 mi.

1292 ft. Site 1 of 4 in cluster M

Relative: EDR Historical Auto Stations:

Higher Name: DELTA AUTO COLLISION INCORPORATED

Year: 2000

Actual: Address: 4 SWEENEYDALE AVE

71 ft.

Name: PRECISE AUTO BODY & REPAIR INC

Year: 2003

Address: 4 SWEENEYDALE AVE

Name: ALL ALLEN AUTO CO

Year: 2004

Address: 4 SWEENEYDALE AVE

Name: ALL ALLEN AUTO CO INC

Year: 2006

Address: 4 SWEENEYDALE AVE

Name: ALL ALLEN AUTO CO INC

Year: 2007

Address: 4 SWEENEYDALE AVE

Name: ALL ALLEN AUTO CO INC

Year: 2008

Address: 4 SWEENEYDALE AVE

M51 ALL ISLAND AUTO COMPANY INC NY SWF/LF S108145651
North 4 SWEENEYDALE AVENUE N/A

North 4 SWEENEYDALE AVENUE 1/8-1/4 BAYSHORE;, NY 11706

0.245 mi.

1292 ft. Site 2 of 4 in cluster M

Relative: SWF/LF:

Higher Flag: ACTIVE Region Code: 1

Actual: Phone Number: 6312336400 71 ft. Owner Name: Mario Vasconzelos

Owner Type: Private

Owner Address: 4 Sweeneydale Avenue

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ALL ISLAND AUTO COMPANY INC (Continued)

S108145651

S105841194

N/A

NY SWF/LF

Owner Addr2: Not reported

Owner City, St, Zip: Bayshore;, NY 11706 allislandauto@yahoo.com Owner Email:

Owner Phone: 6312336400 Contact Name: Not reported Contact Address: Not reported Contact Addr2: Not reported Contact City,St,Zip: Not reported Contact Email: Not reported Contact Phone: Not reported **Activity Desc:** Vehicle Dismantling

Activity Number: [52J13] Active: Yes East Coordinate: 646685 North Coordinate: 4513467 Accuracy Code: Not reported Regulatory Status: Not reported Waste Type: Not reported Authorization #: Not reported Authorization Date: Not reported **Expiration Date:** Not reported

N52 **CHAMPION RECYCLING** 1512 FIFTH INDUSTRIAL CT. SSW 1/8-1/4 **BAYSHORE, NY 11706**

0.245 mi.

1295 ft. Site 1 of 2 in cluster N

SWF/LF: Relative: Flag: Lower

INACTIVE Region Code: 1 Actual: Phone Number: 6316664044

59 ft. Owner Name: Champion Recycling

Owner Addr2:

Owner Type: Private

Owner Address: 1512 Fifth Industrial Court

Not reported

Owner City, St, Zip: Bayshore, NY 11706 Owner Email: Not reported Owner Phone: Not reported Contact Name: Not reported Contact Address: Not reported Contact Addr2: Not reported Contact City, St, Zip: Not reported Not reported Contact Email: Contact Phone: Not reported

Activity Desc: C&D processing - registration

[52W30] Activity Number: Active: No East Coordinate: 646300 North Coordinate: 4512700 Accuracy Code: Not reported Regulatory Status: Permit

Waste Type: Construction & Demolition Debris; Paper/Cardboard; Commingled Paper

1-4728-01419/00001 Authorization #:

Authorization Date: 10/25/1999 **Expiration Date:** 10/24/2002

Direction Distance

Elevation Site Database(s) EPA ID Number

N53 VINNEMONTES WASTE SYSTEMS RCRA NonGen / NLR 1000789396 SSW 1510 FIFTH INDUSTRIAL CT FINDS NYD987008562

1/8-1/4 BAY SHORE, NY

0.245 mi.

1295 ft. Site 2 of 2 in cluster N

Relative: RCRA NonGen / NLR:

Lower Date form received by agency: 01/01/2007

Facility name: VINNEMONTES WASTE SYSTEMS
Facility address: 1510 FIFTH INDUSTRIAL CT

Actual: Facility address: 1510 FIFTH INDUSTRIAL CT 59 ft. BAY SHORE, NY 117063402

EPA ID: NYD987008562

Mailing address: FIFTH INDUSTRIAL CT

BAY SHORE, NY 11706
Contact: Not reported

Contact address: FIFTH INDUSTRIAL CT

BAY SHORE, NY 11706

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: VINCENT MONTESANO

Owner/operator address: NOT REQUIRED

NOT REQUIRED, NY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: VINCENT MONTESANO Owner/operator address: NOT REQUIRED

NOT REQUIRED, NY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator

Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No **EDR ID Number**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

VINNEMONTES WASTE SYSTEMS (Continued)

1000789396

Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

VINNEMONTES WASTE SYSTEMS Facility name:

Not a generator, verified Classification:

Date form received by agency: 07/08/1999

VINNEMONTES WASTE SYSTEMS Facility name:

Classification: Not a generator, verified

Date form received by agency: 07/15/1992

Facility name: VINNEMONTES WASTE SYSTEMS

Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110006448095

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

M54 EDR US Hist Auto Stat 1015259221

1640 5TH AVE N/A

1/8-1/4 BAY SHORE, NY 11706

0.245 mi.

North

Site 3 of 4 in cluster M 1296 ft.

EDR Historical Auto Stations: Relative:

SALS AUTO Name: Higher

Year: 2002 Actual:

Address: 1640 5TH AVE 71 ft.

NY DRYCLEANERS S110247992 M55 STATE PLAZA SUPER LAUNDROMAT

NNE 1639 FIFTH AVENUE BAY SHORE, NY 11706 1/8-1/4

0.246 mi.

1298 ft. Site 4 of 4 in cluster M

DRYCLEANERS: Relative:

Facility ID: 1-4728-02837 Higher Phone Number: 631-951-2020 Actual: Not reported Region: 71 ft.

Registration Effective Date: Not reported Inspection Date: 04OCT26 Install Date: Not reported N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

STATE PLAZA SUPER LAUNDROMAT (Continued)

S110247992

NY MANIFEST

Drop Shop: Not reported

Shutdown:

Alternate Solvent: Not reported **Current Business:** Not reported

O56 GALE DELIVERY INC RCRA NonGen / NLR 1000196365 **45 SWEENEY DALE AVE FINDS** NYD982798068 North

1/8-1/4 BAY SHORE, NY 11706

0.247 mi.

1303 ft. Site 1 of 2 in cluster O

RCRA NonGen / NLR: Relative:

Higher Date form received by agency: 01/01/2007

Facility name: GALE DELIVERY INC Actual: 45 SWEENEY DALE AVE Facility address: 70 ft.

BAY SHORE, NY 11706

EPA ID: NYD982798068

Mailing address: **SWEENEY DALE AVE** BAY SHORE, NY 11706

Not reported

Contact: Contact address: **SWEENEY DALE AVE**

BAY SHORE, NY 11706

Contact country: US

Not reported Contact telephone: Contact email: Not reported

EPA Region:

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: WILLIAM M JOEL Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: WILLIAM M JOEL Owner/operator address: **NOT REQUIRED**

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No

Distance Elevation

ation Site Database(s) EPA ID Number

GALE DELIVERY INC (Continued)

1000196365

EDR ID Number

On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: GALE DELIVERY INC Classification: Not a generator, verified

Date form received by agency: 04/13/1995

Facility name: GALE DELIVERY INC

Classification: Unverified

Date form received by agency: 11/17/1989

Facility name: GALE DELIVERY INC
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004435861

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD982798068

Country: USA

Mailing Name: GALE DELIVERY
Mailing Contact: GALE DELIVERY

Mailing Address: 45 SWEENEY SALE AVENUE

Mailing Address 2: Not reported
Mailing City: BAY SHORE
Mailing State: NY
Mailing Zip: 11706
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 516-231-4444

Document ID: NYA8318169
Manifest Status: Completed copy
Trans1 State ID: MK8837
Trans2 State ID: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

GALE DELIVERY INC (Continued)

1000196365

N/A

Generator Ship Date: 891120 Trans1 Recv Date: 891120 Trans2 Recv Date: Not reported TSD Site Recv Date: 891121 Part A Recv Date: 891130 Part B Recv Date: 891129

Generator EPA ID: NYD982798068 Trans1 EPA ID: NYD006801245 Trans2 EPA ID: Not reported TSDF ID: NYD082785429

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

00055 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 89

057 S100491169 **TOWN CESSPOOL CO NY LTANKS**

North **55 SWEENYDALE AVENUE BAY SHORE, NY**

1/8-1/4 0.250 mi.

1319 ft. Site 2 of 2 in cluster O

LTANKS: Relative:

Site ID: 355654 Higher

Spill Number/Closed Date: 0509814 / 7/25/2006 Actual: Spill Date: 11/16/2005

70 ft. Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial

> Spill Class: Known release that creates potential for fire or hazard. DEC Response.

> > Willing Responsible Party. Corrective action taken.

Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 5228 Investigator: **HMCIRRIT** Referred To: Not reported 11/16/2005 Reported to Dept: CID: 408

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** False Remediation Phase: Date Entered In Computer: 11/16/2005

Spill Record Last Update: 7/31/2006

Spiller Name: FRED SCALAMANDRE

Spiller Company: FRED & JOSEPH SCALAMANDRE REAL ESTATE

Spiller Address: 157 ALBANY AVENUE Spiller City,St,Zip: FREEPORT, NY 11520

Spiller County: 001 Spiller Contact: **GARY** Spiller Phone: (631) 231-3309 Spiller Extention: Not reported

DEC Region:

DER Facility ID: 305685

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TOWN CESSPOOL CO (Continued)

S100491169

REPLACED ALL PIPING, NO CONTAMINATED SOIL REPORTED DEC Memo: RECOMMEND DIG UP TANK AND REPAIR OR REMOVE TANK Remarks:

Material:

Site ID: 355654 Operable Unit ID: 1113000 Operable Unit: 01 Material ID: 2103045 Material Code: 0001A Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: 314448

Spill Number/Closed Date: 9202302 / 7/6/1992

Spill Date: 5/26/1992 Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

7/6/1992 Cleanup Ceased: Cleanup Meets Standard: True SWIS: 5200 Investigator: T/T/F Referred To: Not reported 5/26/1992 Reported to Dept: CID: Not reported Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** False Remediation Phase: Date Entered In Computer: 5/27/1992 Spill Record Last Update: 10/11/2000

Spiller Company: TOWN CESSPOOL CO Spiller Address: 55 SWEENYDALE AVENUE

Not reported

Spiller City, St, Zip: BAY SHORE, NY

Spiller County: 001

Spiller Name:

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

DEC Region: DER Facility ID: 253534 DEC Memo: Not reported

Remarks: 2K FAILED GROSS LEAK, PETROTITE F&N TESTER, VISUAL LEAK NOTICED ON 1

1/4" VENT LINE, TEST SUSPENDED EXCAV DONE, NO ACTION YET DETERMINED

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TOWN CESSPOOL CO (Continued)

S100491169

Material:

Site ID: 314448 966399 Operable Unit ID: Operable Unit: 01 Material ID: 413559 Material Code: 0001A #2 Fuel Oil Material Name: Not reported Case No.: Material FA: Petroleum Quantity: 0 Units: Gallons No Recovered: Not reported Resource Affected: Oxygenate: False

Tank Test:

Site ID: 314448 Spill Tank Test: 1540040 Not reported Tank Number:

Tank Size: 0 Test Method: 00 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004 Test Method: Unknown

ENE 37 CONNITCUT AVE 1/4-1/2 **BAY SHORE, NY**

0.302 mi. 1594 ft.

58

LTANKS: Relative:

Lower Site ID: 97625 Spill Number/Closed Date: 9305786 / 8/11/1993

GUIDO RESIDENCE

Actual: Spill Date: 8/10/1993 65 ft. Tank Failure

Spill Cause: Spill Source: Private Dwelling

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Cleanup Ceased: 8/11/1993 Cleanup Meets Standard: True SWIS: 5200

Investigator: **UNASSIGNED** Referred To: Not reported Reported to Dept: 8/10/1993 CID: Not reported Water Affected: Not reported Spill Notifier: Other Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** False Remediation Phase: 0 Date Entered In Computer: 8/11/1993 Spill Record Last Update: 10/13/2000

TC3812742.2s Page 207

NY LTANKS

S100560244

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

GUIDO RESIDENCE (Continued)

S100560244

Spiller Name: Not reported **GUIDO RESIDENCE** Spiller Company: Not reported

Spiller Address: Spiller City, St, Zip: ZZ Spiller County: 001

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

DEC Region: DER Facility ID: 86933

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"NONE"08/11/93: NO RESPONSE NEEDED.

PUMP FAILURE, CUSTOMER WILL CLEANUP, RELIANCE WILL REPAIR PUMP Remarks:

Material:

97625 Site ID: Operable Unit ID: 987293 Operable Unit: 01 Material ID: 395691 Material Code: 0001A #2 Fuel Oil Material Name: Case No.: Not reported Material FA: Petroleum Quantity:

Units: Gallons Recovered: Nο Not reported Resource Affected:

False Oxygenate:

Tank Test:

P59 **ADVANCED ENGINEERED PRODUCTS** RCRA-CESQG 1007119330 **NY LTANKS** NYR000121236

North 25 DREXEL DR 1/4-1/2 BAY SHORE, NY 11706

0.331 mi.

1749 ft. Site 1 of 2 in cluster P

Relative:

RCRA-CESQG:

Higher

Date form received by agency: 06/23/2009

Facility name: ADVANCED ENGINEERED PRODUCTS Facility address: 25 DREXEL DR

Actual: 77 ft.

BAY SHORE, NY 11706

EPA ID: NYR000121236 Mailing address: DREXEL DR

> BAY SHORE, NY 11706 MARC ROSENFELD

Contact: Contact address: DREXEL DR

BAY SHORE, NY 11706

Contact country:

Contact telephone: (631) 582-7935

Contact email: MROSENFELD@UFCAERO.COM

EPA Region: 02 Land type: Private

Conditionally Exempt Small Quantity Generator Classification:

Description: Handler: generates 100 kg or less of hazardous waste per calendar

month, and accumulates 1000 kg or less of hazardous waste at any time;

NY MANIFEST

Direction Distance Elevation

Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: UFC AEROSPACE CORP

Owner/operator address: DREXEL DR

BAY SHORE, NY 11706

Owner/operator country: US

Owner/operator telephone: (631) 582-7921

Legal status: Owner/Operator Type:

Owner/Op start date:

Owner/Op end date:

Private Owner 10/01/1996 Not reported

Owner/operator name: UFC AEROSPACE CORP

Owner/operator address: DREXEL DR

BAY SHORE, NY 11706

Owner/operator country: US

Owner/operator telephone: (631) 582-7921

Legal status: Private

Owner/Operator Type: Operator
Owner/Op start date: 10/01/1996
Owner/Op end date: Not reported

Owner/operator name: DOUG DAVIS
Owner/operator address: Not reported
Not reported
Owner/operator country: Not reported

Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Owner Owner/Op start date: 02/19/1998 Owner/Op end date: Not reported

Owner/operator name: DOUG DAVIS
Owner/operator address: Not reported

Not reported

Not reported

Owner/operator country: Not reported Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Operator Owner/Op start date: 02/19/1998

Handler Activities Summary:

Owner/Op end date:

U.S. importer of hazardous waste: No

Direction Distance

Elevation Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: Nο Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2007

Facility name: ADVANCED ENGINEERED PRODUCTS

Site name: U F C AEROSPACE CORP
Classification: U F C AEROSPACE CORP
Not a generator, verified

Date form received by agency: 01/01/2006

Facility name: ADVANCED ENGINEERED PRODUCTS

Site name: U F C AEROSPACE CORP Classification: U F C AEROSPACE CORP Not a generator, verified

Date form received by agency: 12/09/2003

Facility name: ADVANCED ENGINEERED PRODUCTS

Site name: U F C AEROSPACE CORP Classification: Large Quantity Generator

Hazardous Waste Summary:

Waste code: D002

Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS

CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE

DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Waste code: D007 Waste name: CHROMIUM

Facility Has Received Notices of Violations:
Regulation violated:
Not reported

Area of violation: State Statute or Regulation

Date violation determined: 05/20/2009
Date achieved compliance: 07/07/2009
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 06/05/2009

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 07/10/2009
Enforcement lead agency: State
Proposed penalty amount: Not reported

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Final penalty amount: Not reported Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - Pre-transport

Date violation determined: 05/20/2009
Date achieved compliance: 07/07/2009
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 06/05/2009

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 07/10/2009
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - General

Date violation determined: 05/20/2009

Date achieved compliance: 07/07/2009

Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 06/05/2009

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 07/10/2009
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: TSD IS-Preparedness and Prevention

Date violation determined: 05/20/2009
Date achieved compliance: 07/07/2009
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 06/05/2009

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 07/10/2009
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - Manifest

Date violation determined: 05/20/2009
Date achieved compliance: 07/07/2009
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 06/05/2009

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 07/10/2009
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Universal Waste - Small Quantity Handlers

Date violation determined: 05/20/2009
Date achieved compliance: 07/07/2009
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 06/05/2009

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 07/10/2009
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - Records/Reporting

Date violation determined: 05/20/2009
Date achieved compliance: 07/07/2009
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 06/05/2009

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 07/10/2009
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 05/20/2009

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - Manifest

Date achieved compliance: 07/07/2009 Evaluation lead agency: State

Evaluation date: 05/20/2009

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - Records/Reporting

Date achieved compliance: 07/07/2009 Evaluation lead agency: State

Evaluation date: 05/20/2009

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: TSD IS-Preparedness and Prevention

Date achieved compliance: 07/07/2009 Evaluation lead agency: State

Evaluation date: 05/20/2009

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: State Statute or Regulation

Date achieved compliance: 07/07/2009 Evaluation lead agency: State

Evaluation date: 05/20/2009

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Direction Distance

Elevation Site Database(s) **EPA ID Number**

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Generators - General Area of violation:

07/07/2009 Date achieved compliance: State

Evaluation lead agency:

Evaluation date: 05/20/2009

COMPLIANCE EVALUATION INSPECTION ON-SITE Evaluation:

Area of violation: Universal Waste - Small Quantity Handlers

Date achieved compliance: 07/07/2009 Evaluation lead agency: State

Evaluation date: 05/20/2009

COMPLIANCE EVALUATION INSPECTION ON-SITE Evaluation:

Area of violation: Generators - Pre-transport

Date achieved compliance: 07/07/2009 Evaluation lead agency: State

LTANKS:

131000 Site ID:

Spill Number/Closed Date: 9606352 / 12/11/1996

Spill Date: 8/16/1996 Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. (Highly

Improbable)

Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 5200 T/T/F Investigator: Referred To: Not reported Reported to Dept: 8/16/1996 270 CID:

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** False Remediation Phase: 0 Date Entered In Computer: 8/16/1996 Spill Record Last Update: 10/16/2000 LEE MCGINITY

Spiller Name: Spiller Company: **REIGES & WALSH** Spiller Address: 199 MAIN STREET Spiller City, St, Zip: NORTHPORT, NY

Spiller County: 001 Spiller Contact: BOB

Spiller Phone: (516) 678-5115 Spiller Extention: Not reported

DEC Region: DER Facility ID: 112870 DEC Memo: Not reported Remarks: no comments

Material:

Site ID: 131000 1037331 Operable Unit ID: Operable Unit: 01 Material ID: 558334

Direction Distance

Elevation Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Material Code: 0001A

Material Name: #2 Fuel Oil

Case No.: Not reported

Material FA: Petroleum

Ouantity: 0

Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

 Site ID:
 131000

 Spill Tank Test:
 1544690

 Tank Number:
 001

 Tank Size:
 10000

 Test Method:
 03

 Leak Rate:
 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004

Test Method: Horner EZ Check I or II

NY MANIFEST:

EPA ID: NYR000121236

Country: USA

Mailing Name: U F C AEROSPACE CORP
Mailing Contact: U F C AEROSPACE CORP

Mailing Address: 25 DREXEL DR
Mailing Address 2: Not reported
Mailing City: BAY SHORE

Mailing State: NY
Mailing Zip: 11706
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 631-435-3535

Document ID: Not reported Not reported Manifest Status: Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported 9/11/2007 Generator Ship Date: Trans1 Recv Date: 9/11/2007 Trans2 Recv Date: Not reported TSD Site Recv Date: 9/11/2007 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 1800 Units: P - Pounds

Number of Containers: 6

Direction Distance Elevation

Site Database(s) **EPA ID Number**

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Container Type: CW - Wooden boxes

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1 Year: 2007

001033802JJK Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H061

Document ID: Not reported Not reported Manifest Status: Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 9/11/2007 Trans1 Recv Date: 9/11/2007 Trans2 Recv Date: Not reported TSD Site Recv Date: 9/11/2007 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 200 P - Pounds

Number of Containers:

Units:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: Year: 2007

001033802JJK Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJ0000027193

Direction Distance Elevation

Site Database(s) **EPA ID Number**

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Trans2 State ID: Not reported 9/11/2007 Generator Ship Date: Trans1 Recv Date: 9/11/2007 Trans2 Recv Date: Not reported TSD Site Recv Date: 9/11/2007 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD002200046 TSDF ID: Waste Code: Not reported Quantity: 325

Units: P - Pounds Number of Containers:

Container Type: CW - Wooden boxes

Handling Method: L Landfill. Specific Gravity: Year: 2007

001033802JJK Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: N

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Mgmt Method Type Code: H141

Document ID: Not reported Not reported Manifest Status: NJ0000027193 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2007-09-11 Trans1 Recv Date: 2007-09-11 Trans2 Recv Date: Not reported TSD Site Recv Date: 2007-09-11 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 200.0 Units: P - Pounds

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: Year: 2007

Manifest Tracking Num: 001033802JJK

Import Ind: Ν

Direction Distance Elevation

Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Not reported Document ID: Manifest Status: Not reported NJ0000027193 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2007-09-11 2007-09-11 Trans1 Recv Date: Trans2 Recv Date: Not reported 2007-09-11 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000121236 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 1800.0 Units: P - Pounds

Number of Containers: 6.0

Container Type: CW - Wooden boxes

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2007

Manifest Tracking Num: 001033802JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
Not reported
H061

Document ID: Not reported Manifest Status: Not reported NJ0000027193 Trans1 State ID: Trans2 State ID: Not reported 2007-09-11 Generator Ship Date: Trans1 Recv Date: 2007-09-11 Trans2 Recy Date: Not reported TSD Site Recy Date: 2007-09-11 Part A Recv Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 325.0 P - Pounds Units: Number of Containers: 1.0

Container Type: CW - Wooden boxes

Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2007

Manifest Tracking Num: 001033802JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Not reported
Not reported
H141

Document ID: Not reported Manifest Status: Not reported NYD082785429 Trans1 State ID: Not reported Trans2 State ID: Generator Ship Date: 2009-07-27 Trans1 Recv Date: 2009-07-27 Trans2 Recv Date: Not reported TSD Site Recv Date: 2009-07-29 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000121236 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported

Quantity: 110.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 2.0

TSDF ID:

Waste Code:

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.

NYD082785429

Not reported

Specific Gravity: 1.0
Year: 2009

Manifest Tracking Num: 002494251FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Direction Distance Elevation

ation Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NYD082785429 Trans2 State ID: Not reported 2009-07-27 Generator Ship Date: 2009-07-27 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 2009-07-29 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NYD082785429 TSDF ID: Waste Code: Not reported

Quantity: 5.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 1.0 Year: 2009

Manifest Tracking Num: 002494251FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported Not reported Manifest Status: NYD082785429 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2009-07-27 Trans1 Recv Date: 2009-07-27 Trans2 Recv Date: Not reported TSD Site Recv Date: 2009-07-29 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD082785429 Waste Code: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Quantity: 5.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 1.0 Year: 2009

Manifest Tracking Num: 002494251FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NYD082785429 Trans2 State ID: Not reported Generator Ship Date: 2009-07-27 Trans1 Recv Date: 2009-07-27 Trans2 Recv Date: Not reported 2009-07-29 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000121236 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD082785429 Waste Code: Not reported

Quantity: 5.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 1.0 Year: 2009

Manifest Tracking Num: 002494251FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H141

Direction Distance Elevation

on Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Document ID: Not reported Not reported Manifest Status: Trans1 State ID: NYD082785429 Trans2 State ID: Not reported Generator Ship Date: 2009-07-27 Trans1 Recv Date: 2009-07-27 Trans2 Recv Date: Not reported 2009-07-29 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Not reported Trans2 EPA ID: TSDF ID: NYD082785429 Waste Code: Not reported

Quantity: 5.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 1.0 Year: 2009

Manifest Tracking Num: 002494251FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported Manifest Status: Not reported NYD082785429 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2009-07-27 Trans1 Recv Date: 2009-07-27 Trans2 Recv Date: Not reported 2009-07-29 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000121236 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD082785429 Waste Code: Not reported Quantity: 110.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 2.0

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 1.0

Distance Elevation

Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Year: 2009

Manifest Tracking Num: 002494251FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported Manifest Status: Not reported NJ0000027193 Trans1 State ID: Trans2 State ID: Not reported 2010-02-18 Generator Ship Date: Trans1 Recv Date: 2010-02-18 Trans2 Recv Date: Not reported TSD Site Recy Date: 2010-02-18 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000121236 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 115.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 3.0

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 001055680GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID:

Manifest Status:
Not reported

Trans1 State ID:
NJ0000027193

Trans2 State ID:
Not reported

Generator Ship Date:
2010-02-18

Trans1 Recv Date:
2010-02-18

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

Trans2 Recv Date: Not reported 2010-02-18 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000121236 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported

Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 001055680GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported Not reported Manifest Status: Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported 2010-07-09 Generator Ship Date: Trans1 Recv Date: 2010-07-09 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-07-16 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000121236 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported

Quantity: 5.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 001053804GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N

Direction Distance Elevation

ration Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H061

Document ID: Not reported Manifest Status: Not reported NJ0000027193 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2010-07-09 Trans1 Recv Date: 2010-07-09 Trans2 Recv Date: Not reported TSD Site Recy Date: 2010-07-16 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 55.0 P - Pounds Units:

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 001053804GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H141

Document ID: Not reported Manifest Status: Not reported NJ0000027193 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2010-07-09 2010-07-09 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-07-16 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported

Direction Distance Elevation

n Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Trans2 EPA ID:
TSDF ID:
NJD002200046
Waste Code:
Quantity:
Units:
P - Pounds
Number of Containers:
1.0

Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 001053804GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported 2010-07-09 Generator Ship Date: 2010-07-09 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 2010-07-16 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000121236 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported

Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 001053804GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Distance Elevation

on Site Database(s) EPA ID Number

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

EDR ID Number

Mgmt Method Type Code: H061

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 2010-07-09 Trans1 Recv Date: 2010-07-09 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-07-16 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000121236 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported

Quantity: 55.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 001053804GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H061

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 2010-07-09 Trans1 Recv Date: 2010-07-09 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-07-16 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000121236 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 61.0 P - Pounds Units: Number of Containers: 1.0

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ADVANCED ENGINEERED PRODUCTS (Continued)

1007119330

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2010

001053804GBF Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H061

> Click this hyperlink while viewing on your computer to access 20 additional NY_MANIFEST: record(s) in the EDR Site Report.

P60 **DREXEL DRIVE ASSOC** NY LTANKS \$100781513 N/A

North **35 DREXEL DRIVE** 1/4-1/2 **BAY SHORE, NY**

0.331 mi.

1749 ft. Site 2 of 2 in cluster P

LTANKS: Relative:

Site ID: 291362 Higher Spill Number/Closed Date: 9311190 / 1/14/1994

Actual: Spill Date: 12/15/1993 77 ft. Spill Cause: Tank Test Failure

Spill Source: Commercial/Industrial

Spill Class: No spill occured. (Not Possible)

Cleanup Ceased: 1/14/1994 Cleanup Meets Standard: True SWIS: 5200 Investigator: T/T/F Referred To: Not reported Reported to Dept: 12/15/1993 CID: Not reported Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** False Remediation Phase:

Date Entered In Computer: 12/15/1993 Spill Record Last Update: 10/13/2000 Spiller Name: Not reported

Spiller Company: DREXEL DRIVE ASSOC

Spiller Address: Not reported

Spiller City,St,Zip: ΖZ Spiller County: 001

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

DEC Region:

DER Facility ID: 235918

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DREXEL DRIVE ASSOC (Continued)

S100781513

DEC Memo: Not reported

3K FAILED -.190, HORNER EZ II, BONAFIDE TESTER Remarks:

Material:

Site ID: 291362 989826 Operable Unit ID: Operable Unit: 01 Material ID: 390235 Material Code: 0001A Material Name: #2 Fuel Oil Not reported Case No.: Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No Resource Affected: Not reported

Tank Test:

Oxygenate:

Site ID: 291362 Spill Tank Test: 1542303 Tank Number: Not reported

False

Tank Size: Test Method: 00 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004 Test Method: Unknown

NATURES VALUE 61 NY LTANKS S108298894 North **54 DREXEL DRIVE** N/A

1/4-1/2 **BAY SHORE, NY** 0.340 mi.

1795 ft.

LTANKS: Relative:

373807 Higher Site ID:

Spill Number/Closed Date: 0609493 / 1/12/2007

Actual: Spill Date: 11/17/2006 77 ft. Spill Cause: Tank Failure

Spill Source: Commercial/Industrial

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Unknown Responsible Party. Corrective action taken. (ISR)

Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 5228 Investigator: **BXDONOVA** Referred To: Not reported Reported to Dept: 11/17/2006 CID: 444

Water Affected: Not reported Spill Notifier: Other Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** False

Direction Distance

Elevation Site Database(s) EPA ID Number

NATURES VALUE (Continued)

S108298894

EDR ID Number

Remediation Phase: 0

Date Entered In Computer: 11/20/2006 Spill Record Last Update: 1/17/2007 Spiller Name: TARIFF JAFFAR

Spiller Company: NATURES VALUE-VITAMIN COMPANY

Spiller Address: Not reported

Spiller City,St,Zip: NY Spiller County: 001

Spiller Contact: NICK CANONICO
Spiller Phone: (516) 352-3233
Spiller Extention: Not reported

DEC Region: 1
DER Facility ID: 323541

DEC Memo: NATURES VALUE PRESIDENT: OSCAR RAMJECT16:40 TELECON WITH NICK AT

NOVA, SUFFOLK COUNTY GAVE PERMISSION TO ABANDON IN PLACE DUE TO PROXIMITY TO BLDG AND ELECTRIC SERVICE. EVIDENCE OF OVERFILL/LEAKING FILL. TANK TOP 3 FT BGS LIMITED EXCAVATION POSSIBLE 3 1/2 YARDS SOIL REMOVED, SCHD APPROVED BACKFILL. TANK NOT COMPLETELY EXPOSED. ALL CONTAMINATED SOIL NOT REMOVED. AWAITING DIRECTION FROM DEC, PROPERTY BEING TRANSFERRED. OWNER MOTIVATED TO PERFORM ANY ADDITIONAL WORK

EXPEDITIOUSLY. GW @35 FT, MONITORING WELLS ON SITETANK AND

CONTAMINATED SOIL EXCAVATED TO A CLEAN ENDPOINT

Remarks: 1000 GALLON HAD A LEAK IT WAS FROM FILL PIPE

Material:

Site ID: 373807 Operable Unit ID: 1131502 Operable Unit: 01 Material ID: 2121212 Material Code: 0001A Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: Not reported Gallons Units: Recovered: No Resource Affected: Not reported

Tank Test:

Oxygenate:

62 AMERICAN BURNER CORP NNW 45 DREXEL DR

1/4-1/2 BAY SHORE, NY 11706 0.407 mi.

RCRA NonGen / NLR 1000890207 FINDS NY0000277582 NY SWF/LF

NY MANIFEST NY Spills

Relative: RCRA NonGen / NLR:

Higher Date form received by agency: 01/01/2007

Facility name: AMERICAN BURNER CORP

False

Actual: Facility address: 45 DREXEL DR

70 ft.

2149 ft.

BAY SHORE, NY 117062201

EPA ID: NY0000277582
Mailing address: DREXEL DR

BAY SHORE, NY 11706

Contact: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AMERICAN BURNER CORP (Continued)

1000890207

Contact address: DREXEL DR

BAY SHORE, NY 11706

US Contact country:

Not reported Contact telephone: Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: ABC SUNRAY CORP Owner/operator address: 45 DREXEL DR BAY SHORE, NY 11706

Owner/operator country: US

Owner/operator telephone: (516) 273-2929 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

ABC SUNRAY CORP Owner/operator name: Owner/operator address: 45 DREXEL DR

BAY SHORE, NY 11706

Owner/operator country: US

Owner/operator telephone: (516) 273-2929 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: AMERICAN BURNER CORP Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: AMERICAN BURNER CORP Classification: Not a generator, verified

Direction Distance

Elevation Site Database(s) EPA ID Number

AMERICAN BURNER CORP (Continued)

1000890207

EDR ID Number

Date form received by agency: 05/11/1994

Facility name: AMERICAN BURNER CORP Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004314974

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

SWF/LF:

Flag: ACTIVE

Region Code: 1

Phone Number: 6315860333
Owner Name: PSC LLC
Owner Type: Private

Owner Address: 5151 Sanfelipe Suite 1600

Owner Addr2: Not reported Owner City, St, Zip: Houston, TX 77056 Owner Email: Not reported Owner Phone: 7136238777 Contact Name: Fred Miranda Contact Address: Not reported Contact Addr2: Not reported Contact City, St, Zip: Not reported

Contact Email: fmiranda@pscnow.com

Contact Phone: 6315860333

Activity Desc: Transfer station - permit

Activity Number: [52T] Active: Yes East Coordinate: 646583 North Coordinate: 4513632 Accuracy Code: Not reported Regulatory Status: Permit Waste Type: Not reported Authorization #: 1-4728-00086/00002

Authorization #. 1-4720-00000000

Authorization Date: 06/22/2010 Expiration Date: 06/21/2015

NY MANIFEST:

EPA ID: NY0000277582

Country: USA

Mailing Name: AMERICAN BURNER CORP

Mailing Contact: L THOMPSON
Mailing Address: 45 DREXEL DRIVE
Mailing Address 2: Not reported
Mailing City: BAY SHORE

Mailing State: NY

Direction Distance

Elevation Site Database(s) EPA ID Number

AMERICAN BURNER CORP (Continued)

1000890207

EDR ID Number

Mailing Zip: 11706
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 516-273-2929

Document ID: NYB4941981 Completed copy Manifest Status: Trans1 State ID: PD9938 Trans2 State ID: Not reported 940603 Generator Ship Date: 940603 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 940603 Part A Recv Date: 940613 Part B Recv Date: 940615

 Generator EPA ID:
 NY0000277582

 Trans1 EPA ID:
 NYD082785429

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD082785429

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00125

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 085
Waste Code: Not reported
Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 109
Waste Code: Not reported
Quantity: 00020

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

SPILLS:

 Facility ID:
 1111403

 DER Facility ID:
 413753

 Facility Type:
 ER

 Site ID:
 459298

 DEC Region:
 1

Spill Date: 12/22/2011

Spill Number/Closed Date: 1111403 / 1/9/2012

Spill Cause: Human Error

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

SWIS: 5228
Investigator: Unassigned
Referred To: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AMERICAN BURNER CORP (Continued)

1000890207

Reported to Dept: 12/22/2011 CID: Not reported Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Responsible Party Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: 0

Date Entered In Computer: 12/22/2011 Spill Record Last Update: 4/23/2012

Spiller Name: RICHARD CAMARDA

Spiller Company: CHEMICAL POLLUTION CONTROL

Spiller Address: 45 DREXEL DR Spiller City,St,Zip: BAY SHORE, NY

Spiller Company: 999

Contact Name: RICHARD CAMARDA Contact Phone: (631) 252-9150 cell

DEC Memo: 12/22/11 1305 Hrs (A): Called Camarda- an employee was using a

portable container to fuel a truck and dropped the container.12/22/11 1305 Hrs (B); CPC applied sorbents, AND AB ENVIRONMENTAL IS

RESPONDING TO VACUUM OUT THE DRAIN. DR

Remarks: storm drain impacted - cleanup in progress -

Material:

459298 Site ID: Operable Unit ID: 1209391 Operable Unit: 01 2206799 Material ID: Material Code: 8000 Material Name: Diesel Case No.: Not reported Material FA: Petroleum Quantity: 10 Units: Gallons Recovered: Not reported Resource Affected: Not reported False Oxygenate:

Tank Test:

BP AMOCO NY LTANKS S104278645 **NY Spills** N/A

1672 5TH AVENUE North 1/4-1/2 **BAY SHORE, NY**

0.445 mi.

Q63

2348 ft. Site 1 of 2 in cluster Q

LTANKS: Relative:

Higher Site ID: 97256

Spill Number/Closed Date: 9909502 / 12/21/1999

Actual: Spill Date: 11/4/1999 74 ft. Spill Cause: Tank Test Failure Spill Source: **Gasoline Station**

> Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BP AMOCO (Continued) S104278645

Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 5228 Investigator: T/T/F Referred To: Not reported 11/4/1999 Reported to Dept: CID: 390

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** True Remediation Phase: 0 Date Entered In Computer: 11/4/1999 Spill Record Last Update: 7/9/2010

Spiller Name: LEON PETROLIUM Spiller Company: AMOCO STATION Spiller Address: 1672 5TH AVENUE Spiller City, St, Zip: BAY SHORE, NY 11706-

Spiller County: 001

Spiller Contact: LEON PETROLIUM Spiller Phone: (516) 420-8080 Spiller Extention: Not reported DEC Region:

DER Facility ID: 392116

DEC Memo: 11/4 14:50 MACCHETTE, INITIAL SYSTEM, REG NO LEAD, SUSPECT VENT LINE,

TYREE TO UNCOVER 11/5 AND RETESTFAILURE RELATED TO CRACK IN VENT PIPE FROM FENCE INSTALLATION, VENT LINES REPLACED, NO CONTAMINATION NOTED. TANKS PASSED RETEST, NO FURTHER ACTION REQUIREDSEE 99-09502 (OTHER

TANK)

tank failed test - no product spillage ***SEE 9909501 HERE- TANK TEST Remarks:

FAILURE OF 1 8K SUP NO LEAD***

Material:

Site ID: 97256 Operable Unit ID: 1084107 Operable Unit: 01 Material ID: 298585 0009 Material Code: Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported

Oxygenate: False

Tank Test:

Site ID: 97256 Spill Tank Test: 1547814 Not reported Tank Number: Tank Size: 8000 Test Method: 20 Leak Rate: 0

Gross Fail: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

BP AMOCO (Continued) S104278645

Modified By: Spills
Last Modified: 10/1/2004

Test Method: USTest 2000/P/LL plus USTest 2000/U

Site ID: 97255

Spill Number/Closed Date: 9909501 / 12/21/1999

Spill Date: 11/4/1999
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Cleanup Ceased: Not reported

Cleanup Meets Standard: True
SWIS: 5228
Investigator: T/T/F
Referred To: Not reported
Reported to Dept: 11/4/1999
CID: 390

Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 11/4/1999
Spill Record Last Update: 7/9/2010

Spiller Name: ALAN LEON
Spiller Company: AMOCO STATION
Spiller Address: 1672 5TH AVENUE
Spiller City, St, Zip: BAY SHORE, NY 11706-

Spiller County: 001

Spiller Contact: LEON PETROLIUM
Spiller Phone: (516) 420-8080
Spiller Extention: Not reported

DEC Region: 1
DER Facility ID: 392116

DEC Memo: 11/4 14:30 LEFT MESSAGE FOR MATCHETTE14:50 MACHETTE, INITIAL SYSTEM,

SUPER NO LEAD, SUSPECT VENT LINE, TYREE TO UNCOVER 11/5 AND

RETESTFAILURE RELATED TO CRACK IN VENT PIPE FROM FENCE INSTALLATION, VENT LINES REPLACED, NO CONTAMINATION NOTED, TANKS PASSED RETEST, NO

FURTHER ACTION REQUIREDSEE 99-09502 (OTHER TANK) tank failed test - no product spillage. ***SEE 9909502 HERE- TANK

TEST FAILURE OF 1 8K REG NO LEAD***

Material:

Remarks:

Recovered:

Site ID: 97255 Operable Unit ID: 1088192 Operable Unit: 01 Material ID: 298584 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Petroleum Material FA: Quantity: Units: Gallons

No

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BP AMOCO (Continued) S104278645

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: 97255 Spill Tank Test: 1547813 Not reported Tank Number: Tank Size: 8000 Test Method: 20 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004

USTest 2000/P/LL plus USTest 2000/U Test Method:

Site ID: 377471

Spill Number/Closed Date: 0612590 / 1/28/2010

Spill Date: 2/20/2007 Spill Cause: Tank Test Failure Spill Source: **Gasoline Station**

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 5228 Investigator: **HMCIRRIT** Referred To: Not reported Reported to Dept: 2/20/2007 CID: 444

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** True Remediation Phase: Date Entered In Computer: 2/20/2007 Spill Record Last Update: 1/30/2010 Spiller Name: ALLEN LEON Spiller Company: **BP AMOCO** Spiller Address: 1672 5TH AVENUE

Spiller City, St, Zip: BAY SHORE, NY Spiller County: 001

Spiller Contact: ALLEN LEON Spiller Phone: (631) 420-8080 Spiller Extention: Not reported

DEC Region: DER Facility ID: 327021

NEW TANKS INSTALLED JULY 2007, NO FURTHER ACTION DEC Memo:

Remarks: Not reported

Material:

Site ID: 377471 Operable Unit ID: 1135004 Operable Unit: 01 Material ID: 2124894

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BP AMOCO (Continued) S104278645

Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity: Not reported Units: Gallons Recovered: No Not reported

Resource Affected: Oxygenate: False

Tank Test:

Site ID: 377471 Spill Tank Test: 1550644 Tank Number: Tank Size: 8000 Test Method: 01 Leak Rate:

Gross Fail: Not reported Modified By: Watchdog 2/20/2007 Last Modified:

Test Method: Petro-Tite/Petro Comp

SPILLS:

Facility ID: 0701902 DER Facility ID: 327021 Facility Type: ER Site ID: 381512 DEC Region:

Spill Date: 5/16/2007

0701902 / 12/24/2010 Spill Number/Closed Date:

Spill Cause:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

SWIS: 5228 Investigator: kmyager Referred To: Not reported Reported to Dept: 5/16/2007 444 CID:

Water Affected: Not reported Spill Source: Gasoline Station

Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: 0 Date Entered In Computer: 5/16/2007 Spill Record Last Update: 12/29/2010 Spiller Name: **DENNIS MADIGAN**

Spiller Company: **BP AMOCO** Spiller Address: 1672 5TH AVENUE Spiller City,St,Zip: BAY SHORE, NY

Spiller Company:

Contact Name: **DENNIS MADIGAN**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BP AMOCO (Continued) S104278645

Contact Phone: (631) 249-3150

5/16/07 REFER TO SPILL 06-12590 T/T/F REMEDIAL ACTIVITIES ARE BEING DEC Memo:

CONDUCTED UNDER 03-25110 (KY)

REMOVING TANKS AND FOUND CONTAMINATED SOIL: HEALTH DEPT #5141 Remarks:

Material:

Site ID: 381512 Operable Unit ID: 1138964 Operable Unit: 01 Material ID: 2128968 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity: Not reported Gallons Units: Recovered: No Resource Affected: Not reported False

Tank Test:

Oxygenate:

DNS ASSOCIATES NY LTANKS U003538957

12 WISCONSIN COURT 1/4-1/2 **BAY SHORE, NY**

0.460 mi.

Q64

North

2430 ft. Site 2 of 2 in cluster Q

LTANKS: Relative:

Higher Site ID: 68073 Spill Number/Closed Date: 9802827 / 7/24/2001

Actual: Spill Date: 6/3/1998 74 ft. Spill Cause: Tank Test Failure

Spill Source: Commercial/Industrial

Known release that creates potential for fire or hazard. DEC Response. Spill Class:

Willing Responsible Party. Corrective action taken.

Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 5228 Investigator: T/T/F Referred To: Not reported 6/3/1998 Reported to Dept: CID: 266

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** False Remediation Phase: Date Entered In Computer: 6/3/1998 Spill Record Last Update: 10/9/2012 Spiller Name: MR WINNER Spiller Company: DNS ASSOCIATES Spiller Address: 12 WISCONSIN COURT Spiller City, St, Zip: BAY SHORE, NY 11076-

Spiller County: 001

Spiller Contact: MR WINNER **NY Spills**

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DNS ASSOCIATES (Continued)

U003538957

Spiller Phone: (516) 231-7744 Not reported Spiller Extention:

DEC Region: 1

DER Facility ID: 394403

DEC Memo: 6/3/98 16:00 LEFT MESSAGE FOR SEPESAME AS 99-25320

TANK WAS FULL BUT DIDN'T LEAK. BELIEVED TO BE THE TANK TOP. TANK TO Remarks:

BE UNCOVERED AND INSPECTED. ***SAME AS 9925320- CONTAMINATION FOUND

DURING REMOVAL OF 2 1K TANKS.***

Material:

Site ID: 68073 Operable Unit ID: 1063476 Operable Unit: 01 321148 Material ID: Material Code: 0001A #2 Fuel Oil Material Name: Not reported Case No.: Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: 68073 Spill Tank Test: 1545951 **NORTH** Tank Number: Tank Size: 1000 Test Method: 03 Leak Rate: 0 Gross Fail: Modified By: Spills 10/1/2004 Last Modified:

Test Method: Horner EZ Check I or II

SPILLS:

9925320 Facility ID: DER Facility ID: 394403 Facility Type: ER Site ID: 68074 DEC Region: Spill Date: 9/30/1999

Spill Number/Closed Date: 9925320 / 12/23/1999

Spill Cause: Other

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

SWIS: 5228 Investigator: COSTELLO Referred To: Not reported Reported to Dept: 9/30/1999 CID: Not reported Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Health Department

Direction Distance

Elevation Site Database(s) EPA ID Number

DNS ASSOCIATES (Continued)

Spiller Company:

U003538957

EDR ID Number

Cleanup Ceased: Not reported Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: 0 9/30/1999 Date Entered In Computer: Spill Record Last Update: 9/2/2010 Spiller Name: Not reported

Spiller Address: 12 WISCONSIN COURT Spiller City,St,Zip: BAY SHORE, NY 11706-

DNS ASSOC

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"COSTELLO 99-115"***SAME AS 9802827- TANK TEST FAILURE OF ONE OF THE TANKS.***9/30/99 14:00 CHRIS COSTELLO ENROUTE TO SITE.~65 YARDS OF CONT SOIL REMOVED, POST EXCAVATION SAMPLES OK, NO FURTHER ACTION

Remarks: While removing two 1-k tanks, contaminated soil was found.

Approx.thirty cu yds of contaminated soil excavated so far. ***SAME AS 9802827- TANK TEST FAILURE OF ONE OF THE TANKS.***

Material:

68074 Site ID: Operable Unit ID: 1089667 Operable Unit: 01 Material ID: 293454 Material Code: 0001A Material Name: #2 Fuel Oil Not reported Case No.: Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

65 LUMEX NY SHWS
NNW 100 SPENCE ST NY CBS AST

NNW 100 SPENCE ST 1/2-1 ISLIP, NY 11706

0.592 mi. 3124 ft.

Relative: SHWS:

Higher Program: HW Site Code: 338757

Actual: Classification: N
78 ft. Region: 1

Acres: Not reported
HW Code: 152155
Record Add: 11/18/1999
Record Upd: 08/24/2005
Updated By: EMZUK

Site Description: Description Not Available

S102638714

N/A

NY VCP

Direction Distance Elevation

Site Database(s) **EPA ID Number**

LUMEX (Continued) S102638714

Env Problem: Not reported Not reported Health Problem: Dump: Not reported Not reported Structure: Lagoon: Not reported Not reported Landfill: Not reported Pond: Disp Start: Not reported Disp Term: Not reported Lat/Long: Not reported Dell: Not reported Not reported Record Add: Record Upd: Not reported Updated By: Not reported Own Op: Not reported Sub Type: Not reported Owner Name: Not reported Owner Company: Not reported Owner Address: Not reported Owner Addr2: Not reported Owner City, St, Zip: Not reported Owner Country: Not reported HW Code: Not reported Waste Type: Not reported Waste Quantity: Not reported Waste Code: Not reported Crossref ID: Not reported Cross Ref Type Code: Not reported Cross Ref Type: Not reported Record Added Date: Not reported Record Updated: Not reported Updated By: Not reported

CBS AST:

CBS Number: 1-000149 ICS Number: 1-179732 PBS Number: Not reported MOSF Number: Not reported 0-133612 SPDES Number: **ACTIVE FACILITY** Facility Status:

Facility Type: MANUFACTURING Telephone: (516) 273-2200 Facility Town: **ISLIP** Region: STATE

Expiration Date: 07/06/1995

Total Capacity of All Active Tanks(gal):

THOMAS J. MCCRAVE Operator: **Emergency Contact:** THOMAS J. MCCRAVE

Emergency Phone: (516) 265-2985 Owner Name: LUMEX INC.

Owner Address: 100 SPENCE STREET Owner City, St, Zip: BAY SHORE, NY 11706

Owner Telephone: (516) 273-2200 Owner Type: Corporate/Commercial

Owner Sub Type: Not reported Mail Name: LUMEX INC.

100 SPENCE STREET Mail Contact Addr:

Direction Distance

Elevation Site Database(s) EPA ID Number

LUMEX (Continued) S102638714

Mail Contact Addr2: Not reported

Mail Contact Contact: THOMAS J. MCCRAVE
Mail Contact City,St,Zip: BAY SHORE, NY 11706

Mail Phone: (516) 273-2200

Tank Id: 001
CAS Number: 71556
Federal ID: Not reported

 Tank Status:
 0

 Install Date:
 01/79

 Tank Closed:
 00/00

 Capacity (Gal):
 275

Chemical: 1,1,1-Trichloroethane
Tank Location: ABOVEGROUND

Tank Type: Other Total Tanks: 0 Tank Secret: False Tank Containment: Diking

Tank Error Status: No Missing Data
Date Entered: 07/06/1989
Certified Date: 04/16/1993

Substance: Single Hazardous Substance on DEC List

Internal Protection: None

External Protection: Sacrificial Anode Pipe Location: Aboveground Pipe Type: **OTHER** Pipe Internal: None Pipe External: 0 Pipe Containment: Diking Pipe Flag: Diking Leak Detection: None Overfill Protection: None Haz Percent: 100

Haz Percent: 100
Last Test: Not reported
Due Date: Not reported
SWIS Code: 4728

Lat/Long: 78|58|50 / 11|01|10

Is Updated: False
Renew Date: 04/01/93
Is It There: False
Delinquent: False
Date Expired: 07/06/95

Owner Mark: 1

Certificate Needs to be Printed: 78|58|50 / 11|01|10
Fiscal Amt for Registration Fee Correct: 78|58|50 / 11|01|10
Renewal Has Been Printed for Facility: 78|58|50 / 11|01|10
Pre-Printed Renewal App Last Printed: 78|58|50 / 11|01|10

Tank Id: 003
CAS Number: 71556
Federal ID: Not reported

 Tank Status:
 0

 Install Date:
 01/79

 Tank Closed:
 00/00

 Capacity (Gal):
 275

Chemical: 1,1,1-Trichloroethane

Direction Distance

Elevation Site Database(s) EPA ID Number

LUMEX (Continued) S102638714

Tank Location: ABOVEGROUND

Tank Type: Other
Total Tanks: 0
Tank Secret: False
Tank Containment: Diking

Tank Error Status: No Missing Data
Date Entered: 07/06/1989
Certified Date: 04/16/1993

Substance: Single Hazardous Substance on DEC List

Internal Protection: None

External Protection: Sacrificial Anode Aboveground Pipe Location: OTHER Pipe Type: Pipe Internal: None Pipe External: Pipe Containment: Diking Pipe Flag: Diking Leak Detection: None Overfill Protection: None Haz Percent: 100

Last Test: Not reported Due Date: Not reported

SWIS Code: 4728

Lat/Long: 78|58|50 / 11|01|10

Is Updated: False
Renew Date: 04/01/93
Is It There: False
Delinquent: False
Date Expired: 07/06/95

Owner Mark: 1

Certificate Needs to be Printed: 78|58|50 / 11|01|10
Fiscal Amt for Registration Fee Correct: 78|58|50 / 11|01|10
Renewal Has Been Printed for Facility: 78|58|50 / 11|01|10
Pre-Printed Renewal App Last Printed: 78|58|50 / 11|01|10

Tank Id: 002
CAS Number: 71556
Federal ID: Not reported

 Tank Status:
 0

 Install Date:
 01/79

 Tank Closed:
 00/00

 Capacity (Gal):
 275

Chemical: 1,1,1-Trichloroethane
Tank Location: ABOVEGROUND

Tank Type: Other
Total Tanks: 0
Tank Secret: False
Tank Containment: Diking

Tank Error Status: No Missing Data
Date Entered: 07/06/1989
Certified Date: 04/16/1993

Substance: Single Hazardous Substance on DEC List

Internal Protection: None

External Protection: Sacrificial Anode
Pipe Location: Aboveground
Pipe Type: OTHER

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LUMEX (Continued) S102638714

Pipe Internal: None Pipe External: 0 Pipe Containment: Diking Pipe Flag: Diking Leak Detection: None Overfill Protection: None Haz Percent: 100

Last Test: Not reported Due Date: Not reported SWIS Code: 4728

78|58|50 / 11|01|10 Lat/Long:

Is Updated: False 04/01/93 Renew Date: Is It There: False Delinquent: False Date Expired: 07/06/95 Owner Mark:

78|58|50 / 11|01|10 Certificate Needs to be Printed: Fiscal Amt for Registration Fee Correct: 78|58|50 / 11|01|10 Renewal Has Been Printed for Facility: 78|58|50 / 11|01|10 Pre-Printed Renewal App Last Printed: 78|58|50 / 11|01|10

VCP:

VCP Program Type: Site Code: 58320 HW Code: V00127 Site Class: Ν SWIS: 5228 Region: Town: Islip

Acres: Not reported Date Record Added: 11/30/2000 Date Record Updated: 07/14/2004 Updated By: **VCPTRANS**

Site Description: Description Not Available

Env Problem: Not reported Health Problem: Not reported

66 PRESTIGELINE, INC. NNW **5 INEZ DR**

1/2-1 BAY SHORE, NY 11706

0.762 mi. 4022 ft.

SHWS: Relative:

Program: HW Higher Site Code: 338755 Actual: Classification: Ν 81 ft. Region:

Acres: Not reported HW Code: 152149 11/18/1999 Record Add: Record Upd: 08/08/2013 Updated By: **JBSWARTO**

Site Description: The site is located several hundred feet north of the former Hubbard

> Sand and Gravel Registry site. A Suffolk County Health Department investigation conducted in 1978 revealed a leak in the facility's

S113916580

N/A

NY SHWS

MAP FINDINGS Map ID Direction

Distance Elevation

Site Database(s) **EPA ID Number**

PRESTIGELINE, INC. (Continued)

S113916580

EDR ID Number

trichloroethene degreaser. The leaked contents were supposedly collected and then dumped in the rear of the property over several weeks. 1,1,1 trichloroethane was found at high levels in a monitoring well on the Hubbard property several hundred feet downgradient of the site. The Prestigeline property was designated a potential Registry site in order to investigate the suspicion that hazardous wastes had been disposed on site. A State-funded Preliminary Site Assessment was completed in April 1998. Only very low levels of tetrachloroethene and trichloroethene (TCE) were found in shallow groundwater in the former solvent spill area. No TCE or other volatile compounds were found in deeper groundwater at that location. No TCE was detected in any other groundwater or soil samples from the site, indicating that the residual effects of the spill were quite localized. According to available information, the soil in the spill area has been cleaned up and, therefore, it is unlikely that an ongoing source is present. No further action is needed and this site is no longer considered to be a potential Registry site.

Only localized minor contamination remained in the shallow

groundwater at the spill location when the site was sampled in 1997.

Env Problem: Health Problem: Not reported Not reported Dump: Structure: Not reported Not reported Lagoon: Landfill: Not reported Pond: Not reported Not reported Disp Start: Disp Term: Not reported Lat/Long: Not reported Dell: Not reported Record Add: Not reported Record Upd: Not reported Updated By: Not reported Own Op: Not reported Sub Type: Not reported Not reported Owner Name: Not reported Owner Company: Owner Address: Not reported Owner Addr2: Not reported Owner City, St, Zip:

Not reported Not reported Not reported Not reported Not reported Not reported Not reported

Cross Ref Type: Not reported Record Added Date: Not reported Record Updated: Not reported Updated By: Not reported

Cross Ref Type Code: Not reported

Owner Country:

Waste Quantity:

Waste Code:

Crossref ID:

HW Code: Waste Type:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

67 **ALPHA WINDOWS** NY DEL SHWS S108295838 North **1760 5TH AVENUE NY Spills** N/A

1/2-1 0.900 mi. 4752 ft.

DEL SHWS: Relative:

BAY SHORE, NY

Higher Year: Not reported Site Code Id: Not reported Actual: Site Classification: Not reported 78 ft.

Region:

Epa Id Number: Not reported

Site Type - Dump: No Site Type - Structure: No Site Type - Lagoon: No Site Type - Landfill: No Site Type - Treat Pond: No

Site Size (Acres): Not reported Site Size Comment: Not reported Period Assoc/HW Start: Not reported Period Assoc/HW End: Not reported Lat/Long: Not reported Lat/Long Decimal: Not reported Lat/Long (dms): Not reported Hazardous Waste Code: 152228 Hazard Waste Disposed: Not reported Quantity: Not reported

Air Data Available: No SW Std Contravention: No GW Std Contravention: No

Soil Type: Not reported

Sediment Data Available: No GW Std Contravention: No DW Std Contravention: No SW Std Contravention: No Air Stand Contraventions: No

Legal Action Type: Not reported

State Legal Action: No Federal Legal Action: No

Enforce Status Code: Not reported

Remedial Act Proposed: No Rem Act Under Design: No No Rem Act In Progress: Rem Act Completed: No

Remedial Action Type: Not reported Soil Type: Not reported Depth To Groundwater: Not reported Owner Name: Not reported Owner Address: Not reported Owner City, St, Zip: Not reported Owner Phone: Not reported Not reported Owner Contact Name: Owner During Disposal: Not reported Owner During Use: Not reported Operator Name: Not reported Operator Address: Not reported Operator City, St, Zip: Not reported Operator Phone: Not reported

Not reported

Operator Contact Name:

Map ID MAP FINDINGS
Direction

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

ALPHA WINDOWS (Continued)

S108295838

Oper During Disposal: Not reported Site Type: Not reported HW Disposal Period: Not reported Analytical Data Available: Not reported Applicable Std Exceeded: Not reported Geotech Info: Not reported Depth To Groundwater: Not reported Status: Not reported Nature Of Action: Not reported Env Prob Assessment: Not reported Not reported Site Description: Confirmed HW: Not reported **Environment Assesment:** Not reported Health Assesment: Not reported Disposal Start Date: Not reported Disposal Term Date: Not reported Air Violation: Not reported Groundwater Violation: Not reported Drink Water Violation: Not reported Surface Water Violation: Not reported Not reported Legal New York State: Legal Federal: Not reported Legal State: Not reported Remedial Action Active: Not reported Remedial Action Done: Not reported NPL Status: Not reported Count Operator: Not reported Count Owner: Not reported NYTM X: Not reported Not reported NYTM Y: Co Name: Not reported Co Addr: Not reported Operator Addr: Not reported Operator Addr 2: Not reported Operator Addr 3: Not reported Operator Addr 4: Not reported HWDP From: Not reported

From To:

Description:

Assessment of Health: Access to the site is unrestricted. Direct contact with contaminants in the soil is unlikely because the majority of the site is covered

Not reported

with buildings and pavement. People are not believed to be drinking the contaminated groundwater because the area is served by a public water supply system that is regularly monitored. Volatile organic compounds in the groundwater or soil may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Insufficient information exists to determine if soil vapor intrusion has impacted the indoor air quality of buildings on- or off-site.

Location: The site is located on the corner of 5th Avenue and

Candlewood Road in the hamlet of Bay Shore. Current Zoning/Use(s): It

is an industrial property where The primary use is retail sports apparel and garment work. The land directly to the west, south and east is commercial or industrial. To the north and to the southeast of 5th Avenue is residential and commercial. Site features: The site is approximately 1.7 acres in size. The area is pitched slightly to

Direction
Distance

Elevation Site Database(s) EPA ID Number

ALPHA WINDOWS (Continued)

S108295838

EDR ID Number

parking lots, and a small landscaped area. Approximately 75 % of the lot is covered by the main building. Historic Uses: The building was previously occupied by Alpha Windows. Activities included the manufacure of windows, insulated glass, steel clad doors, vinyl siding, and conducting sheet metal work. The property is currently occupied by South Shore Outdoor company which produces screen-printed and embroidered apparel for sport team uniforms. A Site Characterization (SC) was finalized in 2007. The SC identified a drywell as a potential source of contaminated soil and groundwater. Sampling indicated elevated levels of Volatile Organic Compounds (VOCs). A VOC groundwater plume was identified emanating from the drywell in a southeast direction. Sampling evidence indicates that hazardous materials were disposed in the drywell although the circumstance of this disposal is unknown. Site Geology: The site is underlain by the Upper Glacial Aquifer, an unconsolidated mixture of sand and gravel. The estimated average hydraulic conductivity of the Upper Glacial Aquifer is 270 ft/day horizontally and 27ft/day vertically. The Upper Glacial Aquifer has an average thickness of approximately 100 feet in the vicinity of the site. Depth to groundwater is approximately 35 feet. Ground water flows to the South-Southeast.

the east. The entire lot is comprised of a single building, asphalt

Env Assessment: Not reported HW Disposed/Quantity: Not reported Assess/Env Prog: Not reported Assess/Health Prob: Not reported Site Description: Not reported

SPILLS:

 Facility ID:
 0609103

 DER Facility ID:
 322948

 Facility Type:
 ER

 Site ID:
 373220

 DEC Region:
 1

 Spill Date:
 11/8/2006

Spill Number/Closed Date: 0609103 / 3/10/2007

Spill Cause: Other

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

SWIS: 5228
Investigator: DHRAYMON
Referred To: Not reported
Reported to Dept: 11/8/2006
CID: 444
Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier:

Cleanup Ceased:

Cleanup Meets Std:

Last Inspection:

Recommended Penalty:

UST Trust:

Remediation Phase:

Other

Not reported

False

Palse

Other

Not reported

False

Other

Date Entered In Computer: 11/8/2006
Spill Record Last Update: 5/22/2008
Spiller Name: JOHN KETSIS
Spiller Company: ALPHA WINDOWS

Direction Distance

Elevation Site Database(s) EPA ID Number

ALPHA WINDOWS (Continued)

S108295838

EDR ID Number

Spiller Address: 1760 5TH AVENUE Spiller City,St,Zip: BAY SHORE, NY

Spiller Company: 001

Contact Name: DAVID PARISI Contact Phone: (631) 395-9888

DEC Memo: RAINING TODAY11/814:50 CALLED PARISI, HE BELIEVES PRODUCT SPILLED

INTO EXCAVATION WHILE TANK WAS BEING REMOVED, WILL HAVE SOMEONE CALL WITH MORE DETAILS15:05 JOE PARISI CALLED FROM SITE, SPILLAGE MOSTLY ON GROUND, A LITTLE WENT INTO EXCAVATION, HE THE PUT BILL SKEATS, SCHD ON PHONE. HE HAS NOT YET CHECKED THE EXCAVATION, DEC REQUESTED UPDATE LATER TODAY, 16:20 LEFT MESSAGE FOR JOE11/8/06 PRODUCT SPILLED ONTO GROUND AND INTO EXCAVATION DURING REMOVAL OF TANK, SCHD

SATISIFED WITH CLEANUP

Remarks: 5000 GALLON TANK HAD A HOLE AND SOME CONTAMINATION: HEALTH DEPT ON

SCENE: ALL CLEANED UP

Material:

Site ID: 373220 Operable Unit ID: 1130936 Operable Unit: 01 Material ID: 2120626 Material Code: 0001A Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: 30 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

HW

412906

SRHEIGEL

Tank Test:

68 SOUTH SHORE OUTDOOR SITE

North 1760 FIFTH AVENUE 1/2-1 BAY SHORE, NY 11706

0.908 mi. 4794 ft.

Relative: SHWS:

Higher Actual:

79 ft.

Program: Site Code:

Updated By:

Classification: P
Region: 1
Acres: 1.720
HW Code: 152228
Record Add: 04/24/2009
Record Upd: 10/03/2013

Site Description: Location: The site is located on the corner of 5th Avenue and

Candlewood Road in the hamlet of Bay Shore. Current Zoning/Use(s): It

is an industrial property where The primary use is retail sports apparel and garment work. The land directly to the west, south and east is commercial or industrial. To the north and to the southeast of 5th Avenue is residential and commercial. Site features: The site is approximately 1.7 acres in size. The area is pitched slightly to the east. The entire lot is comprised of a single building, asphalt

NY SHWS

S113916739

N/A

Map ID
Direction
Distance

Site

Elevation

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

SOUTH SHORE OUTDOOR SITE (Continued)

S113916739

parking lots, and a small landscaped area. Approximately 75 % of the lot is covered by the main building. Historic Uses: The building was previously occupied by Alpha Windows. Activities included the manufacure of windows, insulated glass, steel clad doors, vinyl siding, and conducting sheet metal work. The property is currently occupied by South Shore Outdoor company which produces screen-printed and embroidered apparel for sport team uniforms. A Site Characterization (SC) was finalized in 2007. The SC identified a drywell as a potential source of contaminated soil and groundwater. Sampling indicated elevated levels of Volatile Organic Compounds (VOCs). A VOC groundwater plume was identified emanating from the drywell in a southeast direction. Sampling evidence indicates that hazardous materials were disposed in the drywell although the circumstance of this disposal is unknown. Site Geology: The site is underlain by the Upper Glacial Aquifer, an unconsolidated mixture of sand and gravel. The estimated average hydraulic conductivity of the Upper Glacial Aquifer is 270 ft/day horizontally and 27ft/day vertically. The Upper Glacial Aguifer has an average thickness of approximately 100 feet in the vicinity of the site. Depth to groundwater is approximately 35 feet. Ground water flows to the South-Southeast.

Env Problem:

The primary contaminants of concern at the site are, 1,1-dichloroethene, 1,1,1-trichloroethane, chloroethene and trichloroethene (TCE). These contaminants have been identified in a

drywells at levels that exceed unrestricted Soil Cleanup Objectives (SCOs). The maximum concentration was identified in the vicinity of a

drywell located in parking the lot. It contained

1,1,1-trichloroethane at 89,000 ppm, this exceeds the SCO of 0.68 ppm. The 2007 Preliminary Site Investigation identified a groundwater plume down gradient from this drywell. Groundwater flow is generally in a south-southeasterly direction. The site presents a significant environmental threat due to the continued release from unknown source

areas and drywells.

Health Problem: Access to the site is unrestricted. Direct contact with contaminants

in the soil is unlikely because the majority of the site is covered with buildings and pavement. People are not believed to be drinking the contaminated groundwater because the area is served by a public water supply system that is regularly monitored. Volatile organic compounds in the groundwater or soil may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Insufficient information exists to determine if soil vapor intrusion

has impacted the indoor air quality of buildings on- or off-site.

Dump: Not reported Not reported Structure: Lagoon: Not reported Landfill: Not reported Not reported Pond: Disp Start: Not reported Disp Term: Not reported Lat/Long: Not reported Not reported Dell: Record Add: Not reported Record Upd: Not reported Updated By: Not reported

Map ID MAP FINDINGS Direction

Distance
Elevation Site Database(s)

EDR ID Number EPA ID Number

S113916739

SOUTH SHORE OUTDOOR SITE (Continued)

Own Op: Owner Sub Type: NNN Owner Name: Allan Sobel

Owner Company: South Shore Outdoor Owner Address: 1760 5th Avenue Owner Addr2: Not reported

Owner City,St,Zip: Bay Shore, NY 11706
Owner Country: United States of America

HW Code: Not reported Waste Type: Not reported Waste Quantity: Not reported Waste Code: Not reported Crossref ID: Not reported Cross Ref Type Code: Not reported Cross Ref Type: Not reported Record Added Date: Not reported Record Updated: Not reported Updated By: Not reported Count: 20 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BAY SHORE	U004200387	SHAMROCK S/S	645 RTE 27A	11706	NY UST
BAY SHORE	U004199773	HESS STATION #32537	327 RTE 27A MONTAUK HWY	11706	NY UST
BAY SHORE	A100383619	SHAMROCK S/S	645 RTE 27A	11706	NY AST
BAY SHORE	A100383242	BRUNOS TRUCK REPAIR	101 5TH AVE	11706	NY AST
BAY SHORE	U004200255	GLOBAL MONTELLO GROUP #6610	515 MONTAUK HWY	11706	NY UST
BAY SHORE	1001223816	NYSDOT	SOUTHERN STATE PKY NORTHBOUND		RCRA NonGen / NLR, FINDS, NY MANIFEST
BAY SHORE	S112809665	ROADWAY	1200 SUNRISE HIGHWAY SERVICE R		NY Spills
BAY SHORE	S112229253	UNKNOWN	1160 SUNRISE HWY/PERKAL STREET		NY Spills
BAY SHORE	S110611824	SOUTH SHORE MALL	SUNRISE HIGHWAY		NY Spills
BAY SHORE	S110138938	SOUTHWEST SEWER DISTRICT #3	SUNRISE HIGHWAY WESTBOUND SERV	11706	NY Spills
BAY SHORE	S106124954	UNKNOWN	EB SUNRISE HWY/W/O BROOK		NY Spills
BAY SHORE	S106007090	UNK	SUNRISE HWY SVCE RD-EAST		NY Spills
BAY SHORE	S106006978	UNK	SUNRISE HWY SVCE RD-EAST		NY Spills
BAY SHORE	S104783968	UNKNOWN	SUNRISE HIGHWAY		NY Spills
BAY SHORE	S102097149	LILCO	SUNRISE HIGHWAY		NY Spills
BAY SHORE	1004759193	JCPENNEY	SUNRISE HWY SOUTH SHORE MALL	11706	RCRA NonGen / NLR, FINDS
BAYSHORE	1009231206	NEW YORK TELEPHONE	MONTAUK HWY	11706	NY MANIFEST
BRENTWOOD	S110490013	RUBY'S COSTUMES	1 HALLOWEEN HWY / PIONEER DRIV	11717	NY Spills
BRENTWOOD	1001028647	NYSDOT BIN 1049382	SAGTIKOS ST PKWY NB OVER495	11717	RCRA NonGen / NLR, NY MANIFEST
BRENTWOOD	1001028646	NYSDOT BIN 1049381	SAGTIKOS ST PKWY OV RTE 498 SB	11717	RCRA NonGen / NLR, NY MANIFEST

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 04/26/2013 Source: EPA
Date Data Arrived at EDR: 05/09/2013 Telephone: N/A

Number of Days to Update: 62 Next Scheduled EDR Contact: 01/20/2014
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources

EPA's Environmental Photographic Interpretation Center (EPIC)

Telephone: 202-564-7333

EPA Region 1 EPA Region 6

Telephone 617-918-1143 Telephone: 214-655-6659

EPA Region 3 EPA Region 7

Telephone 215-814-5418 Telephone: 913-551-7247

EPA Region 4 EPA Region 8

Telephone 404-562-8033 Telephone: 303-312-6774

EPA Region 5 EPA Region 9

Telephone 312-886-6686 Telephone: 415-947-4246

EPA Region 10

Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 04/26/2013 Source: EPA
Date Data Arrived at EDR: 05/09/2013 Telephone: N/A

Number of Days to Update: 62 Next Scheduled EDR Contact: 01/20/2014
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Source: EPA

Date of Government Version: 10/15/1991 Date Data Arrived at EDR: 02/02/1994 Date Made Active in Reports: 03/30/1994

Number of Days to Update: 56

Telephone: 202-564-4267 Last EDR Contact: 08/15/2011

Next Scheduled EDR Contact: 11/28/2011 Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal Delisted NPL site list

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 04/26/2013 Date Data Arrived at EDR: 05/09/2013 Date Made Active in Reports: 07/10/2013

Number of Days to Update: 62

Source: EPA Telephone: N/A

Last EDR Contact: 11/11/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: Quarterly

Federal CERCLIS list

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 04/26/2013 Date Data Arrived at EDR: 05/29/2013 Date Made Active in Reports: 08/09/2013

Number of Days to Update: 72

Source: EPA Telephone: 703-412-9810 Last EDR Contact: 11/11/2013

Next Scheduled EDR Contact: 03/10/2014 Data Release Frequency: Quarterly

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 05/31/2013 Date Data Arrived at EDR: 07/08/2013 Date Made Active in Reports: 12/06/2013

Number of Days to Update: 151

Source: Environmental Protection Agency

Telephone: 703-603-8704 Last EDR Contact: 10/11/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: Varies

Federal CERCLIS NFRAP site List

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 04/26/2013 Date Data Arrived at EDR: 05/29/2013 Date Made Active in Reports: 08/09/2013

Number of Days to Update: 72

Source: EPA Telephone: 703-412-9810

Last EDR Contact: 11/11/2013 Next Scheduled EDR Contact: 03/10/2014 Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/10/2013 Date Data Arrived at EDR: 10/02/2013 Date Made Active in Reports: 12/16/2013

Number of Days to Update: 75

Source: EPA

Telephone: 800-424-9346 Last EDR Contact: 10/02/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 09/10/2013 Date Data Arrived at EDR: 10/02/2013 Date Made Active in Reports: 12/16/2013 Number of Days to Update: 75

Source: Environmental Protection Agency Telephone: (212) 637-3660 Last EDR Contact: 10/02/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 09/10/2013 Date Data Arrived at EDR: 10/02/2013 Date Made Active in Reports: 12/16/2013

Number of Days to Update: 75

Source: Environmental Protection Agency

Telephone: (212) 637-3660 Last EDR Contact: 10/02/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 09/10/2013 Date Data Arrived at EDR: 10/02/2013 Date Made Active in Reports: 12/16/2013

Number of Days to Update: 75

Source: Environmental Protection Agency

Telephone: (212) 637-3660 Last EDR Contact: 10/02/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 09/10/2013 Date Data Arrived at EDR: 10/02/2013 Date Made Active in Reports: 12/16/2013

Number of Days to Update: 75

Source: Environmental Protection Agency

Telephone: (212) 637-3660 Last EDR Contact: 10/02/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Varies

Federal institutional controls / engineering controls registries

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 06/17/2013 Date Data Arrived at EDR: 06/21/2013 Date Made Active in Reports: 10/03/2013 Number of Days to Update: 104

Source: Environmental Protection Agency Telephone: 703-603-0695 Last EDR Contact: 12/09/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 06/17/2013 Date Data Arrived at EDR: 06/21/2013 Date Made Active in Reports: 10/03/2013

Number of Days to Update: 104

Source: Environmental Protection Agency Telephone: 703-603-0695

Last EDR Contact: 12/09/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Varies

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 08/20/2013 Date Data Arrived at EDR: 08/23/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 70

Source: Department of the Navy Telephone: 843-820-7326 Last EDR Contact: 11/18/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 09/30/2013 Date Data Arrived at EDR: 10/01/2013 Date Made Active in Reports: 12/06/2013

Number of Days to Update: 66

Source: National Response Center, United States Coast Guard

Telephone: 202-267-2180 Last EDR Contact: 10/01/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Annually

State- and tribal - equivalent CERCLIS

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9622 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Annually

VAPOR REOPENED: Vapor Intrustion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

Date of Government Version: 01/01/2013 Date Data Arrived at EDR: 02/20/2013 Date Made Active in Reports: 03/15/2013

Number of Days to Update: 23

Source: Department of Environmenal Conservation

Telephone: 518-402-9814 Last EDR Contact: 11/22/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Varies

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 10/08/2013 Date Data Arrived at EDR: 10/09/2013 Date Made Active in Reports: 11/14/2013

Number of Days to Update: 36

Source: Department of Environmental Conservation

Telephone: 518-457-2051 Last EDR Contact: 10/07/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: Semi-Annually

State and tribal leaking storage tank lists

LTANKS: Spills Information Database

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 09/25/2013 Date Data Arrived at EDR: 09/26/2013 Date Made Active in Reports: 11/15/2013

Number of Days to Update: 50

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 11/22/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Varies

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 07/08/2005 Date Made Active in Reports: 07/14/2005

Number of Days to Update: 6

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 07/07/2005 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 03/01/2013 Date Data Arrived at EDR: 03/01/2013 Date Made Active in Reports: 04/12/2013

Number of Days to Update: 42

Source: Environmental Protection Agency

Telephone: 415-972-3372 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Quarterly

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 02/01/2013 Date Data Arrived at EDR: 05/01/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 184

Source: EPA Region 1 Telephone: 617-918-1313 Last EDR Contact: 11/01/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 08/01/2013 Date Data Arrived at EDR: 08/02/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 91

Source: EPA Region 4 Telephone: 404-562-8677 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Semi-Annually

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 08/27/2012 Date Data Arrived at EDR: 08/28/2012 Date Made Active in Reports: 10/16/2012

Number of Days to Update: 49

Source: EPA Region 8 Telephone: 303-312-6271 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Quarterly

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 08/27/2013 Date Data Arrived at EDR: 08/27/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 66

Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 09/12/2011 Date Data Arrived at EDR: 09/13/2011 Date Made Active in Reports: 11/11/2011

Number of Days to Update: 59

Source: EPA Region 6 Telephone: 214-665-6597 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Varies

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 08/20/2013 Date Data Arrived at EDR: 08/23/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 70

Source: EPA, Region 5 Telephone: 312-886-7439 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 11/06/2013 Date Data Arrived at EDR: 11/07/2013 Date Made Active in Reports: 12/06/2013

Number of Days to Update: 29

Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Quarterly

State and tribal registered storage tank lists

TANKS: Storage Tank Faciliy Listing

This database contains records of facilities that are or have been regulated under Bulk Storage Program. Tank information for these facilities may not be releasable by the state agency.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9543 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Quarterly

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002

Number of Days to Update: 30

Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 10/24/2005

Next Scheduled EDR Contact: 01/23/2006 Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or

greater.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002

Number of Days to Update: 30

Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005

Next Scheduled EDR Contact: 10/24/2005

Data Release Frequency: Varies

AST: Petroleum Bulk Storage

Registered Aboveground Storage Tanks.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002

Number of Days to Update: 30

Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005

Next Scheduled EDR Contact: 10/24/2005 Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002

Number of Days to Update: 30

Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005

Next Scheduled EDR Contact: 10/24/2005 Data Release Frequency: No Update Planned

CBS: Chemical Bulk Storage Site Listing

These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Quarterly

MOSF: Major Oil Storage Facility Site Listing

These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Quarterly

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 08/01/2013 Date Data Arrived at EDR: 08/02/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 91

Source: EPA Region 4 Telephone: 404-562-9424 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Semi-Annually

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 09/28/2012 Date Data Arrived at EDR: 11/07/2012 Date Made Active in Reports: 04/12/2013

Number of Days to Update: 156

Source: EPA, Region 1 Telephone: 617-918-1313 Last EDR Contact: 11/01/2014

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 08/20/2013 Date Data Arrived at EDR: 08/23/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 70

Source: EPA Region 5 Telephone: 312-886-6136 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 05/10/2011 Date Data Arrived at EDR: 05/11/2011 Date Made Active in Reports: 06/14/2011

Number of Days to Update: 34

Source: EPA Region 6 Telephone: 214-665-7591 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Semi-Annually

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 12/31/2012 Date Data Arrived at EDR: 02/28/2013 Date Made Active in Reports: 04/12/2013

Number of Days to Update: 43

Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 07/29/2013 Date Data Arrived at EDR: 08/01/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 92

Source: EPA Region 8 Telephone: 303-312-6137 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Quarterly

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 02/05/2013 Date Data Arrived at EDR: 02/06/2013 Date Made Active in Reports: 04/12/2013

Number of Days to Update: 65

Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Quarterly

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 07/29/2013 Date Data Arrived at EDR: 07/30/2013 Date Made Active in Reports: 12/06/2013

Number of Days to Update: 129

Source: EPA Region 9 Telephone: 415-972-3368 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Quarterly

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010 Date Data Arrived at EDR: 02/16/2010 Date Made Active in Reports: 04/12/2010

Number of Days to Update: 55

Source: FEMA

Telephone: 202-646-5797 Last EDR Contact: 10/17/2013

Next Scheduled EDR Contact: 01/27/2014 Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9553 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9553 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Quarterly

RES DECL: Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 11/18/2010 Date Data Arrived at EDR: 12/23/2010 Date Made Active in Reports: 02/11/2011

Number of Days to Update: 50

Source: NYC Department of City Planning

Telephone: 212-720-3401 Last EDR Contact: 09/27/2013

Next Scheduled EDR Contact: 01/08/2014 Data Release Frequency: No Update Planned

State and tribal voluntary cleanup sites

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008 Date Data Arrived at EDR: 04/22/2008 Date Made Active in Reports: 05/19/2008

Number of Days to Update: 27

Source: EPA, Region 7 Telephone: 913-551-7365 Last EDR Contact: 04/20/2009

Next Scheduled EDR Contact: 07/20/2009

Data Release Frequency: Varies

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 09/17/2013 Date Data Arrived at EDR: 10/01/2013 Date Made Active in Reports: 12/06/2013

Number of Days to Update: 66

Source: EPA, Region 1 Telephone: 617-918-1102 Last EDR Contact: 10/01/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Varies

VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/20/2013

Number of Days to Update: 7

Source: Department of Environmental Conservation

Telephone: 518-402-9711 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Semi-Annually

State and tribal Brownfields sites

ERP: Environmental Restoration Program Listing

In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a \$200 million Environmental Restoration or Brownfields Fund as part of the \$1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9622 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Quarterly

BROWNFIELDS: Brownfields Site List

A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9764 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Semi-Annually

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 09/24/2013 Date Data Arrived at EDR: 09/24/2013 Date Made Active in Reports: 12/06/2013

Number of Days to Update: 73

Source: Environmental Protection Agency Telephone: 202-566-2777

Last EDR Contact: 09/24/2013

Next Scheduled EDR Contact: 01/08/2014 Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985 Date Data Arrived at EDR: 08/09/2004 Date Made Active in Reports: 09/17/2004 Number of Days to Update: 39

Source: Environmental Protection Agency

Telephone: 800-424-9346 Last EDR Contact: 06/09/2004 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Source: EPA, Region 9 Telephone: 415-947-4219

Date of Government Version: 01/12/2009 Date Data Arrived at EDR: 05/07/2009 Date Made Active in Reports: 09/21/2009

Number of Days to Update: 137

SWRCY: Registered Recycling Facility List A listing of recycling facilities.

Date of Government Version: 10/08/2013 Date Data Arrived at EDR: 10/09/2013 Date Made Active in Reports: 11/14/2013

Number of Days to Update: 36

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: No Update Planned

Last EDR Contact: 10/28/2013

Source: Department of Environmental Conservation

Telephone: 518-402-8705 Last EDR Contact: 10/07/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: Semi-Annually

SWTIRE: Registered Waste Tire Storage & Facility List A listing of facilities registered to accept waste tires.

Date of Government Version: 08/01/2006 Date Data Arrived at EDR: 11/15/2006 Date Made Active in Reports: 11/30/2006

Number of Days to Update: 15

Source: Department of Environmental Conservation

Telephone: 518-402-8694 Last EDR Contact: 10/22/2013

Next Scheduled EDR Contact: 02/03/2014 Data Release Frequency: Annually

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998 Date Data Arrived at EDR: 12/03/2007 Date Made Active in Reports: 01/24/2008

Number of Days to Update: 52

Source: Environmental Protection Agency

Telephone: 703-308-8245 Last EDR Contact: 11/04/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 08/06/2013 Date Data Arrived at EDR: 09/11/2013 Date Made Active in Reports: 10/03/2013

Number of Days to Update: 22

Source: Drug Enforcement Administration

Telephone: 202-307-1000 Last EDR Contact: 12/05/2013

Next Scheduled EDR Contact: 03/17/2014 Data Release Frequency: Quarterly

DEL SHWS: Delisted Registry Sites

A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 11/13/2013 Date Data Arrived at EDR: 11/13/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 5

Source: Department of Environmental Conservation

Telephone: 518-402-9622 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Annually

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/01/2007 Date Data Arrived at EDR: 11/19/2008 Date Made Active in Reports: 03/30/2009

Number of Days to Update: 131

Source: Drug Enforcement Administration

Telephone: 202-307-1000 Last EDR Contact: 03/23/2009

Next Scheduled EDR Contact: 06/22/2009 Data Release Frequency: No Update Planned

Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 06/02/2006 Date Made Active in Reports: 07/20/2006

Number of Days to Update: 48

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/23/2006

Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: Varies

HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 06/02/2006 Date Made Active in Reports: 07/20/2006

Number of Days to Update: 48

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/23/2006

Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: No Update Planned

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 02/06/2013 Date Data Arrived at EDR: 04/25/2013 Date Made Active in Reports: 05/10/2013

Number of Days to Update: 15

Source: Environmental Protection Agency

Telephone: 202-564-6023 Last EDR Contact: 11/13/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Varies

LIENS: Spill Liens Information

Lien information from the Oil Spill Fund.

Date of Government Version: 08/19/2013 Date Data Arrived at EDR: 08/20/2013 Date Made Active in Reports: 09/11/2013

Number of Days to Update: 22

Source: Office of the State Comptroller

Telephone: 518-474-9034 Last EDR Contact: 11/08/2013

Next Scheduled EDR Contact: 02/24/2014 Data Release Frequency: Varies

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 09/30/2013 Date Data Arrived at EDR: 10/01/2013 Date Made Active in Reports: 12/16/2013

Number of Days to Update: 76

Source: U.S. Department of Transportation

Telephone: 202-366-4555 Last EDR Contact: 10/01/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Annually

SPILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 09/25/2013 Date Data Arrived at EDR: 09/26/2013 Date Made Active in Reports: 11/15/2013

Number of Days to Update: 50

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 11/22/2013

Next Scheduled EDR Contact: 03/03/2014

Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 07/08/2005 Date Made Active in Reports: 07/14/2005

Number of Days to Update: 6

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 07/07/2005 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 11/02/2010 Date Data Arrived at EDR: 01/03/2013 Date Made Active in Reports: 03/07/2013

Number of Days to Update: 63

Source: FirstSearch Telephone: N/A

Last EDR Contact: 01/03/2013 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 12/14/2012 Date Data Arrived at EDR: 01/03/2013 Date Made Active in Reports: 02/12/2013

Number of Days to Update: 40

Source: FirstSearch Telephone: N/A

Last EDR Contact: 01/03/2013 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous

Date of Government Version: 09/10/2013 Date Data Arrived at EDR: 10/02/2013 Date Made Active in Reports: 12/16/2013

Number of Days to Update: 75

Source: Environmental Protection Agency

Telephone: (212) 637-3660 Last EDR Contact: 10/02/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 07/31/2012 Date Data Arrived at EDR: 08/07/2012 Date Made Active in Reports: 09/18/2012

Number of Days to Update: 42

Source: Department of Transporation, Office of Pipeline Safety

Telephone: 202-366-4595 Last EDR Contact: 11/06/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 11/10/2006 Date Made Active in Reports: 01/11/2007

Number of Days to Update: 62

Source: USGS

Telephone: 888-275-8747 Last EDR Contact: 10/18/2013

Next Scheduled EDR Contact: 01/27/2014 Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2011 Date Data Arrived at EDR: 02/26/2013 Date Made Active in Reports: 03/13/2013

Number of Days to Update: 15

Source: U.S. Army Corps of Engineers

Telephone: 202-528-4285 Last EDR Contact: 12/13/2013

Next Scheduled EDR Contact: 03/24/2014

Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 06/30/2013 Date Data Arrived at EDR: 08/07/2013 Date Made Active in Reports: 10/03/2013

Number of Days to Update: 57

Source: Department of Justice, Consent Decree Library

Telephone: Varies

Last EDR Contact: 09/30/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 04/26/2013 Date Data Arrived at EDR: 06/11/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 143

Source: EPA

Telephone: 703-416-0223 Last EDR Contact: 12/12/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010 Date Data Arrived at EDR: 10/07/2011 Date Made Active in Reports: 03/01/2012

Number of Days to Update: 146

Source: Department of Energy Telephone: 505-845-0011 Last EDR Contact: 11/26/2013

Next Scheduled EDR Contact: 03/10/2014 Data Release Frequency: Varies

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 08/01/2013 Date Data Arrived at EDR: 09/05/2013 Date Made Active in Reports: 10/03/2013

Number of Days to Update: 28

Source: Department of Labor, Mine Safety and Health Administration

Telephone: 303-231-5959 Last EDR Contact: 12/06/2013

Next Scheduled EDR Contact: 03/17/2014 Data Release Frequency: Semi-Annually

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2011 Date Data Arrived at EDR: 07/31/2013 Date Made Active in Reports: 09/13/2013

Number of Days to Update: 44

Source: EPA

Telephone: 202-566-0250 Last EDR Contact: 11/27/2013

Next Scheduled EDR Contact: 03/10/2014 Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2006 Date Data Arrived at EDR: 09/29/2010 Date Made Active in Reports: 12/02/2010

Number of Days to Update: 64

Source: EPA

Telephone: 202-260-5521 Last EDR Contact: 09/24/2013

Next Scheduled EDR Contact: 01/08/2014 Data Release Frequency: Every 4 Years

FTTS: FIFRA/TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009

Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances

Telephone: 202-566-1667 Last EDR Contact: 11/21/2013

Next Scheduled EDR Contact: 03/10/2014 Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009

Number of Days to Update: 25

Source: EPA

Telephone: 202-566-1667 Last EDR Contact: 11/21/2014

Next Scheduled EDR Contact: 03/10/2014 Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006 Date Data Arrived at EDR: 03/01/2007 Date Made Active in Reports: 04/10/2007

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 12/17/2007

Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 12/17/2008

Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009 Date Data Arrived at EDR: 12/10/2010 Date Made Active in Reports: 02/25/2011

Number of Days to Update: 77

Source: EPA

Telephone: 202-564-4203 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 07/20/2011 Date Data Arrived at EDR: 11/10/2011 Date Made Active in Reports: 01/10/2012

Number of Days to Update: 61

Source: Environmental Protection Agency

Telephone: 202-564-5088 Last EDR Contact: 10/09/2014

Next Scheduled EDR Contact: 01/27/2014 Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 06/01/2013 Date Data Arrived at EDR: 07/17/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 107

Source: EPA

Telephone: 202-566-0500 Last EDR Contact: 10/18/2013

Next Scheduled EDR Contact: 01/27/2014 Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 07/22/2013 Date Data Arrived at EDR: 08/02/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 91

Source: Nuclear Regulatory Commission

Telephone: 301-415-7169 Last EDR Contact: 12/09/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 09/30/2013 Date Data Arrived at EDR: 10/09/2013 Date Made Active in Reports: 11/01/2013

Number of Days to Update: 23

Source: Environmental Protection Agency

Telephone: 202-343-9775 Last EDR Contact: 10/09/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 03/08/2013 Date Data Arrived at EDR: 03/21/2013 Date Made Active in Reports: 07/10/2013

Number of Days to Update: 111

Source: EPA Telephone: (212) 637-3000 Last EDR Contact: 12/10/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995 Date Data Arrived at EDR: 07/03/1995 Date Made Active in Reports: 08/07/1995

Number of Days to Update: 35

Source: EPA

Telephone: 202-564-4104 Last EDR Contact: 06/02/2008

Next Scheduled EDR Contact: 09/01/2008 Data Release Frequency: No Update Planned

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 05/08/2012 Date Data Arrived at EDR: 05/25/2012 Date Made Active in Reports: 07/10/2012

Number of Days to Update: 46

Source: Environmental Protection Agency Telephone: 202-564-8600

Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2011 Date Data Arrived at EDR: 02/26/2013 Date Made Active in Reports: 04/19/2013

Number of Days to Update: 52

Source: EPA/NTIS Telephone: 800-424-9346 Last EDR Contact: 11/25/2013

Next Scheduled EDR Contact: 03/10/2014 Data Release Frequency: Biennially

HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003 Date Data Arrived at EDR: 10/20/2006 Date Made Active in Reports: 11/30/2006

Number of Days to Update: 41

Source: Department of Environmental Conservation

Telephone: 518-402-9564 Last EDR Contact: 05/26/2009

Next Scheduled EDR Contact: 08/24/2009 Data Release Frequency: No Update Planned

UIC: Underground Injection Control Wells

A listing of enhanced oil recovery underground injection wells.

Date of Government Version: 09/10/2013 Date Data Arrived at EDR: 09/12/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 67

Source: Department of Environmental Conservation

Telephone: 518-402-8056 Last EDR Contact: 12/12/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Quarterly

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 11/01/2013 Date Data Arrived at EDR: 11/07/2013 Date Made Active in Reports: 11/18/2013

Number of Days to Update: 11

Source: Department of Environmental Conservation

Telephone: 518-402-8651 Last EDR Contact: 11/07/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: Annually

DRYCLEANERS: Registered Drycleaners

A listing of all registered drycleaning facilities.

Date of Government Version: 10/17/2013 Date Data Arrived at EDR: 10/17/2013 Date Made Active in Reports: 11/14/2013

Number of Days to Update: 28

Source: Department of Environmental Conservation

Telephone: 518-402-8403 Last EDR Contact: 12/16/2013

Next Scheduled EDR Contact: 03/31/2014 Data Release Frequency: Varies

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 07/15/2013 Date Data Arrived at EDR: 07/17/2013 Date Made Active in Reports: 09/09/2013

Number of Days to Update: 54

Source: Department of Environmental Conservation

Telephone: 518-402-8233 Last EDR Contact: 10/10/2013

Next Scheduled EDR Contact: 01/27/2014 Data Release Frequency: No Update Planned

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 12/31/2011 Date Data Arrived at EDR: 08/02/2012 Date Made Active in Reports: 10/03/2012

Number of Days to Update: 62

Source: Department of Environmental Conservation

Telephone: 518-402-8452 Last EDR Contact: 10/28/2013

Next Scheduled EDR Contact: 02/11/2014 Data Release Frequency: Annually

E DESIGNATION: E DESIGNATION SITE LISTING

The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 09/17/2013 Date Data Arrived at EDR: 10/02/2013 Date Made Active in Reports: 11/14/2013

Number of Days to Update: 43

Source: New York City Department of City Planning

Telephone: 718-595-6658 Last EDR Contact: 09/24/2013

Next Scheduled EDR Contact: 01/08/2014 Data Release Frequency: Varies

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 12/08/2006 Date Made Active in Reports: 01/11/2007

Number of Days to Update: 34

Source: USGS

Telephone: 202-208-3710 Last EDR Contact: 10/18/2013

Next Scheduled EDR Contact: 01/27/2014 Data Release Frequency: Semi-Annually

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 03/07/2011 Date Data Arrived at EDR: 03/09/2011 Date Made Active in Reports: 05/02/2011

Number of Days to Update: 54

Source: Environmental Protection Agency

Telephone: 615-532-8599 Last EDR Contact: 11/18/2013

Next Scheduled EDR Contact: 02/03/2014 Data Release Frequency: Varies

US AIRS MINOR: Air Facility System Data A listing of minor source facilities.

Date of Government Version: 10/23/2013 Date Data Arrived at EDR: 11/06/2013 Date Made Active in Reports: 12/06/2013

Number of Days to Update: 30

Source: EPA

Telephone: 202-564-5962 Last EDR Contact: 09/30/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Annually

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 02/06/2006 Date Made Active in Reports: 01/11/2007

Number of Days to Update: 339

Source: U.S. Geological Survey Telephone: 888-275-8747 Last EDR Contact: 10/18/2013

Next Scheduled EDR Contact: 01/27/2014

Data Release Frequency: N/A

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 06/30/2013 Date Data Arrived at EDR: 08/13/2013 Date Made Active in Reports: 09/13/2013

Number of Days to Update: 31

Source: Environmental Protection Agency

Telephone: 617-520-3000 Last EDR Contact: 11/15/2013

Next Scheduled EDR Contact: 02/24/2014 Data Release Frequency: Quarterly

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 10/28/2013 Date Data Arrived at EDR: 10/29/2013 Date Made Active in Reports: 12/06/2013

Number of Days to Update: 38

Source: Environmental Protection Agency

Telephone: 202-566-1917 Last EDR Contact: 11/18/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 11/11/2011 Date Data Arrived at EDR: 05/18/2012 Date Made Active in Reports: 05/25/2012

Number of Days to Update: 7

Source: Environmental Protection Agency

Telephone: 703-308-4044 Last EDR Contact: 11/15/2013

Next Scheduled EDR Contact: 02/24/2014 Data Release Frequency: Varies

COAL ASH: Coal Ash Disposal Site Listing
A listing of coal ash disposal site locations.

Date of Government Version: 10/08/2013 Date Data Arrived at EDR: 10/09/2013 Date Made Active in Reports: 11/14/2013

Number of Days to Update: 36

Source: Department of Environmental Conservation

Telephone: 518-402-8660 Last EDR Contact: 10/07/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: Varies

COAL ASH DOE: Sleam-Electric Plan Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 08/07/2009 Date Made Active in Reports: 10/22/2009

Number of Days to Update: 76

Source: Department of Energy Telephone: 202-586-8719 Last EDR Contact: 12/10/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 08/17/2010 Date Data Arrived at EDR: 01/03/2011 Date Made Active in Reports: 03/21/2011

Number of Days to Update: 77

Source: Environmental Protection Agency

Telephone: N/A

Last EDR Contact: 12/13/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Varies

Financial Assurance 2: Financial Assurance Information Listing

A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 10/31/2008 Date Data Arrived at EDR: 11/25/2008 Date Made Active in Reports: 12/11/2008

Number of Days to Update: 16

Source: Department of Environmental Conservation

Telephone: 518-402-8712 Last EDR Contact: 10/07/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: Varies

Financial Assurance 1: Financial Assurance Information Listing

Financial assurance information.

Date of Government Version: 10/15/2013 Date Data Arrived at EDR: 10/16/2013 Date Made Active in Reports: 11/14/2013

Number of Days to Update: 29

Source: Department of Environmental Conservation

Telephone: 518-402-8660 Last EDR Contact: 10/07/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: Quarterly

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 01/29/2013 Date Data Arrived at EDR: 02/14/2013 Date Made Active in Reports: 02/27/2013

Number of Days to Update: 13

Source: Environmental Protection Agency

Telephone: 703-603-8787 Last EDR Contact: 09/24/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001 Date Data Arrived at EDR: 10/27/2010 Date Made Active in Reports: 12/02/2010

Number of Days to Update: 36

Source: American Journal of Public Health

Telephone: 703-305-6451 Last EDR Contact: 12/02/2009 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/23/2013 Date Data Arrived at EDR: 11/06/2013 Date Made Active in Reports: 12/06/2013

Number of Days to Update: 30

Source: EPA

Telephone: 202-564-5962 Last EDR Contact: 09/30/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Annually

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 04/15/2013 Date Data Arrived at EDR: 07/03/2013 Date Made Active in Reports: 09/13/2013

Number of Days to Update: 72

Source: EPA

Telephone: 202-564-6023 Last EDR Contact: 10/04/2013

Next Scheduled EDR Contact: 01/13/2014 Data Release Frequency: Quarterly

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 02/01/2011 Date Data Arrived at EDR: 10/19/2011 Date Made Active in Reports: 01/10/2012

Number of Days to Update: 83

Source: Environmental Protection Agency

Telephone: 202-566-0517 Last EDR Contact: 11/01/2013

Next Scheduled EDR Contact: 02/11/2014

Data Release Frequency: Varies

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A

Number of Days to Update: N/A

Source: EDR, Inc. Telephone: N/A Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

EDR US Hist Auto Stat: EDR Exclusive Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A

Number of Days to Update: N/A

Source: EDR, Inc. Telephone: N/A Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

EDR US Hist Cleaners: EDR Exclusive Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

EDR US Hist Cleaners: EDR Proprietary Historic Dry Cleaners - Cole

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: N/A
Telephone: N/A
Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

EDR US Hist Auto Stat: EDR Proprietary Historic Gas Stations - Cole

Date of Government Version: N/A

Date Data Arrived at EDR: N/A

Date Made Active in Reports: N/A

Last EDR Contact: N/A

Number of Days to Update: N/A Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

COUNTY RECORDS

CORTLAND COUNTY:

Cortland County Storage Tank Listing

A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 08/23/2013 Date Data Arrived at EDR: 08/28/2013 Date Made Active in Reports: 09/12/2013

Number of Days to Update: 15

Source: Cortland County Health Department

Telephone: 607-753-5035 Last EDR Contact: 11/04/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: Quarterly

Cortland County Storage Tank Listing

A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 08/23/2013 Date Data Arrived at EDR: 08/28/2013 Date Made Active in Reports: 09/12/2013

Number of Days to Update: 15

Source: Cortland County Health Department

Telephone: 607-753-5035 Last EDR Contact: 11/04/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: Quarterly

NASSAU COUNTY:

Registered Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003 Date Data Arrived at EDR: 05/27/2003 Date Made Active in Reports: 06/09/2003

Number of Days to Update: 13

Source: Nassau County Health Department

Telephone: 516-571-3314 Last EDR Contact: 10/07/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: No Update Planned

Storage Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011 Date Data Arrived at EDR: 02/23/2011 Date Made Active in Reports: 03/29/2011

Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal

Telephone: 516-572-1000 Last EDR Contact: 11/04/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: Varies

Registered Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003 Date Data Arrived at EDR: 05/27/2003 Date Made Active in Reports: 06/09/2003

Number of Days to Update: 13

Source: Nassau County Health Department

Telephone: 516-571-3314 Last EDR Contact: 10/07/2013

Next Scheduled EDR Contact: 01/20/2014 Data Release Frequency: No Update Planned

Storage Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011 Date Data Arrived at EDR: 02/23/2011 Date Made Active in Reports: 03/29/2011

Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal

Telephone: 516-572-1000 Last EDR Contact: 11/04/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: Varies

ROCKLAND COUNTY:

Petroleum Bulk Storage Database

A listing of aboveground storage tank sites located in Rockland County.

Date of Government Version: 09/19/2013 Date Data Arrived at EDR: 09/20/2013 Date Made Active in Reports: 11/13/2013

Number of Days to Update: 54

Source: Rockland County Health Department

Telephone: 914-364-2605 Last EDR Contact: 12/09/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Quarterly

Petroleum Bulk Storage Database

A listing of underground storage tank sites located in Rockland County.

Date of Government Version: 09/19/2013 Date Data Arrived at EDR: 09/20/2013 Date Made Active in Reports: 11/13/2013

Number of Days to Update: 54

Source: Rockland County Health Department

Telephone: 914-364-2605 Last EDR Contact: 12/09/2013

Next Scheduled EDR Contact: 03/24/2014 Data Release Frequency: Quarterly

SUFFOLK COUNTY:

Storage Tank Database

A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 07/08/2013 Date Data Arrived at EDR: 09/10/2013 Date Made Active in Reports: 11/25/2013

Number of Days to Update: 76

Source: Suffolk County Department of Health Services

Telephone: 631-854-2521 Last EDR Contact: 11/04/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: No Update Planned

Storage Tank Database

A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 07/08/2013 Date Data Arrived at EDR: 09/10/2013 Date Made Active in Reports: 11/25/2013

Number of Days to Update: 76

Source: Suffolk County Department of Health Services

Telephone: 631-854-2521 Last EDR Contact: 11/04/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: No Update Planned

WESTCHESTER COUNTY:

Listing of Storage Tanks

A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 09/11/2013 Date Data Arrived at EDR: 09/12/2013 Date Made Active in Reports: 11/13/2013

Number of Days to Update: 62

Source: Westchester County Department of Health

Telephone: 914-813-5161 Last EDR Contact: 11/04/2013

Next Scheduled EDR Contact: 02/17/2014 Data Release Frequency: Varies

Listing of Storage Tanks

A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 09/11/2013 Date Data Arrived at EDR: 09/12/2013 Date Made Active in Reports: 11/13/2013

Number of Days to Update: 62

Source: Westchester County Department of Health

Telephone: 914-813-5161 Last EDR Contact: 11/04/2013

Next Scheduled EDR Contact: 02/17/2014

Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 07/30/2013 Date Data Arrived at EDR: 08/19/2013 Date Made Active in Reports: 10/03/2013

Number of Days to Update: 45

Source: Department of Energy & Environmental Protection

Telephone: 860-424-3375 Last EDR Contact: 11/22/2013

Next Scheduled EDR Contact: 03/03/2014 Data Release Frequency: Annually

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2011 Date Data Arrived at EDR: 07/19/2012 Date Made Active in Reports: 08/28/2012

Number of Days to Update: 40

Source: Department of Environmental Protection

Telephone: N/A

Last EDR Contact: 10/18/2013

Next Scheduled EDR Contact: 01/27/2014 Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2012 Date Data Arrived at EDR: 07/24/2013 Date Made Active in Reports: 08/19/2013

Number of Days to Update: 26

Source: Department of Environmental Protection

Telephone: 717-783-8990 Last EDR Contact: 10/21/2013

Next Scheduled EDR Contact: 02/03/2014 Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2012 Date Data Arrived at EDR: 06/21/2013 Date Made Active in Reports: 08/05/2013

Number of Days to Update: 45

Source: Department of Environmental Management

Telephone: 401-222-2797 Last EDR Contact: 11/25/2013

Next Scheduled EDR Contact: 03/10/2014 Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data Hazardous waste manifest information.

Date of Government Version: 11/12/2013 Date Data Arrived at EDR: 11/20/2013 Date Made Active in Reports: 12/11/2013

Number of Days to Update: 21

Source: Department of Environmental Conservation

Telephone: 802-241-3443 Last EDR Contact: 10/21/2013

Next Scheduled EDR Contact: 02/03/2014 Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2012 Date Data Arrived at EDR: 08/09/2013 Date Made Active in Reports: 09/27/2013

Number of Days to Update: 49

Source: Department of Natural Resources

Telephone: N/A

Last EDR Contact: 12/11/2013

Next Scheduled EDR Contact: 03/31/2014 Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data Source: Rextag Strategies Corp. Telephone: (281) 769-2247

U.S. Electric Transmission and Power Plants Systems Digital GIS Data

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services,

a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary

and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are

comparable across all states. Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers Source: Department of Health Telephone: 212-676-2444

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands Source: Department of Environmental Conservation

Telephone: 518-402-8961

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

HUBBARD POWER & LIGHT 1600 5TH AVENUE BAY SHORE, NY 11706

TARGET PROPERTY COORDINATES

Latitude (North): 40.7557 - 40° 45' 20.52" Longitude (West): 73.263 - 73° 15' 46.80"

Universal Tranverse Mercator: Zone 18 UTM X (Meters): 646629.7 UTM Y (Meters): 4512878.0

Elevation: 68 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map: 40073-G3 GREENLAWN, NY

Most Recent Revision: 1979

East Map: 40073-G2 CENTRAL ISLIP, NY

Most Recent Revision: 1979

Southeast Map: 40073-F2 BAY SHORE EAST, NY

Most Recent Revision: 1979

South Map: 40073-F3 BAY SHORE WEST, NY

Most Recent Revision: 1979

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principal investigative components:

- 1. Groundwater flow direction, and
- 2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General SSW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

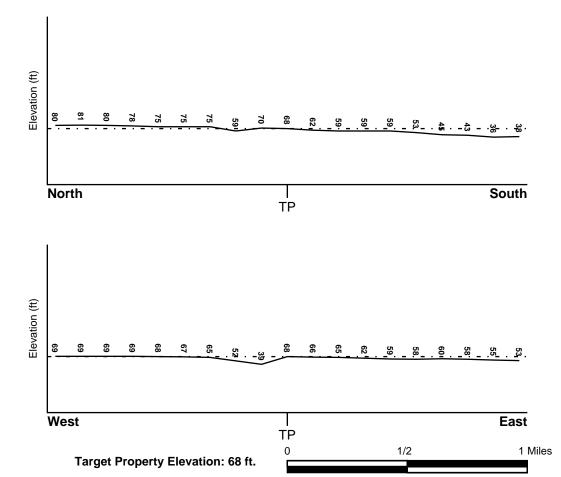

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

FEMA Flood

Target Property County SUFFOLK, NY

Electronic Data
YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property:

36103C - FEMA DFIRM Flood data

Additional Panels in search area:

Not Reported

NATIONAL WETLAND INVENTORY

NWI Electronic

NWI Quad at Target Property

Data Coverage

GREENLAWN

YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius: 1.25 miles Status: Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

 MAP ID
 FROM TP
 GROUNDWATER FLOW

 Not Reported
 GROUNDWATER FLOW

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

GEOLOGIC AGE IDENTIFICATION


Era: Cenozoic Category: Stratifed Sequence

System: Quaternary Series: Pleistocene

Code: Qp (decoded above as Era, System & Series)

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 3812742.2s

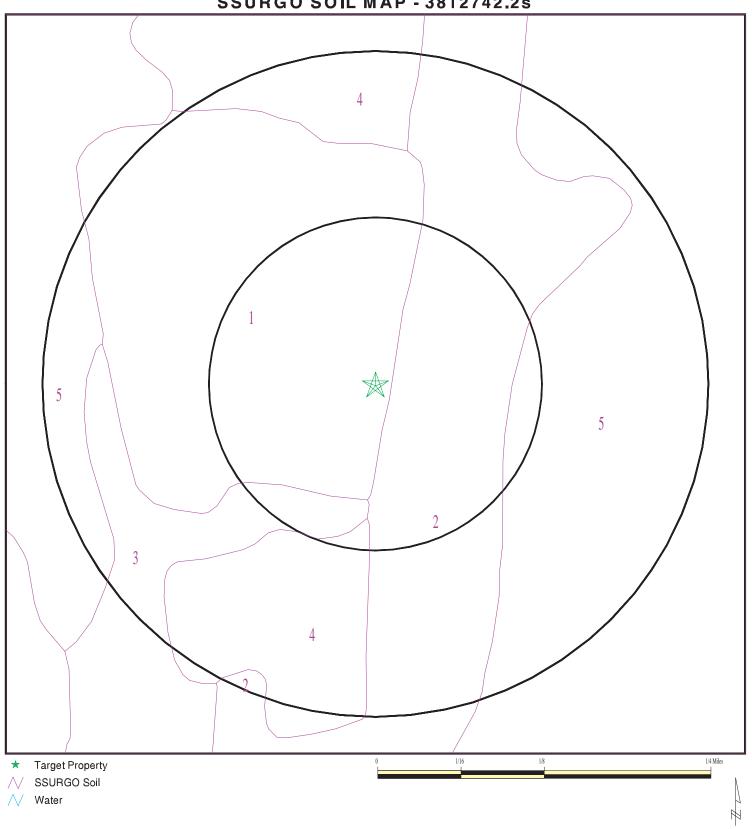

SITE NAME: Hubbard Power & Light ADDRESS: 1600 5th Avenue

1600 5th Avenue Bay Shore NY 11706 40.7557 / 73.263 LAT/LONG:

CLIENT: Nobis Engineering, Inc. CONTACT: Adam Roy INQUIRY #: 3812742.2s

December 17, 2013 12:14 pm DATE:

Copyright © 2013 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Gravel pits

Soil Surface Texture:

Hydrologic Group: Not reported

Soil Drainage Class: Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

No Layer Information available.

Soil Map ID: 2

Soil Component Name: Plymouth

Soil Surface Texture: loamy sand

Hydrologic Group: Class A - High infiltration rates. Soils are deep, well drained to

excessively drained sands and gravels.

Soil Drainage Class: Excessively drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Boundary			Classification		Saturated hydraulic		
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity S	Soil Reaction (pH)
1	0 inches	3 inches	loamy sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 5.5 Min: 3.6
2	3 inches	27 inches	loamy sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 5.5 Min: 3.6
3	27 inches	59 inches	gravelly coarse sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Well-graded sand.	Max: 141 Min: 141	Max: 5.5 Min: 3.6

Soil Map ID: 3

Soil Component Name: Riverhead
Soil Surface Texture: sandy loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep,

moderately well and well drained soils with moderately coarse

textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
	Boundary			Classification		Saturated hydraulic	
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity S	Soil Reaction (pH)
1	0 inches	11 inches	sandy loam	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 14	Max: 5.5 Min: 4.5
2	11 inches	27 inches	sandy loam	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 14	Max: 5.5 Min: 4.5
3	27 inches	35 inches	gravelly loamy sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 14	Max: 5.5 Min: 4.5
4	35 inches	64 inches	stratified coarse sand to gravelly sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Well-graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 141	Max: 5.5 Min: 4.5

Soil Map ID: 4

Soil Component Name: Urban land
Soil Surface Texture: sandy loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep,

moderately well and well drained soils with moderately coarse

textures.

Soil Drainage Class: Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

No Layer Information available.

Soil Map ID: 5

Soil Component Name: Haven

Soil Surface Texture: highly decomposed plant material

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep,

moderately well and well drained soils with moderately coarse

textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Boundary			Classification		ation Saturated hydraulic		
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity	Soil Reaction (pH)
1	0 inches	1 inches	highly decomposed plant material	A-8	Highly organic soils, Peat.	Max: 42 Min: 1.4	Max: 5.5 Min: 4.5
2	5 inches	18 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5
3	1 inches	5 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5
4	18 inches	27 inches	gravelly loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5
5	27 inches	59 inches	stratified gravelly sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Well-graded sand.	Max: 141 Min: 141	Max: 6 Min: 4.5

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE SEARCH DISTANCE (miles)

Federal USGS 1.000

Federal FRDS PWS Nearest PWS within 1 mile

State Database 1.000

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP	
1	USGS40000831707	1/4 - 1/2 Mile WNW	
2	USGS40000831500	1/4 - 1/2 Mile ESE	
A3	USGS40000831399	1/2 - 1 Mile SSE	
A4	USGS40000831400	1/2 - 1 Mile SSE	
5	USGS40000831322	1/2 - 1 Mile SSE	
B12	USGS40000831773	1/2 - 1 Mile ENE	
C13	USGS40000831303	1/2 - 1 Mile SSE	
B14	USGS40000831774	1/2 - 1 Mile ENE	
C16	USGS40000831302	1/2 - 1 Mile SSE	
B17	USGS40000831772	1/2 - 1 Mile ENE	
D18	USGS40000831815	1/2 - 1 Mile ENE	
E19	USGS40000831855	1/2 - 1 Mile WNW	
20	USGS40000831235	1/2 - 1 Mile SSE	
E21	USGS40000831886	1/2 - 1 Mile WNW	
E22	USGS40000831887	1/2 - 1 Mile WNW	
D23	USGS40000831771	1/2 - 1 Mile ENE	
F24	USGS40000831875	1/2 - 1 Mile WNW	
F29	USGS40000832283	1/2 - 1 Mile WNW	
G30	USGS40000831220	1/2 - 1 Mile SSE	
G31	USGS40000831218	1/2 - 1 Mile SSE	
G32	USGS40000831219	1/2 - 1 Mile SSE	
G33	USGS40000831217	1/2 - 1 Mile SSE	
G34	USGS40000831216	1/2 - 1 Mile SSE	
H35	USGS40000831033	1/2 - 1 Mile South	
H36	USGS40000831034	1/2 - 1 Mile South	
H37	USGS40000831035	1/2 - 1 Mile South	
38	USGS40000831284	1/2 - 1 Mile SW	
39	USGS40000831508	1/2 - 1 Mile WSW	

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	FROM TP
B15	NY0010526	1/2 - 1 Mile East


Note: PWS System location is not always the same as well location.

GEOCHECK[®] - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
B6	NYWS006206	1/2 - 1 Mile East
B7	NYWS006207	1/2 - 1 Mile East
B8	NYWS006208	1/2 - 1 Mile East
B9	NYWS006203	1/2 - 1 Mile East
B10	NYWS006204	1/2 - 1 Mile East
B11	NYWS006205	1/2 - 1 Mile East
F25	NYWS006198	1/2 - 1 Mile WNW
F26	NYWS006199	1/2 - 1 Mile WNW
F27	NYWS006196	1/2 - 1 Mile WNW
F28	NYWS006197	1/2 - 1 Mile WNW

PHYSICAL SETTING SOURCE MAP - 3812742.2s

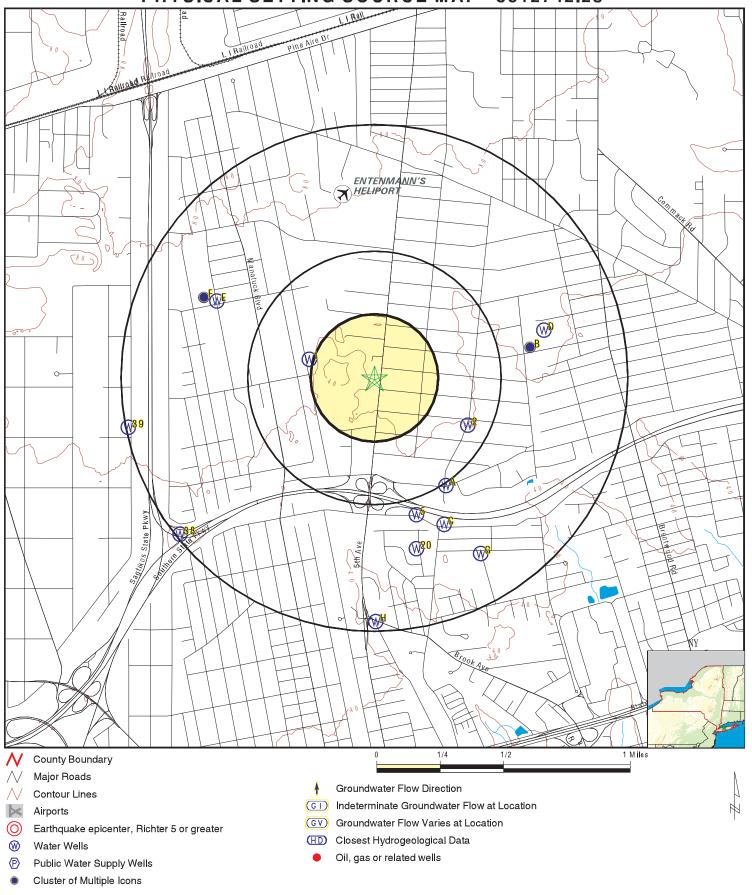

SITE NAME: Hubbard Power & Light ADDRESS: 1600 5th Avenue

Bay Shore NY 11706 LAT/LONG: 40.7557 / 73.263 CLIENT: Nobis Engineering, Inc.

CONTACT: Adam Roy

INQUIRY #: 3812742.2s

DATE: December 17, 2013 12:14 pm

Map ID Direction Distance

Elevation Database EDR ID Number

WNW

FED USGS USGS40000831707

1/4 - 1/2 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404524073160601

Monloc name: S 30193. 1 Monloc type: Well

Monloc desc: Not Reported Huc code: 02030202

02030202 Drainagearea value: Not Reported Huc code: Contrib drainagearea: Not Reported Drainagearea Units: Not Reported 40.756765 Contrib drainagearea units: Not Reported Latitude: Longitude: -73.267895 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 65.0 Vert measure units: 65.0 Vert measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 80

Welldepth units: ft Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 0

2 ESE FED USGS USGS40000831500

1/4 - 1/2 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404509073152301

Monloc name: S 3516. 1 Monloc type: Well

Monloc desc: LAT/LONG UPDATES FROM SIM 3066

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported 40.753 Latitude: Longitude: -73.2559722 24000 Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from Digital Map

Horiz coord refsys: NAD83 Vert measure val: 60.0 Vert measure units: feet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: 1907 Welldepth: 37

Welldepth units: ft Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 427

Ground-wate	East balow		irements. 427		Feet below	Foot to
Date	Feet below Surface	Feet to Sealevel		Date	Surface	Feet to Sealevel
2004-03-16		38.71		2003-03-27		36.11
2002-03-29		34.87		2001-03-19		37.09
2000-03-31		36.44		1999-03-30		38.22
1998-03-18		38.24		1997-03-17		38.76
1996-03-18		36.23		1995-03-16		35.65
1994-03-30		38.17		1993-03-23		38.73
1992-03-17		37.52		1991-03-21		41.59
1990-03-28		40.22		1989-01-13		35.07
1988-03-10		35.66		1987-03-06		36.77
1985-09-19		35.77		1985-06-27		36.99
1985-04-08		37.29		1984-12-11		38.47
1984-10-02		39.69		1984-06-12		41.22
1984-03-21		39.13		1983-12-28		37.92
1983-09-16		37.07		1983-06-14		36.77
1983-03-16		35.64		1982-12-28		35.12
1982-09-30		36.43		1982-06-14		38.25
1982-03-16		37.17		1981-12-14		33.14
1981-09-15		34.77		1981-06-16		35.35
1981-03-15		35.39		1981-01-05		36.60
1980-09-26		36.45		1980-06-30		36.77
1980-03-24		36.88		1980-02-15		36.76
1980-01-02		37.02		1979-09-21		39.85
1979-06-26		40.31		1979-06-25		40.34
1979-04-20		41.07		1979-03-29		40.63
1979-03-22		41.28		1979-01-25		40.17
1978-12-28		37.98		1978-12-22		37.84
1978-11-22		37.60		1978-10-25		38.10
1978-10-02		38.16		1978-09-27		38.50
1978-08-21		39.12		1978-07-26		39.78
1978-06-28		39.98		1978-06-19		40.00
1978-06-06		40.57		1978-04-17		40.08
1978-04-12		39.85		1978-03-23		39.60
1977-12-27		37.67		1977-09-27		34.87
1977-06-22		36.11		1977-04-05		36.27
1976-12-21		35.77		1976-09-21		36.48
1976-06-21		37.40		1975-12-31		37.07
1975-10-30		36.81		1975-09-29		37.66
1975-06-24		38.45		1975-03-21		38.12
1974-12-19		35.69		1974-09-20		35.85
1974-08-16		37.34		1974-04-15		40.77
1973-07-03		39.87		1973-04-06		39.88
1973-01-23		37.95		1972-11-13		36.21
1972-08-09		37.56		1970-09-28		34.59
1970-08-25		35.07		1970-07-29		35.55
1970-06-28		36.16		1970-06-01		36.48
1970-04-28		36.82		1970-03-25		35.53
1970-02-25		35.59		1970-01-26		35.08
1970-01-06		34.73		1969-11-26		33.65
1969-10-27		33.76		1969-09-29		33.84
1969-10-27		34.08		1969-09-29		34.45
1000 00 20		07.00		1000 01 29		UT.TU

Ground-wate	er levels, conti	nued. Feet to		Feet below	Feet to
Date	Surface	Sealevel	Date	Surface	Sealevel
1969-06-24		34.39	1969-05-27	,	34.92
1969-04-29		34.73	1969-03-26	;	34.10
1969-02-25		33.98	1969-01-27	•	34.23
1968-12-24		34.17	1968-11-25		33.53
1968-10-23		33.48	1968-10-03		33.77
1968-08-26		34.25	1968-07-26		34.58
1968-06-24		34.97	1968-05-23		34.89
1968-05-01		35.31	1968-03-25		35.18
1968-02-26		34.69	1968-01-25		34.85
1967-12-26		34.38	1967-11-27		34.47
1967-10-24		34.95	1967-10-03		35.24
1967-08-29		35.48	1967-07-24		35.51
1967-06-26		34.93	1967-05-24		34.47
1967-04-28		33.91	1967-03-30		33.24
1967-02-27		31.81	1967-01-25		31.74
1966-12-28		31.74	1966-11-29		31.90
1966-10-26		32.06	1966-09-27		32.19
1966-08-26		32.01	1966-07-26		32.34
1966-06-29		32.94	1966-06-08		33.07
1966-04-26		32.58	1966-03-28		32.86
1966-02-25		32.65	1966-01-26		32.32
1965-12-27		32.56	1965-11-29		32.75
1965-10-29		33.06	1965-09-30		33.35
1965-08-31		33.67	1965-07-27		34.06
1965-06-25		34.77	1965-05-26		35.25
1965-04-28		35.50	1965-03-20		35.47
1965-02-26		35.47	1965-01-27		34.48
1964-12-30		34.37	1964-11-24		34.18
1964-10-29		34.42	1964-09-29		34.66
1964-09-01		35.22	1964-07-28		35.93
1964-07-01		36.35	1964-05-26		37.15
1964-04-27		37.23	1964-03-27		36.28
1964-02-26		35.99	1964-01-29		35.32
1963-12-26		34.90	1963-12-02		34.95
1963-10-29		34.93	1963-09-26		35.21
1963-09-03		35.47	1963-07-30		35.95
1963-07-01		36.48	1963-05-27		36.87
1963-04-25		37.32	1963-03-26		37.61
1963-02-25		36.93	1963-01-28		36.31
1962-12-26		36.52	1962-12-03		36.54
1962-10-28		36.30	1962-10-01		36.35
1962-08-31		36.66	1962-07-27		37.26
1962-07-02		37.82	1962-05-28		38.59
1962-05-02		39.14	1962-04-02		39.47
1962-03-01		38.49	1962-02-05		38.21
1961-12-29		37.15	1961-12-04		37.21
1961-10-30		37.74	1961-10-06		38.06
1961-09-12		38.38	1961-07-27		39.06
1961-07-03		38.97	1961-06-05		39.34
1961-04-28		39.10	1961-03-29		38.94
1961-02-27		37.51	1961-01-31		37.37
1961-01-03		37.15	1960-12-06		36.92
1960-11-07		37.11	1960-10-03		37.46
1960-08-30		36.77	1960-07-28		37.05
1960-06-28		37.40	1960-06-07		37.75

	Ground-wate	er levels, conti	nued. Feet to		Feet below	Feet to
1960-03-01 37.33 1960-02-02 36.87 1960-01-06 36.58 1959-11-25 36.13 1959-10-23 36.45 1959-10-06 36.72 1959-08-28 37.31 1959-06-24 37.67 1959-03-30 37.64 1958-12-31 36.87 1958-12-02 37.00 1958-10-29 37.26 1958-09-29 37.56 1958-08-27 38.72 1958-07-28 38.94 1956-12-17 37.47 1956-09-28 38.42 1956-06-22 40.39 1956-05-29 40.63 1956-06-22 40.39 1956-05-29 40.64 1956-02-27 40.08 1956-01-25 39.96 1955-12-27 40.08 1956-01-26 39.96 1955-12-27 40.08 1956-01-26 39.96 1955-12-27 30.01 1955-01-26 37.66 1955-08-26 38.23 1955-07-26 37.66 1955-08-26 38.23 1955-07-26 37.66 1955-08-27 33.20 1955-01-26 38.99 1954-12-22 33.25 1954-01-29 38.66 1955-04-27 39.01 1955-01-26 38.99 1954-12-22 33.25 1954-09-27 38.66 1955-02-3 38.60 1955-01-26 38.99 1954-10-20 37.65 1954-01-28 38.99 1954-09-02 37.65 1954-07-28 38.09 1954-09-02 37.65 1954-07-28 38.09 1954-09-02 37.65 1954-07-28 38.99 1954-09-03 38.65 1955-01-26 37.75 1954-10-28 37.97 1953-10-30 37.82 1953-10-5 33.31 1954-03-26 37.75 1953-11-7 37.47 1953-03-24 36.6 1955-02-3 36.50 1955-03-25 39.14 1953-08-30 39.57 1953-10-30 37.82 1953-10-5 33.31 1954-03-26 37.75 1953-11-7 37.47 1953-08-27 38.02 1953-02-3 38.09 1954-05-28 38.99 1954-05-28 33.31 1954-03-29 38.44 1953-08-31 39.90 1955-03-24 36.76 1955-09-27 37.47 1953-10-30 37.82 1953-10-5 33.31 1953-03-24 36.76 1955-08-26 37.76 1953-02-24 36.76 1955-08-26 37.78 1953-02-24 36.76 1955-08-26 37.78 1953-02-25 38.66 1950-02-21 36.26 1955-02-27 38.68 1950-02-21 36.26 1955-02-28 37.75 1953-11-27 37.47 1953-08-29 39.14 1953-08-33 1952-04-29 38.84 1950-02-20 39.35 1951-06-28 37.75 1951-07-25 39.34 1951-08-28 36.75 1951-07-25 39.34 1951-08-28 36.75 1951-07-25 36.24 195	Date			Date		Sealevel
1980-01-06 1959-10-23 1969-08-28 1973-11 1959-08-28 1973-11 1959-08-28 1973-11 1959-08-28 1973-11 1959-08-28 1973-11 1959-08-24 1976-72 1959-03-30 1976-4 1958-10-29 1976-62 1978-08-29 1976-62 1978-08-29 1978-10-29 1978-1	1960-05-03		38.21	1960-04-01		37.76
1959-10-23 36.45 1959-10-06 36.72 1959-08-28 37.31 1959-06-24 37.67 1959-03-30 37.64 1958-12-31 36.87 1958-12-02 37.00 1958-10-29 37.26 1958-09-29 37.56 1958-08-27 38.72 1958-09-28 38.94 1956-12-17 37.47 1956-09-28 38.94 1956-12-17 37.47 1956-09-28 38.42 1956-08-22 40.39 1956-05-29 40.63 1956-04-25 41.16 1956-03-27 40.64 1956-02-27 40.08 1956-01-25 39.96 1955-12-27 40.67 1955-11-25 41.25 1955-11-01 40.37 1955-10-60 38.04 1955-08-26 38.23 1955-07-26 37.66 1955-08-27 39.01 1955-03-24 38.66 1955-08-27 39.01 1955-03-24 38.66 1955-02-23 38.60 1955-01-26 38.99 1954-12-22 38.25 1954-01-2 37.95 1954-10-27 38.25 1954-09-27 38.66 1954-09-02 37.65 1954-01-28 38.99 1954-10-27 38.25 1954-03-26 37.75 1954-01-28 38.32 1954-03-26 37.75 1954-01-28 38.32 1955-03-26 37.65 1955-01-26 38.99 1954-04-28 38.32 1955-03-26 37.75 1954-01-28 38.91 1953-03-26 37.75 1954-01-28 38.92 1953-12-18 37.57 1953-11-27 37.47 1953-10-30 37.82 1953-10-05 38.31 1953-03-27 38.02 1953-00-28 38.31 1953-03-27 38.02 1953-00-28 38.31 1953-03-27 38.02 1953-00-3 37.85 1953-04-20 38.84 1952-03-25 38.51 1953-04-21 38.84 1952-03-25 38.35 1953-04-22 38.84 1952-03-25 38.36 1953-04-24 38.84 1952-03-25 38.75 1953-04-24 38.84 1952-03-25 38.75 1953-04-24 38.84 1952-03-25 38.75 1953-04-24 38.84 1952-03-25 38.75 1953-04-24 38.84 1952-03-25 38.57 1953-04-24 38.84 1952-03-25 38.57 1953-04-24 38.84 1952-03-25 38.57 1953-04-24 38.84 1950-03-28 36.61 1951-04-24 38.28 1951-07-25 37.34 1951-04-24 38.28 1951-07-25 37.34 1951-04-24 38.28 1951-07-25 37.34 1951-04-24 38.28 1951-07-25 37.34 1951-04-24 38.28 1951-07-25 37.34 1951-04-25 36.64 1950-03-28 36.61 1950-04-25 36.94 1940-03-29 38.84 1950-02-2	1960-03-01		37.33	1960-02-02		36.87
1959-08-28 37.31 1959-06-24 37.67 1958-10-29 37.66 1958-10-29 37.26 1958-09-29 37.56 1958-09-29 37.56 1958-09-29 37.56 1958-09-29 37.56 1958-09-27 38.72 1958-07-28 38.94 1956-12-17 37.47 1956-09-28 38.42 1956-06-22 40.39 1956-05-29 40.63 1956-04-25 41.16 1956-03-27 40.64 1956-02-27 40.67 1956-01-25 39.96 1955-12-27 40.67 1955-01-25 39.96 1955-12-27 40.67 1955-01-26 39.96 1955-12-27 40.67 1955-01-26 39.96 1955-04-27 38.20 1955-04-27 38.68 1955-04-27 38.20 1955-05-27 38.68 1955-04-27 39.01 1955-03-24 38.56 1955-04-27 39.01 1955-03-24 38.56 1955-04-27 38.25 1954-10-27 38.25 1954-10-27 38.25 1954-10-27 38.25 1954-10-27 38.26 1954-09-20 37.65 1955-09-20 37.65 1955-09	1960-01-06		36.58	1959-11-25		36.13
1959-08-28 37.31 1959-06-24 37.67 1958-10-29 37.66 1958-10-29 37.26 1958-09-29 37.56 1958-09-29 37.56 1958-09-29 37.56 1958-09-29 37.56 1958-09-27 38.72 1958-07-28 38.94 1956-12-17 37.47 1956-09-28 38.42 1956-06-22 40.39 1956-05-29 40.63 1956-04-25 41.16 1956-03-27 40.64 1956-02-27 40.67 1956-01-25 39.96 1955-12-27 40.67 1955-01-25 39.96 1955-12-27 40.67 1955-01-26 39.96 1955-12-27 40.67 1955-01-26 39.96 1955-04-27 38.20 1955-04-27 38.68 1955-04-27 38.20 1955-05-27 38.68 1955-04-27 39.01 1955-03-24 38.56 1955-04-27 39.01 1955-03-24 38.56 1955-04-27 38.25 1954-10-27 38.25 1954-10-27 38.25 1954-10-27 38.25 1954-10-27 38.26 1954-09-20 37.65 1955-09-20 37.65 1955-09				1959-10-06		
959-03-30 37,64 1958-12-31 36,87 1958-10-29 37,26 1958-10-29 37,26 1958-09-29 37,56 1958-08-27 38,72 1958-09-28 38,94 1956-12-17 37,47 1956-09-28 38,42 1956-04-25 41,16 1956-05-29 40,63 1956-04-25 41,16 1956-03-27 40,64 1956-02-27 40,08 1956-01-25 39,96 1955-12-27 40,67 1955-11-25 41,25 1955-11-01 40,37 1955-10-27 38,04 1955-08-27 38,04 1955-08-27 38,25 1955-11-01 40,37 1955-00-27 38,04 1955-08-27 38,20 1955-00-27 38,68 1955-06-27 38,20 1955-01-26 38,99 1954-10-27 38,25 1954-10-27 38,25 1954-10-27 38,25 1954-09-27 38,66 1955-08-28 38,99 1954-10-27 38,25 1954-09-27 38,68 1954-09-02 37,65 1954-09-02 37,65 1954-09-02 37,65 1954-09-28 38,99 1954-09-02 37,65 1954-09-02 37,67 1955-09-03 39,57 1953-09-03 39,57 1953-09-03 39,57 1953-09-03 39,57 1953-09-03 39,57 1953-09-03 39,57 1953-09-04 39,57 1953-09-04 39,57 1953-09-04 39,57 1955-09-24 39,57 1955-09-24 39,57 1955-09-24 39,57 1955-09-24 39,57 1955-09-25 38,56 1955-09-26 36,58 1955-09-26 36,58 1955-09-26 36,58 1955-09-26 36,59 1955-09-26 36,59 1955-09-26 36,59 1955-09-26 36,59 1955-09-26 36,59 1955-09-26 36,59 1955-09-27 36,69 1955-09-27 36,69 1955-09-				1959-06-24		
1988-12-02 37.00 1988-10-29 37.26 1958-09-29 37.56 1958-08-27 38.72 1986-09-28 38.94 1956-12-17 37.47 1956-09-28 38.42 1956-06-22 40.39 1956-03-27 40.64 1956-02-27 40.08 1956-11-25 39.96 1955-12-27 40.67 1955-11-25 41.25 1955-11-01 40.37 1955-10-07 38.04 1955-02-6 38.23 1955-09-26 37.66 1955-02-6 38.20 1955-09-27 38.68 1955-02-23 38.60 1955-09-27 38.68 1955-02-23 38.60 1955-09-27 38.68 1955-02-23 38.60 1955-09-27 38.66 1955-02-23 38.60 1955-09-27 38.66 1955-02-23 38.60 1955-09-27 38.66 1955-02-23 38.60 1955-09-27 38.66 1954-02-3 38.61 1954-07-28 38.09 1954-02-3 38.51 1954-07-28 38.09 1954-06-30 38.65						
988-09-29						
1958-07-28 38.94 1956-12-17 37.47 1956-09-28 38.42 1956-06-22 40.39 1956-05-29 40.63 1956-06-25 41.16 1956-03-27 40.64 1956-02-27 40.08 1956-01-25 39.96 1955-12-27 40.67 1955-11-25 41.25 1955-11-01 40.37 1955-10-07 38.04 1955-08-26 38.23 1955-07-26 37.66 1955-08-26 38.20 1955-05-27 38.68 1955-02-23 38.60 1955-03-24 38.56 1955-02-23 38.60 1955-03-24 38.56 1955-02-23 38.60 1955-01-26 38.99 1954-10-27 38.25 1954-11-22 37.95 1954-10-27 38.25 1954-07-28 38.09 1954-06-30 38.65 1954-07-28 38.99 1954-08-30 38.65 1954-07-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 38.99 1954-08-30 38.65 1954-05-28 37.75 1953-11-27 37.47 1953-10-30 37.82 1953-08-30 39.57 1953-08-24 40.47 1953-08-26 41.01 1953-08-25 39.14 1953-08-30 39.57 1953-08-26 37.75 1953-08-30 39.90 1953-08-27 38.02 1953-08-30 39.57 1953-08-28 36.56 1952-08-29 39.34 1952-08-27 38.68 1952-08-20 39.35 1952-08-27 38.68 1952-08-20 39.35 1952-08-27 38.68 1952-08-20 39.35 1952-08-27 38.68 1952-08-20 39.35 1952-08-27 38.68 1952-08-20 39.35 1952-08-28 36.75 1951-08-22 39.34 1952-08-29 39.54 1950-08-26 39.35 1951-08-28 36.75 1951-08-29 37.87 1951-08-28 36.75 1951-08-29 37.87 1951-08-28 36.75 1951-08-29 39.84 1950-08-26 37.09 1950-08						
986-09-28 38.42 1986-06-22 40.39 1986-05-29 40.63 1986-04-25 41.16 1986-03-27 40.64 1986-02-27 40.08 1986-01-25 39.96 1985-12-27 40.67 1985-11-25 41.25 39.96 1985-12-27 40.67 1985-11-01 40.37 1985-10-07 38.04 1985-08-26 38.23 1985-07-26 37.66 1985-06-27 38.20 1985-05-07 38.68 1985-06-27 38.68 1985-06-27 38.68 1985-03-24 38.56 1985-02-23 38.60 1985-02-23 38.60 1985-03-24 38.56 1985-02-23 38.60 1985-03-24 38.56 1985-03-24 38.56 1985-03-24 38.25 1984-10-27 38.25 1984-10-27 38.25 1984-09-27 38.66 1984-09-02 37.65 1984-09-02 37.65 1984-09-02 37.65 1984-09-02 37.65 1984-09-02 37.65 1984-09-03 38.65 1984-03-26 37.75 1984-01-28 37.97 1983-10-30 37.82 38.31 1983-03-26 37.47 1983-10-30 37.82 1983-10-05 38.31 1983-03-33 39.90 1983-06-24 40.47 1983-06-26 41.01 1983-06-26 41.01 1983-06-26 41.01 1983-06-26 41.01 1983-06-26 41.01 1983-06-27 38.68 1982-12-03 36.89 1982-12-03 36.89 1982-07-22 39.34 1982-09-24 38.17 1982-09-24 38.17 1982-09-24 38.17 1982-09-24 38.17 1982-09-24 38.17 1982-09-24 38.17 1982-09-24 38.17 1982-09-24 38.17 1982-09-24 38.17 1982-09-24 38.75 1982-09-24 38.17 1982-09-24 38.75 1982-09-25 39.36 1982-09-26 39.36 1982-09-26						
1956-05-29						
1956-03-27 40.64 1956-02-27 40.08 1956-01-25 39.96 1955-12-27 40.67 1955-11-25 41.25 1955-11-01 40.37 1955-10-07 38.04 1955-08-26 38.23 1955-07-26 37.66 1955-06-27 38.01 1955-03-24 38.56 1955-04-27 39.01 1955-01-26 38.99 1954-12-22 38.25 1954-11-22 37.95 1954-10-27 38.25 1954-09-27 38.66 1954-09-02 37.65 1954-09-27 38.66 1954-09-02 37.65 1954-09-27 38.09 1954-00-02 37.65 1954-09-27 38.06 1954-09-02 37.65 1954-09-28 38.99 1954-04-28 38.32 1954-05-28 38.99 1954-04-28 38.32 1954-05-28 39.99 1954-04-28 37.97 1953-10-30 37.82 1953-10-05 38.31 1953-08-25 39.14 1953-08-26 41.01 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1956-01-25 39.96 1955-12-27 40.67 1955-11-26 41.25 1955-11-101 40.37 1955-10-07 38.04 1955-08-26 38.23 1955-07-26 37.66 1955-08-27 38.20 1955-05-27 38.68 1955-04-27 39.01 1955-03-24 38.56 1955-04-27 39.01 1955-03-24 38.56 1955-04-27 38.60 1955-01-28 38.99 1954-12-22 38.25 1954-11-22 37.95 1954-10-27 38.66 1954-09-02 37.65 1954-09-02 37.65 1954-07-28 38.09 1954-06-30 38.65 1954-07-28 38.09 1954-06-30 38.65 1954-07-28 38.99 1954-01-28 37.97 1953-12-18 37.57 1953-11-27 37.47 1953-12-18 37.57 1953-11-27 37.47 1953-12-18 37.57 1953-11-27 37.47 1953-08-03 39.57 1953-06-24 40.47 1953-08-03 39.57 1953-06-24 40.47 1953-08-03 39.57 1953-04-20 37.48 1952-07-22 39.34 1952-01-04 37.37 1952-09-24 38.17 1952-09-24 38.17 1952-09-24 38.17 1952-09-24 38.17 1952-09-24 38.17 1952-09-24 38.75 1952-01-24 37.37 1952-09-24 38.75 1952-01-24 37.37 1952-09-24 38.75 1952-01-24 37.45 1952-01-24 37.45 1952-01-24 37.45 1952-01-24 37.45 1952-01-24 37.45 1952-01-24 37.45 1952-01-24 37.45 1952-01-24 37.45 1952-01-24 37.45 1952-01-24 37.45 1952-01-24 37.45 1951-01-22 38.68 1952-01-24 37.45 1951-01-22 38.59 1951-03-27 37.46 1951-03-28 36.61 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-27 37.46 1951-03-28 36.61 1951-03-27 37.46 1951-03-28 36.61 1951-03-28 36.61 1951-03-28 36.61 1951-03-28 36.61 1951-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-03-28 36.61 1950-0						
1955-11-25 41.25 1955-11-01 40.37 1955-10-07 38.04 1955-08-26 38.23 1955-05-27 38.68 1955-06-27 39.01 1955-03-24 38.56 1955-04-27 39.01 1955-01-26 38.99 1954-12-22 38.25 1954-09-27 38.66 1954-09-02 37.65 1954-09-27 38.66 1954-09-02 37.65 1954-09-27 38.66 1954-09-02 37.65 1954-09-28 38.09 1954-06-30 38.65 1954-09-28 38.09 1954-06-30 38.65 1954-09-28 38.99 1954-01-28 37.97 1953-11-27 37.47 1953-11-27 37.47 1953-05-26 37.75 1953-11-27 37.47 1953-05-30 37.82 1953-10-05 38.31 1953-06-24 40.47 1953-08-26 41.01 1953-04-30 41.38 1953-03-31 39.90 1952-12-24 36.78 1952-02-26 37.34 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1955-10-07 38.04 1955-08-26 38.23 1955-07-26 37.66 1955-06-27 39.01 1955-03-24 38.56 1955-02-23 38.60 1955-01-26 38.99 1954-12-22 38.25 1954-11-22 37.95 1954-10-27 38.25 1954-09-27 38.66 1954-09-02 37.65 1954-07-28 38.09 1954-06-30 38.65 1954-07-28 38.09 1954-06-30 38.65 1954-07-28 38.99 1954-04-28 38.32 1954-03-26 37.75 1953-11-28 37.97 1953-12-18 37.57 1953-11-27 37.47 1953-08-25 39.14 1953-08-23 39.57 1953-08-25 39.14 1953-08-23 39.57 1953-06-24 40.47 1953-05-26 41.01 1953-02-27 38.02 1953-02-23 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-02-25 38.96 1952-07-22 39.34 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1955-07-26 37.66 1955-06-27 38.20 1955-05-27 38.68 1955-04-27 39.01 1955-01-26 38.99 1954-12-22 38.25 1954-10-27 38.25 1954-10-27 38.25 1954-02-27 38.66 1954-00-20 37.65 1954-07-28 38.09 1954-06-30 38.65 1954-05-28 38.99 1954-06-30 38.65 1954-05-28 38.99 1954-04-28 38.32 1954-05-28 38.99 1954-04-28 38.32 1954-05-28 38.99 1954-01-28 37.97 1953-10-30 37.82 1953-10-10-8 37.97 1953-08-25 39.14 1953-08-03 39.57 1953-08-25 39.14 1953-08-26 41.01 1953-04-30 41.38 1953-03-31 39.90 1953-04-27 38.02 1952-01-24 36.89 1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34<						
1955-05-27 38.68 1955-04-27 39.01 1955-03-24 38.56 1955-02-23 38.60 1955-01-26 38.99 1954-12-22 38.25 1954-11-22 37.95 1954-00-27 38.25 1954-09-27 38.66 1954-09-02 37.65 1954-07-28 38.09 1954-06-30 38.65 1954-05-28 38.99 1954-04-28 38.32 1954-03-26 37.75 1954-01-28 37.97 1953-12-18 37.57 1953-11-27 37.47 1953-08-25 39.14 1953-08-03 39.57 1953-08-25 39.14 1953-08-03 39.57 1953-08-24 40.47 1953-05-26 41.01 1953-02-27 38.02 1953-02-20 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-02-27 38.02 1953-02-03 37.48 1952-08-27 38.68 1952-07-22 39.34 1952-08-23 39.92 1952-05-26 39.35 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1955-03-24 38.56 1955-02-23 38.60 1955-01-26 38.99 1954-12-22 38.25 1954-11-22 37.95 1954-10-27 38.25 1954-09-27 38.66 1954-09-02 37.65 1954-07-28 38.09 1954-06-30 38.65 1954-05-28 38.99 1954-04-28 38.32 1954-03-26 37.75 1954-01-28 37.97 1953-12-18 37.57 1953-10-05 38.31 1953-00-30 37.82 1953-10-05 38.31 1953-06-25 39.14 1953-08-03 39.57 1953-06-24 40.47 1953-05-26 41.01 1953-04-30 41.38 1953-02-03 37.48 1952-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-02-20 37.49 1952-06-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-03-25 38.75 1952-02-25 38.36 1952-01-24 37.45 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1955-01-26 38.99 1954-12-22 38.25 1954-10-27 38.25 1954-10-27 38.25 1954-09-27 38.66 1954-09-02 37.65 1954-09-28 38.09 1954-06-30 38.65 1954-05-28 38.99 1954-04-28 38.32 1954-03-26 37.75 1954-01-28 37.97 1953-12-18 37.57 1953-11-27 37.47 1953-10-30 37.82 1953-10-05 38.31 1953-08-25 39.14 1953-08-03 39.57 1953-08-24 40.47 1953-05-26 41.01 1953-08-25 39.14 1953-08-26 41.01 1953-08-27 38.02 1953-02-23 37.48 1952-12-24 36.78 1952-12-03 37.48 1952-10-23 39.92 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-04-22 38.84 1952-03-25 38.75 1952-04-22 38.84 1952-03-25 38.75 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1954-11-22 37.95 1954-10-27 38.65 1954-09-27 38.66 1954-09-02 37.65 1954-07-28 38.09 1954-09-02 37.65 1954-05-28 38.99 1954-04-28 38.32 1954-03-26 37.75 1954-01-28 37.97 1953-11-31 37.57 1953-11-27 37.47 1953-10-30 37.82 1953-10-05 38.31 1953-08-25 39.14 1953-08-03 39.57 1953-06-24 40.47 1953-05-26 41.01 1953-02-27 38.02 1953-02-26 41.01 1953-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-04-23 39.92 1952-09-24 38.17 1952-06-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-03-25 38.75 1952-04-22 38.84 1952-03-25 38.75 1952-04-23 39.84 1952-03-25 38.75 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1954-09-27 38.66 1954-09-02 37.65 1954-07-28 38.09 1954-06-30 38.65 1954-05-28 38.99 1954-04-28 38.32 1954-05-26 37.75 1954-01-28 37.97 1953-12-18 37.57 1953-11-27 37.47 1953-10-30 37.82 1953-10-05 38.31 1953-08-25 39.14 1953-08-03 39.57 1953-06-24 40.47 1953-05-26 41.01 1953-04-30 41.38 1953-03-31 39.90 1952-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-02-03 37.88 1952-08-27 38.68 1952-07-22 39.34 1952-08-27 38.68 1952-07-22 39.34 1952-08-27 38.68 1952-07-22 39.34 1952-08-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-07-22 39.34 1952-02-25 38.36 1952-07-24 37.45 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1954-07-28 38.09 1954-06-30 38.65 1954-05-28 38.99 1954-04-28 38.32 1954-03-26 37.75 1954-01-28 37.97 1953-12-18 37.57 1953-11-27 37.47 1953-10-30 37.82 1953-10-05 38.31 1953-08-25 39.14 1953-08-03 39.57 1953-08-25 39.14 1953-08-02 39.57 1953-08-24 40.47 1953-08-02 41.01 1953-04-30 41.38 1953-03-31 39.90 1953-02-27 38.02 1953-02-03 37.48 1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-04-23 39.92 1952-05-26 39.35 1952-04-23 38.84 1952-05-26 39.35 1952-04-22 38.84 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-08-28 36.75 1951-09-25 36.22 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1954-05-28 38.99 1954-04-28 37.97 1953-12-18 37.57 1953-11-27 37.47 1953-10-30 37.82 1953-10-05 38.31 1953-08-25 39.14 1953-08-03 39.57 1953-06-24 40.47 1953-05-26 41.01 1953-04-30 41.38 1953-02-31 39.90 1953-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-10-27 38.68 1952-12-03 36.89 1952-08-27 38.68 1952-07-22 39.34 1952-08-27 38.68 1952-07-22 39.34 1952-08-27 38.68 1952-07-22 39.34 1952-08-27 38.68 1952-07-22 39.34 1952-08-27 38.68 1952-07-22 39.34 1952-08-27 38.68 1952-07-22 39.34 1952-08-23 39.92 1952-07-22 39.34 1952-08-25 38.36 1952-07-22 39.35 1951-08-28 36.16 1951-11-26 36.07						
1954-03-26 37.75 1953-10-12 37.47 1953-10-30 37.82 1953-10-05 38.31 1953-08-25 39.14 1953-08-03 39.57 1953-06-24 40.47 1953-05-26 41.01 1953-04-30 41.38 1953-05-26 41.01 1953-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-08-23 39.92 1952-07-22 39.34 1952-04-23 38.84 1952-07-22 39.34 1952-04-22 38.84 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-08-28 36.75 1951-09-25 36.22 1951-08-28 37.75 1951-07-25 37.34 1951-08-28 37.75 1951-07-25 37.87 1951-02-21 36.25 1951-07-25 37.46 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1953-12-18 37.57 1953-11-27 37.47 1953-10-30 37.82 1953-10-05 38.31 1953-08-25 39.14 1953-08-03 39.57 1953-06-24 40.47 1953-05-26 41.01 1953-04-30 41.38 1953-03-31 39.90 1953-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-08-23 39.92 1952-05-26 39.35 1952-04-23 38.84 1952-03-25 38.75 1952-02-25 38.36 1952-01-24 37.45 1951-02-28 36.16 1951-11-26 36.07 1951-03-28 36.75 1951-09-25 36.22 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1953-10-30 37.82 1953-10-05 38.31 1953-08-25 39.14 1953-08-03 39.57 1953-06-24 40.47 1953-05-26 41.01 1953-04-30 41.38 1953-03-31 39.90 1953-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-08-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-05-26 39.35 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-01-24 37.45 1951-08-28 36.75 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-02-21 36.25 1951-07-25 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-02-21 35.59 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93						
1953-08-25 39.14 1953-08-03 39.57 1953-06-24 40.47 1953-05-26 41.01 1953-04-30 41.38 1953-03-31 39.90 1953-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-06-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-05-26 39.35 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-07-25 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-02-21 35.91 1950-09-26 36.32 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1953-06-24 40.47 1953-05-26 41.01 1953-04-30 41.38 1953-03-31 39.90 1953-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-06-23 39.92 1952-05-26 39.35 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-08-28 36.75 1951-07-25 37.87 1951-02-21 36.25 1951-07-25 37.46 1951-02-23 38.28 1951-07-25 37.46 1951-02-21 36.25 1951-07-22 35.59 1950-12-21 35.29 1950-01-22 35.59 1950-08-31 36.64 1950-09-26 36.32 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
1953-04-30 41.38 1953-03-31 39.90 1953-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-10-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-06-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-03-25 38.75 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-08-28 37.75 1951-05-29 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-10-25 35.91 1950-01-22 35.46 1950-08-31 36.64 1950-07-24 36.93 1950-08-21 36.94 1950-05-23 36.54 1950-02-21 35.98 1950-05-23 36.54						
1953-02-27 38.02 1953-02-03 37.48 1952-12-24 36.78 1952-12-03 36.89 1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-06-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-03-25 38.75 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-07-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-04-24 38.28 1951-05-29 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-10-25 35.91 1950-01-22 35.59 1950-08-31 36.64 1950-07-24 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-02-21 35.98 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70						
1952-12-24 36.78 1952-12-03 36.89 1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-06-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-03-25 38.75 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-05-29 37.87 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 36.25 1950-11-27 35.46 1950-02-21 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-02-21 35.98 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-02-28 36.00 1949-11-30 36.38 1949-02-27 37.43 1949-08-25 38.64						
1952-11-04 37.37 1952-09-24 38.17 1952-08-27 38.68 1952-07-22 39.34 1952-06-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-03-25 38.75 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-05-29 37.87 1951-04-24 38.28 1951-05-29 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-08-31 36.64 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-04-25 36.54 1950-03-28 36.54 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-02-21 36.91 1949-07-27 38.64						
1952-08-27 38.68 1952-07-22 39.34 1952-06-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-03-25 38.75 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-05-29 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-02-21 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-02-21 36.91 1949-07-27 38.64 1949-07-07 39.05 1949-07-27 38.64	1952-11-04					
1952-06-23 39.92 1952-05-26 39.35 1952-04-22 38.84 1952-03-25 38.75 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-05-29 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-02-21 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-04-25 36.54 1950-03-28 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-02-24 36.91 1949-07-27 38.64 1949-07-07 39.05 1949-07-27 38.64	1952-08-27			1952-07-22		
1952-04-22 38.84 1952-03-25 38.75 1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-05-29 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-02-21 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-06-26 37.09 1950-05-23 36.54 1950-02-21 35.98 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-02-24 36.91 1949-07-27 38.64 1949-08-25 38.02 1949-07-27 38.64 1949-04-27 39.75 1949-03-29 39.84						
1952-02-25 38.36 1952-01-24 37.45 1951-12-18 36.16 1951-11-26 36.07 1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-05-29 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-02-25 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-08-31 36.64 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-02-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84				1952-03-25		
1951-10-30 35.71 1951-09-25 36.22 1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-05-29 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-02-5 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-06-26 37.09 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-02-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1952-02-25		38.36	1952-01-24		37.45
1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-05-29 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-02-5 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-06-26 37.09 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-02-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1951-12-18		36.16	1951-11-26		36.07
1951-08-28 36.75 1951-07-25 37.34 1951-06-28 37.75 1951-05-29 37.87 1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-02-5 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-06-26 37.09 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-02-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1951-10-30		35.71	1951-09-25		36.22
1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-10-25 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-06-26 37.09 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1951-08-28			1951-07-25		
1951-04-24 38.28 1951-03-27 37.46 1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-10-25 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-06-26 37.09 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1951-06-28		37.75	1951-05-29		37.87
1951-02-21 36.25 1951-01-22 35.59 1950-12-21 35.29 1950-11-27 35.46 1950-10-25 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-06-26 37.09 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1951-04-24			1951-03-27		37.46
1950-10-25 35.91 1950-09-26 36.32 1950-08-31 36.64 1950-07-24 36.93 1950-06-26 37.09 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1951-02-21			1951-01-22		
1950-08-31 36.64 1950-07-24 36.93 1950-06-26 37.09 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1950-12-21		35.29	1950-11-27		35.46
1950-06-26 37.09 1950-05-23 36.54 1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1950-10-25		35.91	1950-09-26		36.32
1950-04-25 36.54 1950-03-28 36.61 1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1950-08-31		36.64	1950-07-24		36.93
1950-02-21 35.98 1950-02-01 35.70 1949-12-28 36.00 1949-11-30 36.38 1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1950-06-26		37.09	1950-05-23		36.54
1949-12-28 36.00 1949-11-30 36.38 1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1950-04-25		36.54	1950-03-28		36.61
1949-10-24 36.91 1949-09-27 37.43 1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1950-02-21		35.98	1950-02-01		35.70
1949-08-25 38.02 1949-07-27 38.64 1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1949-12-28		36.00	1949-11-30		36.38
1949-07-07 39.05 1949-05-26 39.67 1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1949-10-24		36.91	1949-09-27		37.43
1949-04-27 39.75 1949-03-29 39.84 1949-02-23 39.34 1949-01-27 38.96	1949-08-25		38.02	1949-07-27		38.64
1949-02-23 39.34 1949-01-27 38.96	1949-07-07		39.05	1949-05-26		39.67
	1949-04-27		39.75	1949-03-29		39.84
1948-12-28 37.13 1948-12-02 37.50	1949-02-23		39.34	1949-01-27		38.96
	1948-12-28		37.13	1948-12-02		37.50

Ground-wate	er levels, cont Feet below	inued. Feet to		Feet below	Feet to
Date	Surface	Sealevel	Date	Surface	Sealevel
1948-10-25		38.13	1948-09-28		38.73
1948-08-26		39.53	1948-07-29		40.12
1948-06-29		40.26	1948-05-26		39.64
1948-04-28		39.50	1948-03-29		39.05
1948-02-26		37.79	1948-01-30		36.96
1947-12-22		36.81	1947-11-28		36.56
1947-10-27		36.24	1947-10-01		36.66
1947-09-08		37.00	1947-07-28		37.36
1947-07-03		37.34	1947-06-03		37.54
1947-05-01		37.40	1947-04-01		36.16
1947-03-03		35.85	1947-02-10		35.87
1947-01-02		36.04	1946-11-29		36.50
1946-10-31		36.97	1946-09-27		37.48
1946-08-30		37.99	1946-07-26		38.49
1946-06-27		38.92	1946-06-05		37.95
1946-04-26		37.86	1946-04-04		37.76
1946-03-07		37.71	1946-02-06		37.61
1945-12-28		36.52	1945-11-28		36.02
1945-10-26		36.40	1945-10-03		36.80
1945-09-08		37.26	1945-07-31		37.85
1945-06-28		38.32	1945-05-29		38.43
1945-05-03		37.88	1945-03-28		38.13
1945-02-02		37.47	1944-12-29		37.35
1944-11-28		36.30	1944-11-01		36.56
1944-09-29		37.15	1944-08-30		37.42
1944-07-29		38.11	1944-06-29		38.75
1944-06-01		39.30	1944-04-29		38.95
1944-03-28		38.06	1944-03-03		37.30
1944-02-07		37.53	1943-12-31		36.77
1943-11-29		37.06	1943-11-01		36.88
1943-09-27		37.39	1943-08-30		37.93
1943-07-31		38.58	1943-06-26		39.12
1943-05-29		38.40	1943-05-01		38.51
1943-03-31		38.71	1943-02-27		38.36
1943-01-02		37.43	1942-12-26		37.30
1942-12-19		37.14	1942-12-12		37.25
1942-12-05		37.16	1942-11-28		37.21
1942-11-21		37.31	1942-11-14		37.42
1942-11-07		37.50	1942-10-31		37.63
1942-10-24		37.75	1942-10-17		37.87
1942-10-10		38.00	1942-10-03		38.12
1942-09-26		38.25	1942-09-19		38.38
1942-09-12		38.52	1942-09-05		38.61
1942-08-29		38.50	1942-08-22		38.09
1942-08-15		37.52	1942-08-08		37.33
1942-08-01		37.43	1942-07-25		37.36
1942-07-18		37.44	1942-07-11		37.53
1942-07-06		37.59	1942-06-27		37.60
1942-06-20		37.59	1942-06-13		37.59
1942-06-06		37.46	1942-05-30		37.54
1942-05-22		37.62	1942-05-15		37.69
1942-05-08		37.77	1942-04-30		37.84
1942-04-24		37.90	1942-04-17		37.97
1942-04-14		37.95			

Map ID Direction Distance

Elevation Database EDR ID Number

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404458073152901

Monloc name: S 90097. 1
Monloc type: Well
Monloc desc: Not Reported

02030202 Drainagearea value: Not Reported Huc code: Contrib drainagearea: Not Reported Drainagearea Units: Not Reported 40.7495427 Contrib drainagearea units: Not Reported Latitude: Longitude: -73.2576171 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: Not Reported Vert measure units: Not Reported Vertacc measure val: Not Reported

Vert accmeasure units: Not Reported Vertcollection method: Not Reported

Vert coord refsys: Not Reported Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: Not Reported Welldepth units: Not Reported Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 0

A4
SSE FED USGS USGS40000831400

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404458073152902

Monloc name: S 90098. 1

Monloc type: Well

Monloc desc: Not Reported

02030202 Drainagearea value: Not Reported Huc code: Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported 40.7495427 Latitude: -73.2576171 Longitude: 24000 Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: Not Reported Vert measure units: Not Reported Vertacc measure val: Not Reported

Vert accmeasure units: Not Reported Vertcollection method: Not Reported

Vert coord refsys: Not Reported Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: Not Reported Welldepth units: Not Reported Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 0

5 SSE FED USGS USGS40000831322

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404452073153701

Monloc name: S 90099. 1
Monloc type: Well
Monloc desc: Not Reported
Huc code: 02030202

Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported 40.7478761 Latitude: Longitude: -73.2598394 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 52.2 Vert measure units: feet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 25 Welldepth units: ft Wellholedepth: 75

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

B6 East NY WELLS NYWS006206

1/2 - 1 Mile Lower

Well Id: NY5110526 System name: SUFFOLK COUNTY WATER AUTHORITY System Id: Sustem name: EAST FORKS ROAD WELL # 1 S-13534

Type: Well Active?: Active
County: SUFFOLK COUNTY Latitude: 404526 000
Longitude: 731505 000 Slec_type_: AC

Agency: RANDAZZO, KAREN Address: PO BOX 18043

City/State/Zip: HAUPPAUGUE NY 11788

Phone: 631-563-0258

B7

East 1/2 - 1 Mile Lower NY WELLS NYWS006207

Well Id: NY5110526 System Id: 012

System Id: 012 Type: Well

County: SUFFOLK COUNTY
Longitude: 731505 000
Agency: RANDAZZO, KAREN
Address: PO BOX 18043

City/State/Zip: HAUPPAUGUE NY 11788

Phone: 631-563-0258

System name: SUFFOLK COUNTY WATER AUTHORITY Well name: EAST FORKS ROAD WELL # 4 S-38192

Active?: Active
Latitude: 404526 000
Slec_type_: AC

East NY WELLS NYWS006208

1/2 - 1 Mile Lower

Well Id: NY5110526 System name: SUFFOLK COUNTY WATER AUTHORITY
System Id: 012 Well name: EAST FORKS ROAD WELL # 4 S-38192

Type: Well Active?: Active
County: SUFFOLK COUNTY Latitude: 404526 000
Longitude: 731505 000 Slec_type_: AC

Agency: MURRAY, ROBERT L.
Address: 180 Fifth Avenue
City/State/Zip: BAYSHORE NY 11706

Phone: 631-665-0662

1/2 - 1 Mile Lower

Lower

Well Id: NY5110526 System name: SUFFOLK COUNTY WATER AUTHORITY System Id: Support System name: SUFFOLK COUNTY WATER AUTHORITY System Id: Support System name: Support System name

Type: Well Active?: Active

County: SUFFOLK COUNTY Latitude: 404526 000

Longitude: 731505 000 Slec_type_: AC

Longitude: 731505 000
Agency: MURRAY, ROBERT L.
Address: 180 Fifth Avenue
City/State/Zip: BAYSHORE NY 11706

Phone: 631-665-0662

Well Id: NY5110526 System name: SUFFOLK COUNTY WATER AUTHORITY
System Id: 011 Well name: EAST FORKS ROAD WELL # 2 S-16176

Type: Well Active?: Active

County: SUFFOLK COUNTY Latitude: 404526 000

Longitude: 731505 000 Slec_type_: AC

Agency: RANDAZZO, KAREN

Address: PO BOX 18043
City/State/Zip: HAUPPAUGUE NY 11788

Phone: 631-563-0258

Map ID Direction Distance

Database EDR ID Number Elevation

B11 NY WELLS NYWS006205

1/2 - 1 Mile Lower

> Well Id: NY5110526 System name: SUFFOLK COUNTY WATER AUTHORITY EAST FORKS ROAD WELL # 2 S-16176 System Id: Well name: 011

Well Active?: Type: Active SUFFOLK COUNTY 404526 000 County: Latitude: Longitude: 731505 000 Slec_type_: AC

Agency: MURRAY, ROBERT L. Address: 180 Fifth Avenue City/State/Zip: **BAYSHORE NY 11706**

Phone: 631-665-0662

B12 ENE 1/2 - 1 Mile **FED USGS** USGS40000831773

Lower

Org. Identifier: **USGS-NY**

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404528073150701

Monloc name: S 71083.1 Monloc type: Well

Monloc desc: SCWA EAST FORKS RD #5 NORTH BAY SHORE

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported Latitude: 40.757876 Longitude: -73.2515056 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 61.9 Vert measure units: feet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Magothy Aquifer Formation type:

Aquifer type: Not Reported

Welldepth: Construction date: Not Reported 798

Welldepth units: Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 3

Feet below Feet to Feet below Feet to Date Surface Sealevel Date Surface Sealevel 1985-04-08 33.86 1985-04-08 33.87

1984-04-18 35.24

Lower

C13 **FED USGS** USGS40000831303 SSE 1/2 - 1 Mile

TC3812742.2s Page A-21

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404450073153101

Monloc name: S 90100. 1

Monloc type: Well

Monloc desc: Not Reported

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported 40.7473206 Latitude: -73.2581727 24000 Longitude: Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 50.0 Vert measure units: 50.0 Vert measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aguifer type: Not Reported

Construction date: Not Reported Welldepth: 25 Welldepth units: ft Wellholedepth: 75

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404528073150801

Monloc name: S 16176. 1 Monloc type: Well

Monloc desc: SCWA EAST FORKS RD #2 NORTH BAY SHORE

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported Latitude: 40.757876 Longitude: -73.2512278 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 62.0 Vert measure units: 62.0 Vert measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: 19580318 Welldepth: 117 Welldepth units: ft Wellholedepth: 121

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

Map ID Direction Distance

Elevation Database EDR ID Number

1/2 - 1 Mile Lower

PWS ID: NY0010526

Date Initiated: Not Reported Date Deactivated: Not Reported

PWS Name: SUFFOLK COUNTY WATER AUTHORITY

POND ROAD

OAKDALE, NY 11769

Addressee / Facility: System Owner/Responsible Party

SUFFOLK COUNTY WATER AUTHORITY

POND ROAD

OAKDALE, NY 11769

Facility Latitude: 40 43 17 Facility Longitude: 073 15 36 Facility Latitude: 40 45 37 Facility Longitude: 073 16 33 Facility Latitude: 40 45 05 Facility Longitude: 073 13 14 Facility Latitude: 40 40 46 Facility Longitude: 073 25 20 Facility Latitude: 40 47 07 Facility Longitude: 073 18 58 Facility Longitude: 073 05 14 Facility Latitude: 40 48 05 Facility Latitude: 40 46 32 Facility Longitude: 073 07 06 Facility Latitude: 40 45 54 Facility Longitude: 072 56 19 Facility Latitude: 40 59 00 Facility Longitude: 072 06 24 Facility Latitude: Facility Longitude: 071 56 47 41 03 16 Facility Latitude: 40 58 39 Facility Longitude: 072 11 45 Facility Longitude: 072 08 24 Facility Latitude: 40 58 44 Facility Latitude: 40 44 30 Facility Longitude: 073 21 16 Facility Latitude: 40 45 49 Facility Longitude: 073 10 44 40 43 26 Facility Longitude: 073 17 38 Facility Latitude: Facility Latitude: 40 42 05 Facility Longitude: 073 24 22 Facility Latitude: 40 49 51 Facility Longitude: 073 04 30 Facility Latitude: 40 49 36 Facility Longitude: 073 06 04 Facility Longitude: 072 58 50 Facility Latitude: 40 52 44 Facility Longitude: 071 55 44 Facility Latitude: 41 02 42 Facility Latitude: 40 58 16 Facility Longitude: 072 10 06 Facility Longitude: 072 12 29 Facility Latitude: 40 57 18 Facility Latitude: 40 51 40 Facility Longitude: 073 19 07 Facility Latitude: 40 43 20 Facility Longitude: 073 20 19 Facility Longitude: 073 18 22 Facility Latitude: 40 45 01 Facility Longitude: 073 15 38 Facility Latitude: 40 43 18 Facility Latitude: 40 42 00 Facility Longitude: 073 21 25 Facility Latitude: 40 48 20 Facility Longitude: 073 07 40 Facility Latitude: 40 47 15 Facility Longitude: 072 59 59 40 44 55 Facility Longitude: 073 03 33 Facility Latitude: Facility Latitude: 40 53 32 Facility Longitude: 072 24 22 Facility Latitude: 41 02 00 Facility Longitude: 071 57 36 Facility Latitude: 40 59 20 Facility Longitude: 072 17 05 Facility Longitude: 073 23 56 Facility Latitude: 40 51 35 Facility Latitude: 40 54 01 Facility Longitude: 073 27 59 Facility Longitude: 073 22 34 Facility Latitude: 40 53 09 Facility Latitude: 40 42 11 Facility Longitude: 073 25 01 Facility Latitude: 40 41 18 Facility Longitude: 073 22 45

Facility Latitude:	40 44 28	Facility Longitude:	073 07 40
Facility Latitude:	40 48 11	Facility Longitude:	073 11 33
Facility Latitude:	40 43 24	Facility Longitude:	073 22 25
Facility Latitude:	40 40 49	Facility Longitude:	073 23 23
Facility Latitude:	40 51 04	Facility Longitude:	073 05 11
Facility Latitude:	40 47 53	Facility Longitude:	073 02 50
Facility Latitude:	40 49 03	Facility Longitude:	073 03 31
Facility Latitude:	40 49 45	Facility Longitude:	
Facility Latitude:	40 49 55	Facility Longitude:	
Facility Latitude:	41 02 56	Facility Longitude:	
Facility Latitude:	40 54 13	Facility Longitude:	
Facility Latitude:	40 53 57	Facility Longitude:	073 18 27
Facility Latitude:	40 53 35	Facility Longitude:	
Facility Latitude:	40 53 05	Facility Longitude:	
Facility Latitude:	40 53 43	Facility Longitude:	
Facility Latitude:	40 51 21	Facility Longitude:	
Facility Latitude:	40 45 26	Facility Longitude:	
Facility Latitude:	40 43 57	Facility Longitude:	
Facility Latitude:	40 47 52	Facility Longitude:	
Facility Latitude:	40 50 38	Facility Longitude:	
Facility Latitude:	41 02 28	Facility Longitude:	
Facility Latitude:	40 51 58	Facility Longitude:	
Facility Latitude:	40 54 36	Facility Longitude:	
Facility Latitude:	40 52 54	Facility Longitude:	
Facility Latitude:	40 54 13	Facility Longitude:	
Facility Latitude:	40 52 56	Facility Longitude:	
Facility Latitude:	40 43 05	Facility Longitude:	
Facility Latitude:	40 45 39	Facility Longitude:	
Facility Latitude:	40 46 59	Facility Longitude:	
Facility Latitude:	40 45 11	Facility Longitude:	
Facility Latitude:	40 44 32	Facility Longitude:	
Facility Latitude:	40 41 58	Facility Longitude:	
Facility Latitude:	40 44 02	Facility Longitude:	
Facility Latitude:	40 42 32	Facility Longitude:	
Facility Latitude:		Facility Longitude:	
	40 40 50		
Facility Latitude:	40 47 37	Facility Longitude:	
Facility Latitude: Facility Latitude:	40 46 16 40 54 11	Facility Longitude: Facility Longitude:	
Facility Latitude:	40 54 11 40 51 17	Facility Longitude:	
•		Facility Longitude:	
Facility Latitude:	40 52 48 40 43 50	Facility Longitude:	
Facility Latitude: Facility Latitude:	40 46 05	Facility Longitude:	
•			
Facility Latitude:	40 43 07 40 45 31	Facility Longitude:	
Facility Latitude:	40 45 21 41 03 26	Facility Longitude:	
Facility Latitude:		Facility Longitude:	
Facility Latitude:	40 46 16	Facility Longitude:	
Facility Latitude:	40 43 04	Facility Longitude:	
Facility Latitude:	40 48 02	Facility Longitude: Facility Longitude:	
Facility Latitude:	40 48 02	, ,	
Facility Latitude:	40 44 20	Facility Longitude:	
Facility Latitude:	40 42 23	Facility Longitude:	
Facility Latitude:	41 03 22	Facility Longitude:	
Facility Latitude:	41 03 05	Facility Longitude:	
Facility Latitude:	40 53 16	Facility Longitude:	
Facility Latitude:	40 49 57	Facility Longitude:	
Facility Latitude:	40 52 32	Facility Longitude:	0/3 22 15

Facility Latitude: 40 52 57 Facility Longitude: 073 23 03

City Served: ISLIP (T)

Treatment Class Not Reported Population: Not Reported

Violations information not reported.

C16
SSE FED USGS USGS40000831302

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404450073152801

Monloc name: S 90101.1

Monloc type: Well

Monloc desc: Not Reported

02030202 Huc code: Drainagearea value: Not Reported Contrib drainagearea: Drainagearea Units: Not Reported Not Reported 40.7473205 Contrib drainagearea units: Not Reported Latitude: -73.2573393 24000 Longitude: Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 50.0 Vert measure units: feet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 25 Welldepth units: ft Wellholedepth: 75

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

B17
ENE FED USGS USGS40000831772

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404528073150501

Monloc name: S 18566. 1 Monloc type: Well

Monloc desc: SCWA EAST FORKS RD #3 NORTH BAY SHORE

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported Latitude: 40.7581538 Longitude: -73.25095 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 62.0 Vert measure units: 62.0 Vert measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Magothy Aquifer

Aquifer type: Not Reported

Construction date: 19600512 Welldepth: 383
Welldepth units: ft Wellholedepth: 653

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404531073150601

Monloc name: S 13534. 1 Monloc type: Well

Monloc desc: SCWA EAST FORKS RD #1 NORTH BAY SHORE

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported 40.7581538 Latitude: Longitude: -73.2506723 24000 Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 62.0 Vert measure units: 62.0 Vert measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: 19550504 Welldepth: 126 Welldepth units: ft Wellholedepth: 126

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

E19
WNW FED USGS USGS40000831855

1/2 - 1 Mile Higher

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404534073163101

Monloc name: S 16175. 1 Monloc type: Well

Monloc desc: SCWA LOCUST DR #2 NORTH BRIGHTWATERS

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported Latitude: 40.7595428 Longitude: -73.2748397 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 70.0 Vert measure units: feet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: 19580402 Welldepth: 130 Welldepth units: ft Wellholedepth: 130 Wellholedepth units: ft

Ground-water levels, Number of Measurements: 3

Feet below Feet to Feet below Feet to Date Surface Sealevel Date Surface Sealevel 1985-04-09 1985-04-09 48.18 47.73 1985-04-09 47.87

20 SSE FED USGS USGS40000831235 1/2 - 1 Mile

1/2 - 1 Mil Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404445073153701

Monloc name: S 3515. 1

Monloc type: Well

Monloc desc: Not Reported

02030202 Huc code: Drainagearea value: Not Reported Drainagearea Units: Not Reported Not Reported Contrib drainagearea: Contrib drainagearea units: Not Reported Latitude: 40.7459317 Longitude: -73.2598394 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: Not Reported Vert measure units: Not Reported Vertacc measure val: Not Reported

Vert accmeasure units: Not Reported Vertcollection method: Not Reported

Vert coord refsys: Not Reported Countrycode: US

Aquifername: Not Reported Formation type: Not Reported Aquifer type: Not Reported Construction date: Not Reported

Construction date: Not Reported Welldepth: 35

Welldepth units: ft Wellholedepth: Not Reported Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 157

Feet below Feet to Feet below Feet to Date Surface Sealevel Date Surface Sealevel 1953-03-31 34.93 1952-12-24 31.84 31.74 1952-11-04 32.07 1952-12-03 32.71 33.19 1952-09-24 1952-08-27 1952-07-22 33.75 1952-06-23 34.50 1952-05-26 34.29 1952-04-22 33.76 1952-03-25 33.91 1952-02-25 33.58 1952-01-24 32.90 1951-12-17 31.67 1951-11-26 31.54 1951-10-30 30.82 31.66 1951-09-25 31.19 1951-08-28 1951-07-25 32.20 1951-06-28 32.72 1951-05-29 32.95 1951-04-24 33.47 1951-03-27 32.80 1951-02-21 31.96 1951-01-22 31.16 1950-12-21 30.68 1950-11-27 30.71 1950-10-25 31.07

Ground-wate	er levels, conti	nued. Feet to		Feet below	Feet to
Date	Surface	Sealevel	Date	Surface	Sealevel
1950-09-26		31.43	1950-08-3 ⁻	 1	31.77
1950-07-24		32.01	1950-06-20	3	32.39
1950-05-23		31.90	1950-04-2		31.89
1950-03-28		31.88	1950-02-2		31.51
1950-02-01		31.84	1949-12-2		31.01
1949-11-30		31.29	1949-10-2		31.61
1949-09-27		32.02	1949-08-2		32.45
1949-07-27		33.01	1949-07-0		33.98
1949-05-26		34.26	1949-04-2		34.36
1949-03-29		34.55	1949-02-2		34.26
1949-01-27		33.83	1948-12-2		32.03
1948-12-02		32.27	1948-10-29		32.67
1948-09-28		33.18	1948-08-20		34.00
1948-07-29		34.63	1948-06-29		34.83
1948-05-26		34.55	1948-04-2		34.29
1948-03-29		33.26	1948-02-20 1947-12-2:		33.15 32.10
1948-01-30		32.43		_	
1947-11-28		31.96	1947-10-2		31.20
1947-10-01		31.59	1947-09-0		31.95
1947-07-28		32.42	1947-07-03		32.31
1947-06-03		32.69	1947-05-0		32.58
1947-04-01		31.45	1947-03-03		31.06
1947-02-10		31.16	1947-01-02		31.03
1946-11-29		31.39	1946-10-3		31.78
1946-09-27		32.26	1946-08-3		32.75
1946-07-26		33.20	1946-06-2		33.80
1946-06-05		33.23	1946-04-20		32.87
1946-04-04		32.99	1946-03-0	7	32.92
1946-02-06		32.82	1945-12-2	3	31.95
1945-11-28		31.19	1945-10-20	3	31.32
1945-10-03		31.64	1945-09-0	3	32.04
1945-07-31		32.62	1945-06-2	3	33.15
1945-05-29		33.49	1945-05-0	3	32.91
1945-03-28		33.25	1945-03-0	1	32.73
1945-02-02		32.53	1944-12-29	9	32.62
1944-11-28		31.56	1944-11-0	1	31.47
1944-09-29		31.97	1944-08-3)	32.01
1944-07-29		32.68	1944-06-29	9	33.37
1944-06-01		33.99	1944-04-29	9	34.17
1944-03-28		33.36	1944-03-0	3	32.36
1944-02-07		32.58	1943-12-3	1	31.84
1943-11-29		32.21	1943-11-0	1	31.92
1943-09-27		32.10	1943-08-3)	32.52
1943-07-31		33.21	1943-06-20	3	34.00
1943-05-29		34.05	1943-05-0	1	33.39
1943-03-31		33.87	1943-02-2	7	33.48
1943-01-02		32.73	1942-12-20	3	32.42
1942-12-19		32.50	1942-12-1	2	32.50
1942-12-05		32.36	1942-11-2	3	32.25
1942-11-21		32.29	1942-11-1	4	32.36
1942-11-07		32.42	1942-10-3		32.50
1942-10-24		32.61	1942-10-1		32.71
1942-10-10		32.84	1942-10-0		32.98
1942-09-26		33.11	1942-09-1		33.26
1942-09-12		33.39	1942-09-0		33.56

Ground-wate	Ground-water levels, continued. Feet below Feet to					Feet to	
Date	Surface	Sealevel		Date	Surface	Sealevel	
1942-08-29		33.64		1942-08-22		33.37	
1942-08-15		32.64		1942-08-08		32.47	
1942-08-01		32.52		1942-07-25		32.39	
1942-07-18		32.47		1942-07-11		32.55	
1942-07-06		32.63		1942-06-27		32.72	
1942-06-20		32.80		1942-06-13		32.73	
1942-06-06		32.45		1942-05-30		32.56	
1942-05-22		32.65		1942-05-15		32.73	
1942-05-08		32.82		1942-04-30		32.88	
1942-04-24		32.95					

E21
WNW
FED USGS USGS40000831886
1/2 - 1 Mile

Org. Identifier: USGS-NY

Higher

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404537073163100

Monloc name: CORE SAMPLE FROM S108365.1 BOREHOLE AT 460 FEET

Monloc type: Well: Test hole not completed as a well

Monloc desc: Not Reported

Huc code: Not Reported Drainagearea value: Not Reported Not Reported Contrib drainagearea: Not Reported Drainagearea Units: Contrib drainagearea units: Not Reported Latitude: 40.7603761 -73.2748397 24000 Longitude: Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: Not Reported Vert measure units: Not Reported Vertacc measure val: Not Reported Vert accmeasure units: Not Reported

Vert cord refsys: Not Reported

Not Reported

Not Reported

Not Reported

Not Reported

/ert coord refsys: Not Reported Countrycode: US

Aquifername: Not Reported Formation type: Not Reported Aquifer type: Not Reported Construction date: Not Reported

Construction date: Not Reported Welldepth: Not Reported Welldepth units: Not Reported Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 0

E22
WNW FED USGS USGS40000831887

1/2 - 1 Mile Higher

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404537073163101

Monloc name: S108365. 1 Monloc type: Well Monloc desc: 3101

Huc code:Not ReportedDrainagearea value:Not ReportedDrainagearea Units:Not ReportedContrib drainagearea:Not ReportedContrib drainagearea units:Not ReportedLatitude:40.7603761Longitude:-73.2748397Sourcemap scale:24000

Horiz Acc measure: 1 Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 76.0 Vert measure units: 6eet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Magothy Aquifer Aquifer type: Not Reported

Construction date: Not Reported Welldepth: Not Reported Welldepth units: Not Reported Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 0

D23
ENE FED USGS USGS40000831771

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404528073150402

Monloc name: S 38192. 1 Monloc type: Well

Monloc desc: SCWA EAST FORKS RD #4 NORTH BAY SHORE

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported 40.7587093 Contrib drainagearea units: Not Reported Latitude: -73.2498389 24000 Longitude: Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 65.9 Vert measure units: 65.9 Vert measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Magothy Aquifer Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 306 Welldepth units: ft Wellholedepth: 605

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

F24 WNW FED USGS USGS40000831875 1/2 - 1 Mile

Higher

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404536073163301

Monloc name: S 15898. 1 Monloc type: Well

Monloc desc: SCWA LOCUST DR #1 NORTH BRIGHTWATERS

Huc code:02030202Drainagearea value:Not ReportedDrainagearea Units:Not ReportedContrib drainagearea:Not ReportedContrib drainagearea units:Not ReportedLatitude:40.7603761Longitude:-73.275673Sourcemap scale:24000

Horiz Acc measure: 1 Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 70.0 Vert measure units: feet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: 19570830 Welldepth: 128 Welldepth units: ft Wellholedepth: 133

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 5

Feet below Feet to Feet below Feet to
Date Surface Sealevel Date Surface Sealevel

1990-03-28 47.83

Note: A nearby site that taps the same aquifer was being pumped.

 1985-04-09
 45.46
 1985-04-09
 45.47

 1984-04-25
 71.77
 1984-04-25
 48.51

F25
WNW NY WELLS NYWS006198
1/2 - 1 Mile

Higher

Well Id: NY5110526 System name: SUFFOLK COUNTY WATER AUTHORITY
System Id: 017 Well name: LOCUST DRIVE BRENT. WELL # 3 S-36460

Type: Well Active?: Active
County: SUFFOLK COUNTY Latitude: 404537 000
Longitude: 731633 000 Slec_type_: AC

Agency: MURRAY, ROBERT L.
Address: 180 Fifth Avenue
City/State/Zip: BAYSHORE NY 11706

Phone: 631-665-0662

F26
WNW
NY WELLS
NYWS006199

1/2 - 1 Mile Higher

Well Id: NY5110526 System name: SUFFOLK COUNTY WATER AUTHORITY
System Id: 017 Well name: LOCUST DRIVE BRENT. WELL # 3 S-36460

Type: Well Active?: Active

County: SUFFOLK COUNTY Latitude: 404537 000

Longitude: 731633 000 Slec_type_: AC

Agency: RANDAZZO, KAREN Address: PO BOX 18043

City/State/Zip: HAUPPAUGUE NY 11788

Phone: 631-563-0258

F27 WNW 1/2 - 1 Mile Higher

NY WELLS NYWS006196

Well Id: NY5110526 System name: SUFFOLK COUNTY WATER AUTHORITY
System Id: O16 Well name: LOCUST DRIVE BRENT. WELL #1 S-15898

Type: Well Active?: Active

County: SUFFOLK COUNTY Latitude: 404537 000

Longitude: 731633 000 Slec_type_: AC

Agency: MURRAY, ROBERT L.
Address: 180 Fifth Avenue
City/State/Zip: BAYSHORE NY 11706

Phone: 631-665-0662

F28
WNW
NY WELLS NYWS006197

1/2 - 1 Mile Higher

Well Id:NY5110526System name:SUFFOLK COUNTY WATER AUTHORITYSystem Id:016Well name:LOCUST DRIVE BRENT. WELL # 1 S-15898

Type: Well Active?: Active
County: SUFFOLK COUNTY Latitude: 404537 000
Longitude: 731633 000 Slec_type_: AC

Agency: RANDAZZO, KAREN Address: PO BOX 18043

City/State/Zip: HAUPPAUGUE NY 11788

Phone: 631-563-0258

F29
WNW
FED USGS USGS40000832283
1/2 - 1 Mile

Higher

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404627073070901

Monloc name: S 36460. 1 Monloc type: Well

Monloc desc: SCWA LOCUST DR #3 NORTH BRIGHTWATERS

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported Latitude: 40.7603761 Longitude: -73.2759508 24000 Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 76.0 Vert measure units: 6eet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Magothy Aquifer Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 611

Welldepth units: ft Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 17

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1998-04-	14	41.79	1997-04-10		40.81
1994-04-0	05	40.83	1993-04-07		42.21
1992-04-0	01	40.53			
Note: T	he site had beer	n pumped recently.			
1991-03-2	25	43.49			
Note: T	he site had beer	n pumped recently.			
1990-03-2	23	42.45			
Note: T	he site had beer	n pumped recently.			
1989-03-2	20	38.26	1985-04-09		40.64
1985-04-0	09	40.95	1984-04-25		42.79
1983-03-1	15	38.55			
Note: A	nearby site that	t taps the same aquifer was being pumped	l .		
1981-03-1	10	39.35			
Note: A	nearby site that	t taps the same aquifer was being pumped	l.		
1980-03-1	11	35.96			
1977-03-2	22	36.67			
Note: A	nearby site that	t taps the same aquifer was being pumped	l.		
1977-03-	14	42.35	1976		39.20

G30 SSE FED USGS USGS40000831220 1/2 - 1 Mile

1/2 - 1 N Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404444073152101

Monloc name: S 90102. 1
Monloc type: Well
Monloc desc: Not Reported
Huc code: 02030202

Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported 40.7456539 Latitude: 24000 Longitude: -73.2553948 Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 48.0 Vert measure units: feet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 91
Welldepth units: ft Wellholedepth: 91

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

G31 SSE 1/2 - 1 Mile

FED USGS USGS40000831218

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404444073152001

Monloc name: S 90104. 1
Monloc type: Well
Monloc desc: Not Reported

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported 40.7456539 Latitude: -73.255117 24000 Longitude: Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 48.0 Vert measure units: 48.0 Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aguifer type: Not Reported

Construction date: Not Reported Welldepth: 24
Welldepth units: ft Wellholedepth: 98

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

G32 SSE FED USGS USGS40000831219

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404444073152002

Monloc name: S 90103. 1
Monloc type: Well
Monloc desc: Not Reported

02030202 Huc code: Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported Latitude: 40.7456539 Longitude: -73.255117 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 48.0
Vert measure units: feet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 90 Welldepth units: ft Wellholedepth: 90

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

Map ID Direction Distance

Elevation Database EDR ID Number

G33
SSE FED USGS USGS40000831217

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404444073151901

Monloc name: S 90105. 1 Monloc type: Well

Monloc desc: Not Reported

02030202 Drainagearea value: Not Reported Huc code: Contrib drainagearea: Not Reported Drainagearea Units: Not Reported 40.7456539 Contrib drainagearea units: Not Reported Latitude: Longitude: -73.2548392 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 48.5 Vert measure units: 6eet Vertacc measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 96
Welldepth units: ft Wellholedepth: 96

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

G34
SSE FED USGS USGS40000831216

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404444073151801

Monloc name: S 90106. 1

Monloc type: Well

Monloc desc: Not Reported

Huc code: 02030202

Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported 40.7456539 Latitude: Longitude: -73.2545615 24000 Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 50.0 Vert measure units: 50.0 Vert measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 66
Welldepth units: ft Wellholedepth: 66

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

H35 South FED USGS USGS40000831033

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404430073154801

Monloc name: S 63852. 1

Monloc type: Well

Monloc desc: Not Reported

Huc code: 02030202

Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported Latitude: 40.7417651 Longitude: -73.2628951 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: Not Reported Vert measure units: Not Reported Vertacc measure val: Not Reported

Vert accmeasure units: Not Reported Vertcollection method: Not Reported

Vert coord refsys: Not Reported Countrycode: US

Aquifername: Not Reported
Formation type: Not Reported
Aquifer type: Not Reported

Construction date: Not Reported Welldepth: Not Reported Welldepth units: Not Reported Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 19

Feet below		Feet to			Feet below	Feet to	
Date	Surface	Sealevel		Date	Surface	Sealevel	
1990-03-08		38.91		1983-03-08		36.98	
1982-12-06		36.49		1982-09-28		37.20	
1982-06-21		39.75		1982-03-19		38.42	
1981-09-30		37.18		1981-06-08		37.11	
1979-01-30		40.99		1978-12-29		37.66	
1978-11-20		37.70		1978-10-27		38.23	
1978-09-26		38.43		1978-08-22		39.11	
1978-07-31		39.18		1978-06-28		40.17	
1978-06-02		40.88		1978-05-04		40.11	
1978-04-27		40.26					

H36 South 1/2 - 1 Mile Lower

FED USGS USGS40000831034

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404430073154802

Monloc name: S 91156. 1
Monloc type: Well
Monloc desc: Not Reported

Huc code: 02030202 Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported 40.7417651 Latitude: -73.2628951 24000 Longitude: Sourcemap scale: Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: Not Reported Vert measure units: Not Reported Vertacc measure val: Not Reported

Vert accmeasure units: Not Reported Vertcollection method: Not Reported

Vert coord refsys: Not Reported Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 12 Welldepth units: ft Welldepth: 12

Wellholedepth units: ft

Ground-water levels, Number of Measurements: 0

H37
South FED USGS USGS40000831035
1/2 - 1 Mile

Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404430073154803

Monloc name: S 91155. 1
Monloc type: Well
Monloc desc: Not Reported

02030202 Huc code: Drainagearea value: Not Reported Drainagearea Units: Not Reported Contrib drainagearea: Not Reported Contrib drainagearea units: Not Reported Latitude: 40.7417651 Longitude: -73.2628951 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: Not Reported Vert measure units: Not Reported Vertacc measure val: Not Reported

Vert accmeasure units: Not Reported Vertcollection method: Not Reported

Vert coord refsys: Not Reported Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Magothy Aquifer Aquifer type: Not Reported

Construction date: Not Reported Welldepth:

Welldepth units: ft Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 0

133

Map ID Direction Distance

Elevation Database EDR ID Number

38 SW FED USGS USGS40000831284

1/2 - 1 Mile Lower

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404448073164101

Monloc name: S 66144. 1 Monloc type: Well

Monloc desc: Not Reported

02030202 Drainagearea value: Not Reported Huc code: Contrib drainagearea: Not Reported Drainagearea Units: Not Reported 40.7467651 Contrib drainagearea units: Not Reported Latitude: Longitude: -73.2776177 Sourcemap scale: 24000 Horiz Acc measure: Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: 55.0 Vert measure units: 55.0 Vert measure val: 0.1

Vert accmeasure units: feet

Vertcollection method: Level or other surveying method

Vert coord refsys: NGVD29 Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Magothy Aquifer Aquifer type: Not Reported

Construction date: Not Reported Welldepth: 143

Welldepth units: ft Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 14

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1994-03-24		38.83	1990-03-02		41.05
1983-03-09		35.95	1982-12-07		35.78
1982-09-14		36.81	1982-06-30		38.87
1982-03-12		38.27	1981-06-19		36.35
1980-12-12		37.39	1980-09-27		37.74
1980-08-06		39.72	1980-06-26		39.81
1980-03-07		37.17	1980-01-18		37.74

39 WSW FED USGS USGS40000831508 1/2 - 1 Mile Higher

Org. Identifier: USGS-NY

Formal name: USGS New York Water Science Center

Monloc Identifier: USGS-404510073165501

Monloc name: S 62720. 1

Monloc type: Well

Monloc desc: Not Reported

Huc code:02030202Drainagearea value:Not ReportedDrainagearea Units:Not ReportedContrib drainagearea:Not ReportedContrib drainagearea units:Not ReportedLatitude:40.7528762Longitude:-73.2815067Sourcemap scale:24000

TC3812742.2s Page A-38

Horiz Acc measure: 1 Horiz Acc measure units: seconds

Horiz Collection method: Interpolated from map

Horiz coord refsys: NAD83 Vert measure val: Not Reported Vert measure units: Not Reported Vertacc measure val: Not Reported

Vert accmeasure units: Not Reported Vertcollection method: Not Reported

Vert coord refsys: Not Reported Countrycode: US

Aquifername: Northern Atlantic Coastal Plain aquifer system

Formation type: Glacial Aquifer, Upper

Aquifer type: Not Reported

Construction date: Not Reported Welldepth: Not Reported Welldepth units: Not Reported Wellholedepth: Not Reported

Wellholedepth units: Not Reported

Ground-water levels, Number of Measurements: 2

 Feet below
 Feet to
 Feet below
 Feet to

 Date
 Surface
 Sealevel
 Date
 Surface
 Sealevel

 1994-03-15
 42.63
 1990-03-23
 45.38

AREA RADON INFORMATION

State Database: NY Radon

Radon Test Results

County	Town	Num Tests	Avg Result	Geo Mean	Max Result
SUFFOLK	BABYLON	49	1.07	0.76	5.5
SUFFOLK	BROOKHAVEN	117	1.61	1.22	7.5
SUFFOLK	E. HAMPTON	19	1.55	1.16	4.7
SUFFOLK	HUNTINGTON	146	2.13	1.47	22.2
SUFFOLK	ISLIP	61	1.19	0.74	10.4
SUFFOLK	NORTHPORT	4	1.43	1.12	2.5
SUFFOLK	RIVERHEAD	9	2.18	1.26	8.9
SUFFOLK	SHELTER ISLAND	1	1.1	1.1	1.1
SUFFOLK	SMITHTOWN	60	3.02	1.48	42.6
SUFFOLK	SOUTHAMPTON	24	0.99	0.8	2.8
SUFFOLK	SOUTHOLD	7	2.47	1.58	8.6

Federal EPA Radon Zone for SUFFOLK County: 3

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= $\overset{\cdot}{2}$ pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for SUFFOLK COUNTY, NY

Number of sites tested: 183

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L	
Living Area	0.670 pCi/L	100%	0%	0%	
Basement	1.010 pCi/L	98%	2%	0%	

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells

Source: New York Department of Health

Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database

Department of Environmental Conservation

Telephone: 518-402-8072

These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon Source: Department of Health Telephone: 518-402-7556 Radon Test Results

Area Radon Information Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency

(USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor

radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

Hubbard Power & Light

1600 5th Avenue Bay Shore, NY 11706

Inquiry Number: 3812742.4

December 17, 2013

EDR Historical Topographic Map Report



EDR Historical Topographic Map Report

Environmental Data Resources, Inc.s (EDR) Historical Topographic Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDRs Historical Topographic Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the early 1900s.

Thank you for your business.Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Historical Topographic Map





TARGET QUAD

NAME: NORTHPORT

MAP YEAR: 1903

SERIES: 15 SCALE: 1:62500 SITE NAME: Hubbard Power & Light

ADDRESS: 1600 5th Avenue

Bay Shore, NY 11706

LAT/LONG: 40.7557 / -73.263

CLIENT: Nobis Engineering, Inc.

CONTACT: Adam Roy
INQUIRY#: 3812742.4
RESEARCH DATE: 12/17/2013





TARGET QUAD NAME: ISLIP MAP YEAR: 1904

SERIES: 30

SCALE: 1:125000

SITE NAME: Hubbard Power & Light


ADDRESS: 1600 5th Avenue

Bay Shore, NY 11706

LAT/LONG: 40.7557 / -73.263

CLIENT: Nobis Engineering, Inc.

CONTACT: Adam Roy
INQUIRY#: 3812742.4
RESEARCH DATE: 12/17/2013

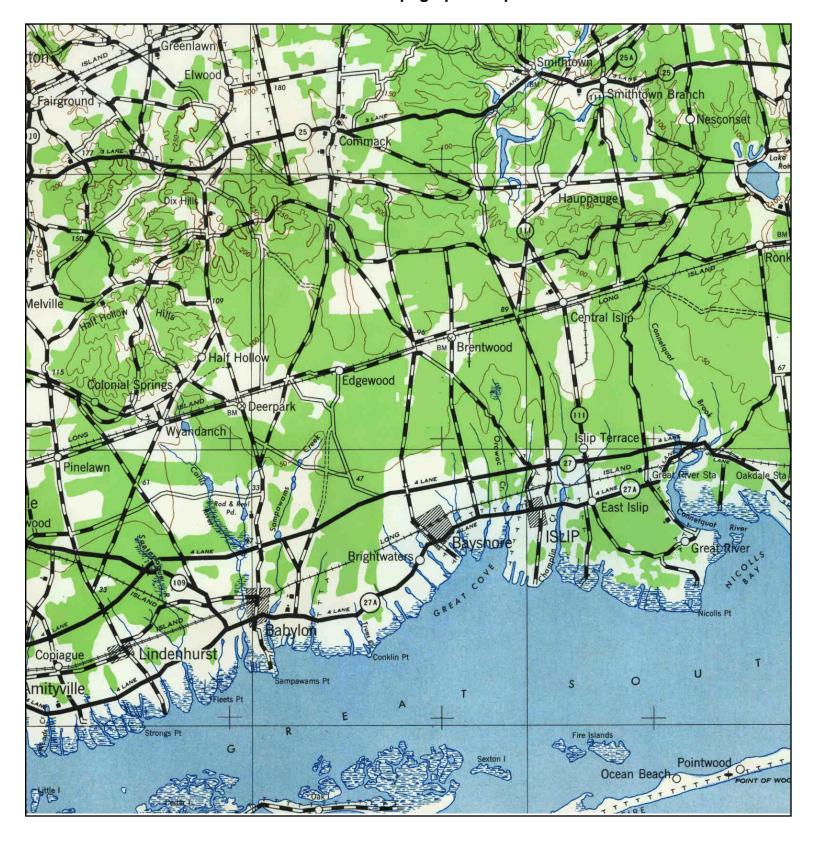

N M TARGET QUAD NAME: ISLIP MAP YEAR: 1942

SERIES: 30

SCALE: 1:125000

SITE NAME: Hubbard Power & Light


ADDRESS: 1600 5th Avenue

Bay Shore, NY 11706

LAT/LONG: 40.7557 / -73.263

CLIENT: Nobis Engineering, Inc.

CONTACT: Adam Roy INQUIRY#: 3812742.4 RESEARCH DATE: 12/17/2013

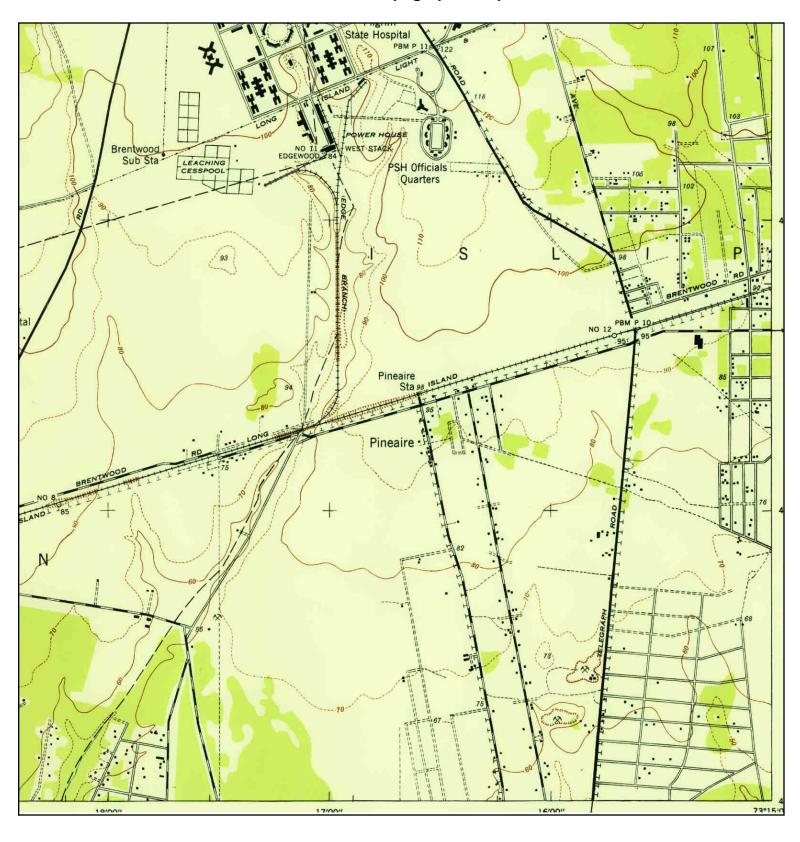



TARGET QUAD

NAME: GREENLAWN

MAP YEAR: 1943

SERIES: 7.5 SCALE: 1:24000 SITE NAME: Hubbard Power & Light


ADDRESS: 1600 5th Avenue

Bay Shore, NY 11706

LAT/LONG: 40.7557 / -73.263

CLIENT: Nobis Engineering, Inc.

CONTACT: Adam Roy INQUIRY#: 3812742.4 RESEARCH DATE: 12/17/2013

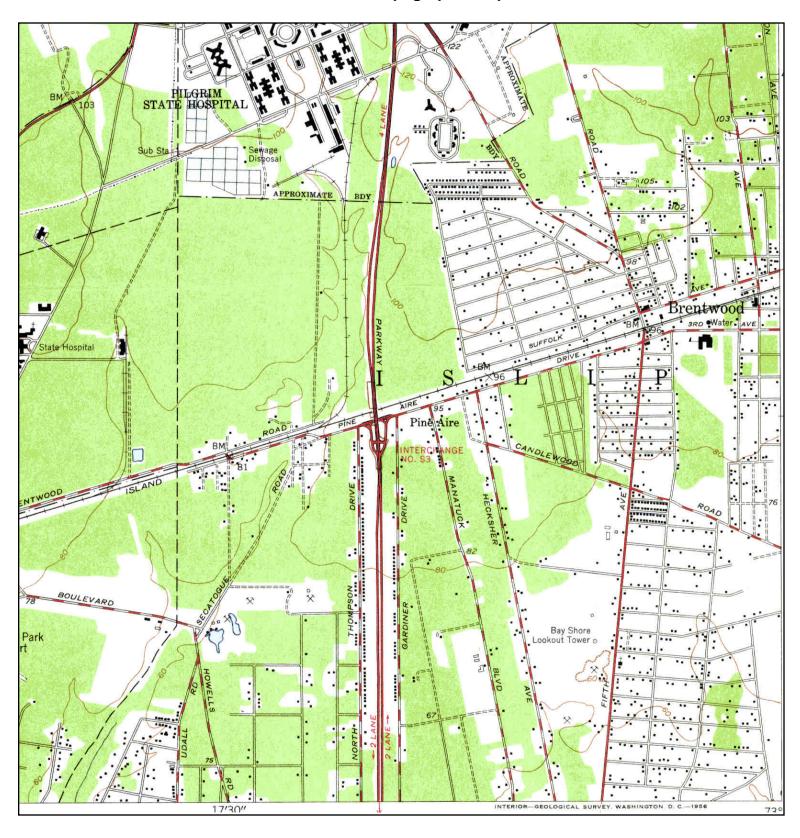



TARGET QUAD

NAME: GREENLAWN

MAP YEAR: 1954

SERIES: 7.5 SCALE: 1:24000 SITE NAME: Hubbard Power & Light


ADDRESS: 1600 5th Avenue

Bay Shore, NY 11706

LAT/LONG: 40.7557 / -73.263

CLIENT: Nobis Engineering, Inc.

CONTACT: Adam Roy INQUIRY#: 3812742.4 RESEARCH DATE: 12/17/2013

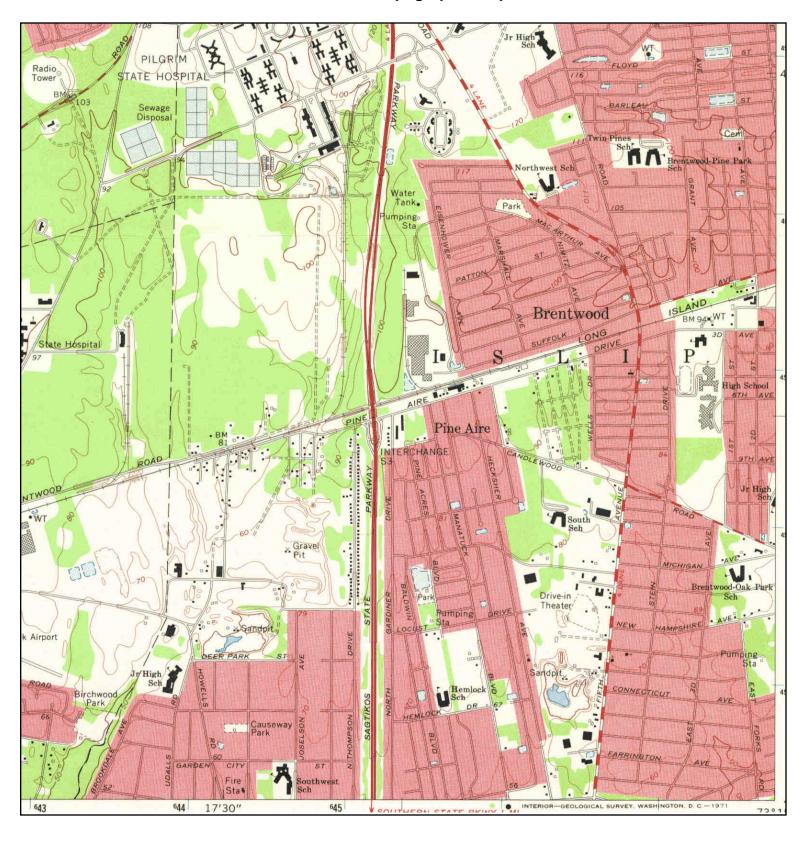



TARGET QUAD

NAME: GREENLAWN


MAP YEAR: 1967

SERIES: 7.5 SCALE: 1:24000 SITE NAME: Hubbard Power & Light

ADDRESS: 1600 5th Avenue

Bay Shore, NY 11706 LAT/LONG: 40.7557 / -73.263 CLIENT: Nobis Engineering, Inc.

CONTACT: Adam Roy INQUIRY#: 3812742.4 RESEARCH DATE: 12/17/2013

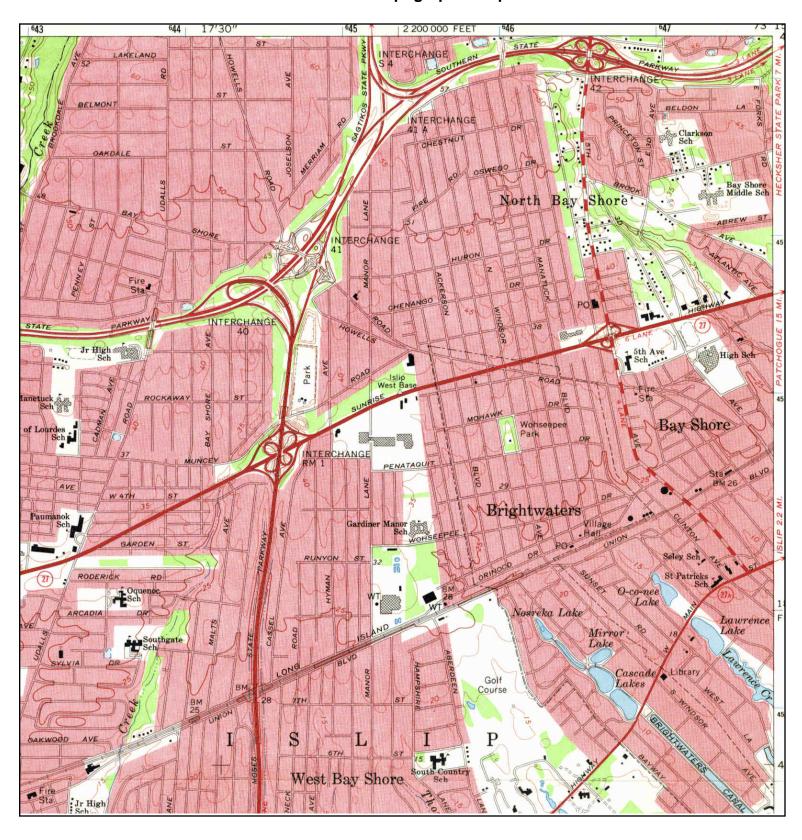

ADJOINING QUAD

NAME: BAY SHORE WEST

MAP YEAR: 1969


Ν

SERIES: 7.5 SCALE: 1:24000 SITE NAME: Hubbard Power & Light

ADDRESS: 1600 5th Avenue

Bay Shore, NY 11706 LAT/LONG: 40.7557 / -73.263 CLIENT: Nobis Engineering, Inc.

CONTACT: Adam Roy INQUIRY#: 3812742.4 RESEARCH DATE: 12/17/2013

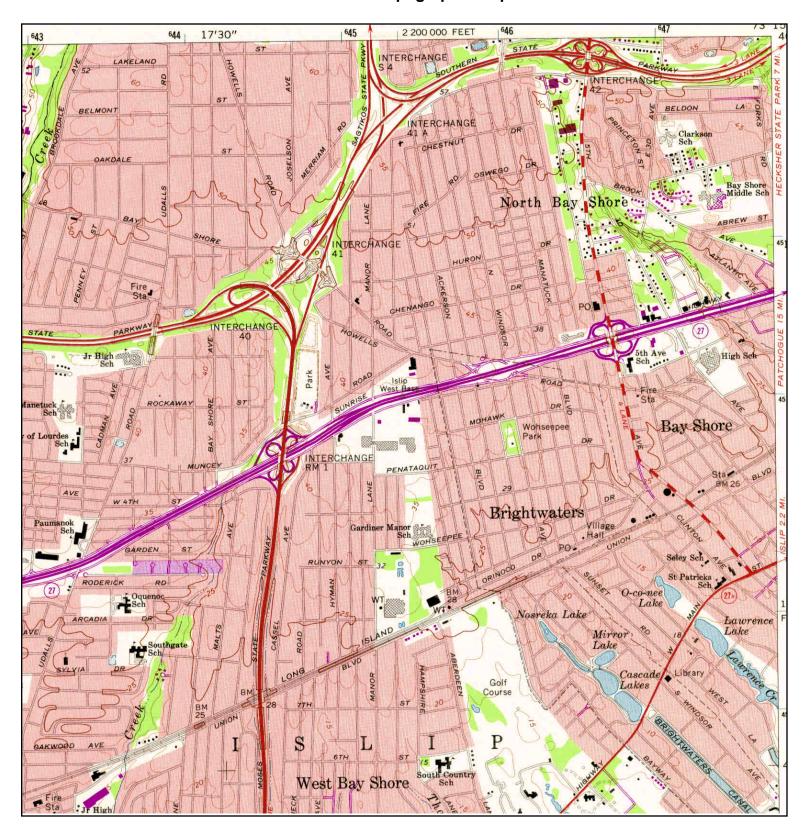

ADJOINING QUAD

NAME: BAY SHORE WEST

MAP YEAR: 1979

PHOTOREVISED FROM: 1969

SERIES: 7.5 SCALE: 1:24000 SITE NAME: Hubbard Power & Light

ADDRESS: 1600 5th Avenue

Bay Shore, NY 11706 LAT/LONG: 40.7557 / -73.263 CLIENT: Nobis Engineering, Inc.

CONTACT: Adam Roy INQUIRY#: 3812742.4

RESEARCH DATE: 12/17/2013

Hubbard Power & Light

1600 5th Avenue Bay Shore, NY 11706

Inquiry Number: 3812742.5

December 17, 2013

The EDR Aerial Photo Decade Package



EDR Aerial Photo Decade Package

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc., All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Date EDR Searched Historical Sources:

Aerial Photography December 17, 2013

Target Property:

1600 5th Avenue

Bay Shore, NY 11706

<u>Year</u>	<u>Scale</u>	<u>Details</u>	<u>Source</u>
1953	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/Flight Date: December 03, 1953	EDR
1957	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/Flight Date: March 25, 1957	EDR
1966	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/Flight Date: January 01, 1966	EDR
1969	Aerial Photograph. Scale: 1"=750'	Panel #: 40073-G3, Greenlawn, NY;/Flight Date: October 06, 1969	EDR
1976	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/Flight Date: January 01, 1976	EDR
1980	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/Flight Date: January 01, 1980	EDR
1994	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/DOQQ - acquisition dates: April 25, 1994	EDR
2006	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/Flight Year: 2006	EDR
2008	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/Flight Year: 2008	EDR
2009	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/Flight Year: 2009	EDR
2011	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G3, Greenlawn, NY;/Flight Year: 2011	EDR














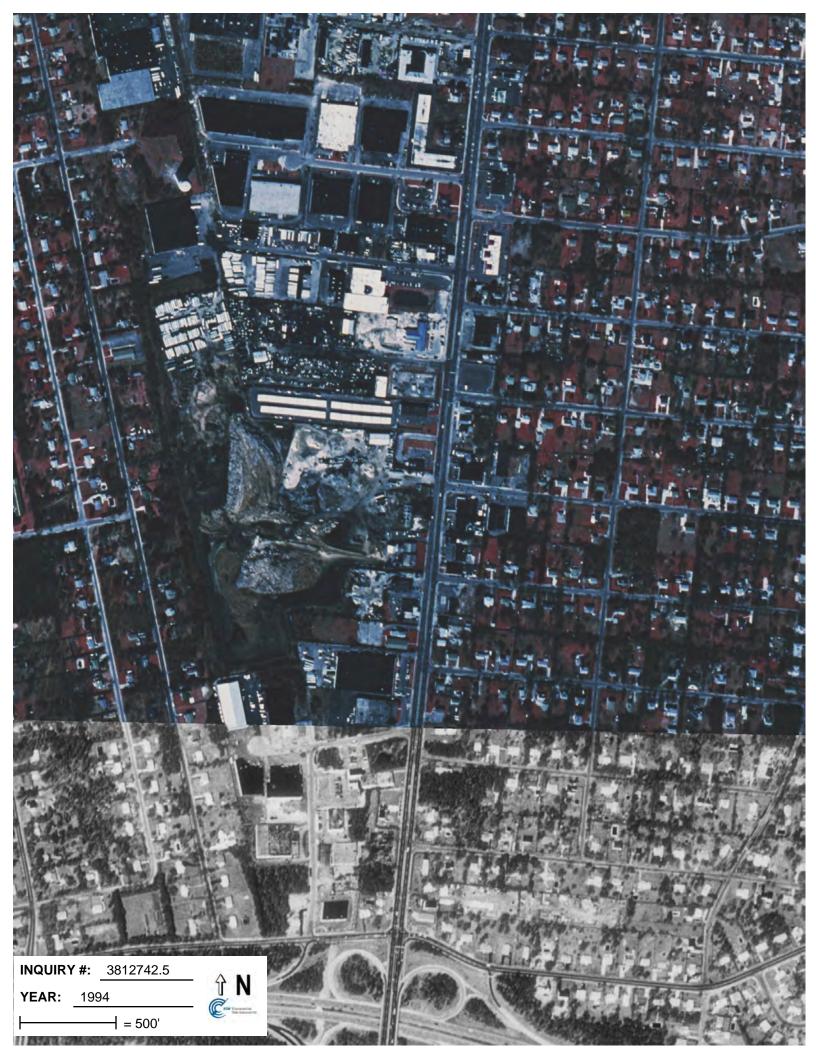









Hubbard Power & Light

1600 5th Avenue Bay Shore, NY 11706

Inquiry Number: 3812742.6

December 19, 2013

The EDR-City Directory Image Report



TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING. WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available city directory data at 5 year intervals.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

<u>Year</u>	Target Street	Cross Street	<u>Source</u>
2013	$\overline{\checkmark}$		Cole Information Services
2008	$\overline{\checkmark}$		Cole Information Services
2003	$\overline{\checkmark}$		Cole Information Services
1999	$\overline{\checkmark}$		Cole Information Services
1993	$\overline{\checkmark}$		Cole Criss-Cross Directory
1988	$\overline{\checkmark}$		Cole Criss-Cross Directory
1983	$\overline{\checkmark}$		Cole Criss-Cross Directory
1978	$\overline{\checkmark}$		Cole Criss-Cross Directory
1973	$\overline{\checkmark}$		Cole Criss-Cross Directory

RECORD SOURCES

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.

FINDINGS

TARGET PROPERTY STREET

1600 5th Avenue Bay Shore, NY 11706

<u>Year</u>	CD Image	<u>Source</u>
5TH AVE		
2013	pg A1	Cole Information Services
2008	pg A3	Cole Information Services
2003	pg A5	Cole Information Services
1999	pg A7	Cole Information Services
1993	pg A8	Cole Criss-Cross Directory
1988	pg A9	Cole Criss-Cross Directory
1983	pg A10	Cole Criss-Cross Directory
1978	pg A11	Cole Criss-Cross Directory
1973	pg A12	Cole Criss-Cross Directory

3812742-6 Page 2

FINDINGS

CROSS STREETS

No Cross Streets Identified

3812742-6 Page 3



Cross Street

Target Street <u>Source</u> Cole Information Services

1557	JNC WIRELESS COMMUNICATION INC
	USA INDUSTRIES
1560 1564	FIRST SPANISH BAPTIST CHURCH OF BAY
1569	LUIS ARQUIZA
1509	GEORGE FUENTES
1571	5TH AV BEAUTY SALON
1372	ALCOHOLICS ANONYMOUS
	ALL DAY EMERGENCY LOCKSMITH
	AMERICANA DRY CLEANERS
	DAVE & DAVE AUTOMOTIVE SOUND & SEC
	NATIONAL REALTY SERVICES
	PRESTIGE
	ROYAL PRESTIGE AYANIM
	THE INTERGROUPO
1573	LA SALON UNISEX SPA
1575	ARGUETA EXPRESS INTERNATIONAL CURRIE
1070	ELISA ACEVEDO
	JJS BARBER SHOP
	METROPCS
	PENSKE TRUCK RENTAL
	SHOWTIME FASHION
1579	CHAPIN TIRES
	SARAMY FASHION CORP
1580	EDWARDS K P MATERIALS
1581	POLLO SALSERO INC
1582	RUSSELL MCALLISTER
1583	PUEBLO GROCERY
1585	PIZZA INC
1591	RANGER TIRES
1601	AAA PIANO TUNING SVCE
1608	5 AVENUE LUBE INC
	FIFTH AVE CAR WASH
1611	IRMA AREVALO
1612	HUBBARDS CUBBARDS MINISTORAGE
	NORTHEAST LAND IMPROVEMENT INC
	NORTHEAST RECYCLING
	Z B T INCORPORATED
4044	ZOROCK INTERNATIONAL
1614	FIFTH AV SELF STORAGE
4045	UHAUL NEIGHBORHOOD DEALER
1615	SABOR GUANACO
4047	SALSA Y CONTROL
1617	TROPICAL MARKET
1625 1630	IGLESIA DE DIOS PENTECOSTAL COUNTY OF SUFFOLK
1030	
1631	SUFFOLK COUNTY OFFICES & INSTITUTION CHRIS & CHRIS INCORPORATION
1031	V & C AUTO CENTER
1635	ALL PHASE PROPERTY DEVELOPMENT CORP
1000	REICH & TANG ASSET MANAGEMENT
	ACION & TARO AGOET WAR AGENTERY

<u>Target Street</u> <u>Cross Street</u> <u>Source</u>

✓ - Cole Information Services

5TH AVE 2013 (Cont'd)

		5TH AVE	2013	(Cont'd)	
	1636	CRAZY ALS LIQUIDATORS			
		RANGER TIRES			
	1640	TELEDATA COMMUNICATION AUTO MUFFLER CENTER INC			
	1040	OCCUPANT UNKNOWN			
	1644	5TH AV FURNITURE WAREHOUSE			
	1645	SALVADOR BARBER SHOP			
	1647	R & J SEXY NAIL SAL SUNRISE MEDICAL LABORATORIES			
		TAXEGUROS			
		YVETTE KORELL NATIONWIDE INSURA	NCE		
1					

Cross Street

Target Street

Source

Cole Information Services

1557	GONZALEZ UMBERTO
	PROGRESSIVE INSURANCE AGENCY
1560	FOUR STAR ASSOCIATES INC
4=00	U S A INDUSTRIES INC
1568	FIRST SPANISH BAPTIST CHURCH
1571	PATRICK ROMAN
1572	5TH AV BEAUTY SALON
	DAVE & DAVE AUTOMOTIVE SOUND & SECUR GOLDEN HOMES REALTY
	SUGEY MOTA
1575	ARGUETA EXPRESS
1373	ARGUETA EXPINESS ARGUETA EXRSS INTERNATIONAL COUR
	CRAFT HERNANDEZ
1579	MACHITO COMMUNICATION MUSIC CENTER
1580	EDWARDS K P MATERIALS
	KENNETH P EDWARDS INC
1581	PUNTO FABALOSO
	RESTAURANT POLLA A LA BRAZA
1582	RUSSELL MCALLISTER
1583	LATINO MIX DELI & PIZZERIA CORP
	PUEBLO GROCERY
1585	LATINO MIX
4507	PUNTO SABROSO
1587	HOME MARKET REALTY
1001	JIL UNLIMITED INC
1601 1608	CHRISTIAN CLOTHING OF AMERICA INC 5 AVENUE LUBE INC
1000	FIFTH AVENUE CAR WASH
1609	BERTA VILLEGA
1611	IRMA AREVALO
1612	HUBBARD SAND & GRAVEL
	NORTHEAST LAND IMPROVEMENT INC
	NORTHEAST RECYCLING
	T ZB INC
	Z B T INC
	ZOROCK INTERNATIONAL
1617	CLOUD NINE PRODUCTIONS
	LA TROPICAL MARKET
1625	PENTECOSTAL CHURCH OF GOD
1631	CHRISTIAN ROAD RUNNER TIRE SERVICE
1605	V & C AUTO CENTER
1635 1636	GUIDE PROFESSIONAL SERVICES ROBS CANDY & SUNDRIES INC
1030	TELEMECHANICS
1639	7 ELEVEN INC
1640	AUTO MUFFLER CENTER INC
	OCCUPANT UNKNOWN
1644	5 STAR FURNITURE INC
	IMAN WORLDWIDE ENTERPRISE INC
1645	SALVADOR BARBER SHOP

Target Street Cross Street Source
✓ - Cole Information Services

5TH AVE 2008 (Cont'd)

1647	LUS SEXY NAIL SALON

Cross Street

Target Street Source Cole Information Services

1557	ANCEL VIICA
1557	ANGEL YUCA
	E BORJAS EVARISTO PORTILLO
	INKA EXPRESS COURIER
	JOSE SALGADO
	M JIMENEZ
1560	174 RTE 111 LLC
1560	UNITED STRTRS ALTRNTRS INDS
	VINCENT TRAPANI
1561	OCCUPANT UNKNOWN
1564 1565	ONE MOE SIGN
1568	JORGE MALDONADO
1569	VICTOR MONROY
1571 1572	ANTHONY CRUZ DINORAH BEAUTY SALON
1572	
	TAXI LAS AMERICAS WILLIAM VAZQUEZ
1573	MAGDO TAILOR & ALTERATIONS
15/3	OCCUPANT UNKNOWN
4575	
1575	HERTZ PENSKE TRUCK RENTAL TELE FUTURA CMNCTN WRLDWD
4.570	
1579	MACHITO CMNCTN MUSIC CTR
	OCCUPANT UNKNOWN POMAS TIRE CTR INC
4500	TAXI MORAZAN
1580	EDWARDS K P MATERIALS OCCUPANT UNKNOWN
1500	
1582 1583	RUSSELL MCALLISTER OCCUPANT UNKNOWN
1503	PUEBLO GROCERY
1585	PUNTO SABROSO
1587	BRENDA REYES
1307	CARLOS A CRUZ
	JUMAJOVI INSURANCE AGENCY
1591	AMERICAN SIGNCRAFTERS
1591	INTERSTATE SIGNCRAFTERS INC
	OCCUPANT UNKNOWN
	TJ SIGN INC
	TJ SIGNS UNLIMITED INC
1601	AAA PIANO TUNING SERVICE
1001	CHRISTIAN CLOTHING OF AMERICA INC
	EL SHADAI CHRISTIAN BOOK STORE
4000	OCCUPANT UNKNOWN
1608	5 AVENUE LUBE INC
4600	FIFTH AVE CAR WASH
1609	JAIME TELLADO
1612	HUBBARD SAND & GRAVEL CORP
	NORTHEAST RECYCLING
4044	OCCUPANT UNKNOWN
1614	ANA MARTINEZ

<u>Target Street</u> <u>Cross Street</u> <u>Source</u>

✓ - Cole Information Services

5TH AVE 2003 (Cont'd)

1614	ANNAMARIE HESS
	CLIFFORD STEWARD
	DIANA MONTERO
	FIFTH AVENUE SELF STORAGE
	JENNIFER COTIER
	KENNETH MCCAFFREY
	U HAUL CO
	WILLIAM KLEIN
1615	BAY SHORE ESTADIO RESTAURANT INC
	ESTADIO RESTAURANT
	OCCUPANT UNKNOWN
1617	ANA MALDONADO
	JESENIA PAGAN
	LA TROPICAL MARKET
	LATROPICAL MARKET
1625	DEDIOS INGLESIA
	ILGESIA DEDIOS PENTECOSTAL M I
1629	JASON HALL
1630	OCCUPANT UNKNOWN
1631	BAY SHORE AUTO SPRINGS & WHEEL
	CHRISTIAN ROAD RNR TIRE SRVC
	FRIENDLY MUFFLER & EXHST SYSTM INC
	OCCUPANT UNKNOWN
1635	M BOWMAN
1636	AMERICAN DATA LEASING
	OCCUPANT UNKNOWN
	TELEDATA COMMUNICATIONS INC
	TELEMECHANICS INC
1640	RAFAELS HOUSE OF FADES
1644	OCCUPANT UNKNOWN
1645	OCCUPANT UNKNOWN
1017	SALVADOR BARBER SHOP
1647	OCCUPANT UNKNOWN
	SUNRISE MEDICAL LABS

<u>Cross Street</u> <u>Source</u>

Cole Information Services

5TH AVE 1999

Target Street

1557	PROGRESSIVE INSURANCE AGENCY
1560	FOUR STAR ASSOCIATES INCORPORATED
1568	FIRST SPANISH BAPTIST CHURCH OF BAY SHORE
	OCCUPANT UNKNOWN
1572	AMERICANA LAUNDROMAT
	CANAAN INSURANCE
1573	MAGDO TAILOR & ALTERATIONS
1575	HERTZ PENSKE TRUCK RENTAL
1579	POMAS TIRE CENTER INCORPORATED
1580	EDWARDS K P MATERIALS
	OCCUPANT UNKNOWN
1583	PUEBLO GROCERY
1587	JIL UNLIMITED
1591	AMERICAN SIGNCRAFTERS
	T J SIGNS UNLIMITED INCORPORATED
1601	AAA PIANO TUNING SVCE
	CLUB BIRTHDAY PARTY
1608	FIFTH AVE CAR WASH
1609	SOUTH SHORE AUTO PARTS
1612	HUBBARDS CUBBARDS MINI STORAGE
	SALVAGE RECOVERY SYSTEMS
1614	FIFTH AVENUE SELF STORAGE
1615	KURBANALI LIQUOR STORE
1617	LATROPICAL MARKET
1631	BAY SHORE SPRING COMPANY INCORPORATED
	CHRISTIANSS READ RUNNER TIRE SERVICE
1000	FRIENDLY MUFFLER & EXHAUST SYSTEMS INCORPORATED
1636	AMERICAN DATA LEASING COMPANY COMPANY
	TELEDATA COMMUNICATIONS
4000	TELEMECHANICS INCORPORATED
1639	KUT KING
	KUT KINGS
	OCCUPANT UNKNOWN
4040	PACKAGING PLUS
1640	HOUSE OF FADES
	RAFAELS HOUSE OF FADES
1647	SALS AUTO GENERAL PRACTITIONERS
1047	HOME TASTE CHINESE KITCHEN
	OCCUPANT UNKNOWN
	PELLIN JUAN CARLOS MD
	I LELIN JUAN CANLOG IVID

8	H 854-0
St Employment	
* St Unempimnt Ins	81 666-0
a seas M. J. M. D. J. I.	86 666-74
* St Unemplmnt Ins	H 666-33
0 B McGinn	90 666-04
8 * Fifth Av Nursry	665-05
8 * Fifth Ave Paving	84 666-12
* Patrick J Moore	75 0 665 - 05
7 1525 Christopher Meyer	H 666-68
0 Patrick Moore	89 • 968 - 78
5 1527 M Merced	81 665-62
1529 Vicente Perez	91 968-46
1 1549 Carlos Avili	91 665-56
5 * A&L Envrnt Svs	90 665-00
9 1550 * Blank Drug	70 665-47
* Ken Art US Corp	91 665-65
5 1557 * Alma RI Est Cosits * Valdas Duoba Aty	11 666-32
→ Valdas Duoba Aty	79 271-43
7 1560 * Direct Mrking Cmpt	90 666-83
* Four Star Assocs	87 968-41
4 1568 * First Spnsh Bpt Ch	665-07
1 * First Spansh Bptst	72 666-95
1569 Bernardo Gonzalez	H 968-69
7 Jose Gonzalez 1571 Anthony Cruz	91 666-30
1571 Anthony Cruz	89 968-76
4 1572 William Vazquez	80 -000 -08
A A I Travel Corn	89 665_52
3 * Americana Laudromt	81 665-96
9 * Rosa Clothing	89 665-93
15/3 * Stock&Barrel Sprtg	81 665-73
1575 * Hertz Penske Rentl	86 666-88
5 1579 * P&O Tires	90 665-92
5 1579-81 * Goodies	91 968-41
5 1580 John Fazio	85 665-25
4 * Parkway Ready Mix	76 665-87
5 1579 * P&O Tires	90 968-95
1585★ Myrties Bty Salon	665-95
1585 * Myrties Bty Salon	91 968-95
7 David Navarro	85 665-59
0 1591 * Landmark Signs	91 585-30
1 * T J Signs Unlmtd	88 968-68
0 1600 * Hubbard Power&Lght	90 665-14
1 1603 Rene Funes	H 968-62
8 1608 * Otto Gilbert	四 968-75
5 1609 Jose R Rodriguez	H 665-54
5 * South Shr Auto Prt	74 666-41
1611 NP	
8 1612 * Hubbard Enterprise	82 666-49
4 * Hubbard Snd&Grvel	665-11
0 * Hubbards Cubbards	85 0 665-1
0 1614 * Fifth Av SIf Strg	87 665-3
	73 666-3
0 1615 E Guanill * Kurbanali Lgr Str 1617 * Latropical Market 1625 * Ilgesia De Dios Pn	83 666-1
5 1617 * Latropical Market	71 665-1
1 1625★ Ilgesia De Dios Pn	82 666-7
1630 + Bi Co Constr Corn	H 968-6
5 1631 * Bay Shr Ato Algamt .	666-7
* Bay Shore Spring	75 0 666 - 7
8 * Frindly Muffler&Exh	88 968-0
8 * Frndly Muffler&Exh 6 1635 M Bowman John Justice	83 435-8
6 1635 M Bowman	76 231-4
1636★ Amer Data Leasing	91 231-3
5 * Telemechanics	84 @ 231 - 3
5 * Telemechanics	H 231 1
* Natl Rent To Buy	- 969
6 Packaging Plus	91 272
6 * Packaging Plus * Progressy Ins Agcy * Rosas Clothing	17 221
Rosas Clothing	H 434
1639-8 * El Criollo Rstrnt	H 435-
6 1640 × CMS Twng&Auto Rpr	01 435-
6 1640 * CMS Twng&Auto Rpr .	91 434-
1 1641	
1 1641	90 272
1 1641 NP	80 273
1 1641 1644 * ELS Mfg	BLISHER
1 1641 * ELS Mfg	80 273 BLISHER

Cole Criss-Cross Directory

1460		• • • • • • • • • • • • • • • • • • • •			
1603	Т	1460		ND	COL
1603		1464 ×	Dr Abul Fazal	74	968-8990
1603	П	1465	Vilne Sehestven	NP 86	666-3839
1603		1484	Thos devestion	NP	000-0000
1603		1500	William F Keller	. 83	665-0886
1603	Н	1508×	Power Test Mini Mt	. 85	665-8260
1603		*	U-Haul Co	86	665-2327
1603	П	1510*	John P Tilden Ltd	84	666-7232
1603	П	*	R A McGuire Assocs	.77	666-9300
1603		*	William Steel Ins .	80	666-9300
1603	П	*	St Employment St Unemplymt No 66	81	666-0206 666-7480
1603	П	1521★	Fifth Av Nursry		665-0530
1603	1		Patrick J Moore	75	665-0530
1603		1525	M Merced	81	665-6296
1603		1529	Juan Gonzalez	84	665-5780
1603		1550×	Blank Drug	70	665-4717
1603	1	1557×	A Carlos Cruz Aty	79	968-5454
1603	П	*	Valdas Duoba Aty .	79	968 - 5454
1603		*	M S Probert Aty .	86	968-5572
1603		*	C Tomasello Aty	86 H	968-5572
1603		1560 ±	AAA Direct Mail .	п	968-4100
1603		*	Four Star Assocs	н	968-4100
1603	П	1568*	First Spansh Bpt Ch	. 72	665-0253 666-9567
1603		1569	Miguel Fuentes	п	968-8429
1603			A Tejeda	86	666-6125
1603	1	1571	Gracio Fuentes Margie Fuentes	61	666-8408
1603	1	1572★	Americana Laudromt	.81	665-9658
1603	П	1573×	Margal Lingerie	82	665-0245
1603	П	1575*	Stock&Barrel Sprtg Hertz Penske Rentl	81	665-7310 666-8868
1603	П	1580	Re&J Garage Inc .		666-8880
1603	П	#	Parkway Readymix	76	665-8794
1603	П	1582*	Leo Fuel Oil Inc	83	666-1117
1603	1	1583 * 1585 *	Dinorahs Prof Hr C	п	665-6817
1603	1	1587*	Jil Unlimited	85	665-5900
1603	П	1591	Carmen Navario	NP H	655-7129
1603	П	1595 *	A-1 Cirksn Trk Rpr A-1 Fmly Myng&Stra	84	665-8555
* Latropical Market 71 665-1248 1625* ligesia De Dios Pn 82 666-7901 1631* Bay Shr Ato Algnmt 666-7473 * Bay Shore Co Inc . 75 666-7473 1635 M Bowman 83 435-8593 John Justice 76 231-4789 1636* Telemechanics 84 231-3833 1637* BNA Tires 273-2622 1640* Li Portugs Amr Clb 86 273-3368 * Rosados Auto Body 77 435-1794 1641 1644 ELS Mfg 80 273-2652 * ELS Mfg Inc 80 273-2652 * LS Mfg Inc 80 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 83 273-2652 * Pine Aire Outlet 80 273-2652 * Pine Aire Outlet 80 273-2652 * Medcl Exercs Pres 84 231-4848 * Dr R A Morton 74 231-4848 * Dr J C Pellin 75 231-4848 * Dr J C Pellin 75 231-4848 A * Li Insurance 231-5666 1649* Ruivo Deli 82 231-5666 1651* Los Immortales 86 273-5926 1650* Bank of Long Islnd 669-3600 1651* Los Immortales 85 273-5926 1654* Binyan Realty 82 273-0440 * Pituach Constr 82 273-0440	П	1601*	USA Bedding	86	968-8777
* Latropical Market 71 665-1248 1625* ligesia De Dios Pn 82 666-7901 1631* Bay Shr Ato Algnmt 666-7473 * Bay Shore Co Inc . 75 666-7473 1635 M Bowman 83 435-8593 John Justice 76 231-4789 1636* Telemechanics 84 231-3833 1637* BNA Tires 273-2622 1640* Li Portugs Amr Clb 86 273-3368 * Rosados Auto Body 77 435-1794 1641 1644 ELS Mfg 80 273-2652 * ELS Mfg Inc 80 273-2652 * LS Mfg Inc 80 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 83 273-2652 * Pine Aire Outlet 80 273-2652 * Pine Aire Outlet 80 273-2652 * Medcl Exercs Pres 84 231-4848 * Dr R A Morton 74 231-4848 * Dr J C Pellin 75 231-4848 * Dr J C Pellin 75 231-4848 A * Li Insurance 231-5666 1649* Ruivo Deli 82 231-5666 1651* Los Immortales 86 273-5926 1650* Bank of Long Islnd 669-3600 1651* Los Immortales 85 273-5926 1654* Binyan Realty 82 273-0440 * Pituach Constr 82 273-0440	П	1609	A Ortiz	85	665-1069
* Latropical Market 71 665-1248 1625* ligesia De Dios Pn 82 666-7901 1631* Bay Shr Ato Algnmt 666-7473 * Bay Shore Co Inc . 75 666-7473 1635 M Bowman 83 435-8593 John Justice 76 231-4789 1636* Telemechanics 84 231-3833 1637* BNA Tires 273-2622 1640* Li Portugs Amr Clb 86 273-3368 * Rosados Auto Body 77 435-1794 1641 1644 ELS Mfg 80 273-2652 * ELS Mfg Inc 80 273-2652 * LS Mfg Inc 80 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 83 273-2652 * Pine Aire Outlet 80 273-2652 * Pine Aire Outlet 80 273-2652 * Medcl Exercs Pres 84 231-4848 * Dr R A Morton 74 231-4848 * Dr J C Pellin 75 231-4848 * Dr J C Pellin 75 231-4848 A * Li Insurance 231-5666 1649* Ruivo Deli 82 231-5666 1651* Los Immortales 86 273-5926 1650* Bank of Long Islnd 669-3600 1651* Los Immortales 85 273-5926 1654* Binyan Realty 82 273-0440 * Pituach Constr 82 273-0440	П	1611	South Shr Auto Prt Raphael Rodriguez	74	666-4343 666-1986
* Latropical Market 71 665-1248 1625* ligesia De Dios Pn 82 666-7901 1631* Bay Shr Ato Algnmt 666-7473 * Bay Shore Co Inc . 75 666-7473 1635 M Bowman 83 435-8593 John Justice 76 231-4789 1636* Telemechanics 84 231-3833 1637* BNA Tires 273-2622 1640* Li Portugs Amr Clb 86 273-3368 * Rosados Auto Body 77 435-1794 1641 1644 ELS Mfg 80 273-2652 * ELS Mfg Inc 80 273-2652 * LS Mfg Inc 80 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 83 273-2652 * Pine Aire Outlet 80 273-2652 * Pine Aire Outlet 80 273-2652 * Medcl Exercs Pres 84 231-4848 * Dr R A Morton 74 231-4848 * Dr J C Pellin 75 231-4848 * Dr J C Pellin 75 231-4848 A * Li Insurance 231-5666 1649* Ruivo Deli 82 231-5666 1651* Los Immortales 86 273-5926 1650* Bank of Long Islnd 669-3600 1651* Los Immortales 85 273-5926 1654* Binyan Realty 82 273-0440 * Pituach Constr 82 273-0440	П	1612±	Hubbard Enterprise	82	666-4550
* Latropical Market 71 665-1248 1625* ligesia De Dios Pn 82 666-7901 1631* Bay Shr Ato Algnmt 666-7473 * Bay Shore Co Inc . 75 666-7473 1635 M Bowman 83 435-8593 John Justice 76 231-4789 1636* Telemechanics 84 231-3833 1637* BNA Tires 273-2622 1640* Li Portugs Amr Clb 86 273-3368 * Rosados Auto Body 77 435-1794 1641 1644 ELS Mfg 80 273-2652 * ELS Mfg Inc 80 273-2652 * LS Mfg Inc 80 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 83 273-2652 * Pine Aire Outlet 80 273-2652 * Pine Aire Outlet 80 273-2652 * Medcl Exercs Pres 84 231-4848 * Dr R A Morton 74 231-4848 * Dr J C Pellin 75 231-4848 * Dr J C Pellin 75 231-4848 A * Li Insurance 231-5666 1649* Ruivo Deli 82 231-5666 1651* Los Immortales 86 273-5926 1650* Bank of Long Islnd 669-3600 1651* Los Immortales 85 273-5926 1654* Binyan Realty 82 273-0440 * Pituach Constr 82 273-0440	П	*	Hubbards Cubbards	85	665-1005
* Latropical Market 71 665-1248 1625* ligesia De Dios Pn 82 666-7901 1631* Bay Shr Ato Algnmt 666-7473 * Bay Shore Co Inc . 75 666-7473 1635 M Bowman 83 435-8593 John Justice 76 231-4789 1636* Telemechanics 84 231-3833 1637* BNA Tires 273-2622 1640* Li Portugs Amr Clb 86 273-3368 * Rosados Auto Body 77 435-1794 1641 1644 ELS Mfg 80 273-2652 * ELS Mfg Inc 80 273-2652 * LS Mfg Inc 80 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 83 273-2652 * Pine Aire Outlet 80 273-2652 * Pine Aire Outlet 80 273-2652 * Medcl Exercs Pres 84 231-4848 * Dr R A Morton 74 231-4848 * Dr J C Pellin 75 231-4848 * Dr J C Pellin 75 231-4848 A * Li Insurance 231-5666 1649* Ruivo Deli 82 231-5666 1651* Los Immortales 86 273-5926 1650* Bank of Long Islnd 669-3600 1651* Los Immortales 85 273-5926 1654* Binyan Realty 82 273-0440 * Pituach Constr 82 273-0440	П	1614*	Leszlos Car Wash . 5th Av Self Storg	. п	665 - 0597 665 - 3335
* Latropical Market 71 665-1248 1625* ligesia De Dios Pn 82 666-7901 1631* Bay Shr Ato Algnmt 666-7473 * Bay Shore Co Inc . 75 666-7473 1635 M Bowman 83 435-8593 John Justice 76 231-4789 1636* Telemechanics 84 231-3833 1637* BNA Tires 273-2622 1640* Li Portugs Amr Clb 86 273-3368 * Rosados Auto Body 77 435-1794 1641 1644 ELS Mfg 80 273-2652 * ELS Mfg Inc 80 273-2652 * LS Mfg Inc 80 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 83 273-2652 * Pine Aire Outlet 80 273-2652 * Pine Aire Outlet 80 273-2652 * Medcl Exercs Pres 84 231-4848 * Dr R A Morton 74 231-4848 * Dr J C Pellin 75 231-4848 * Dr J C Pellin 75 231-4848 A * Li Insurance 231-5666 1649* Ruivo Deli 82 231-5666 1651* Los Immortales 86 273-5926 1650* Bank of Long Islnd 669-3600 1651* Los Immortales 85 273-5926 1654* Binyan Realty 82 273-0440 * Pituach Constr 82 273-0440	И	1615*	Chomatics Graphics	п	666-0008
* Latropical Market 71 665-1248 1625* ligesia De Dios Pn 82 666-7901 1631* Bay Shr Ato Algnmt 666-7473 * Bay Shore Co Inc . 75 666-7473 1635 M Bowman 83 435-8593 John Justice 76 231-4789 1636* Telemechanics 84 231-3833 1637* BNA Tires 273-2622 1640* Li Portugs Amr Clb 86 273-3368 * Rosados Auto Body 77 435-1794 1641 1644 ELS Mfg 80 273-2652 * ELS Mfg Inc 80 273-2652 * LS Mfg Inc 80 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 83 273-2652 * Pine Aire Outlet 80 273-2652 * Pine Aire Outlet 80 273-2652 * Medcl Exercs Pres 84 231-4848 * Dr R A Morton 74 231-4848 * Dr J C Pellin 75 231-4848 * Dr J C Pellin 75 231-4848 A * Li Insurance 231-5666 1649* Ruivo Deli 82 231-5666 1651* Los Immortales 86 273-5926 1650* Bank of Long Islnd 669-3600 1651* Los Immortales 85 273-5926 1654* Binyan Realty 82 273-0440 * Pituach Constr 82 273-0440	П	*	Olmeda Liquor Str	83	666-1555
Bay Shr At O Algomit **Bay Shr At O Algomit** 1635	П	1617	L Carrasquillo	78	665-6133 665-1248
Bay Shr At O Algomit **Bay Shr At O Algomit** 1635	П	1625*	Ilgesia De Dios Pn	82	666-7901
1635 M. Bowman 83 435-8593 John Justice 76 231-4889 1636 * Telemechanics 84 231-3833 1637 * BNA Tires 273-2622 1640 * LI Portugs Amr Clb 86 273-3368 * Rosados Auto Body 77 435-1794 1641 NP 1644 * ELS Mfg 80 273-2652 * LS Mfg Inc 80 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 83 273-2652 * Jo-Mat Sportswear 80 273-4664 * Lesters Pres 84 231-4848 * Dr R A Morton 74 231-4848 * Dr R A Morton 75 231-4848 A * Lil Insurance 231-5666 1649 * Ruivo Deli 82 231-9562 1650 * Bank of Long Islnd 669-3600 1651 * Los Immortales 86 273-5926 1653 * Fernandes & Sons 83 273-3260 1654 * Binyan Realty 82 273-0440 * Pituach Constr 83 273-0440 * Pituach Constr 84 273-0440 * Pituach Constr 84 2	П	1031×	Bay Shore Co Inc .	75	666-7473
1036 × 1elemechanics	П	1635	M Bowman	83	435-8593
1640 * LI Portugs Amr Clb	П	1636*	Telemechanics	84	231-3833
1644 ★ ELS Mfg	П	1640+	LI Destres Ass Cit	0.0	273 2260
1644 ★ ELS Mfg	П	1641	Rosados Auto Body	77 NP	435-1794
* Jo-Mat Sportswear 83 273 - 2652 * Pine Aire Outlet 80 273 - 2652 * Pine Aire Outlet 80 273 - 2652 * Easty Driv Schl 85 435 - 4664 * Easty Driv Schl 85 435 - 4664 * Medel Exercs Pres 84 231 - 4848 * Dr R A Morton 74 231 - 4848 * Dr B C Pellin 75 231 - 4848 A * Fatima Travel Inc 84 231 - 3646 A * Lil Insurance 231 - 5666 1649 * Raivo Deli 82 231 - 9552 1650 * Bank of Long Islnd 669 - 3600 1651 * Los Immortales 86 273 - 5926 1653 * Fernandes&Sons 83 273 - 3260 1654 * Binyan Realty 82 273 - 0440 * Pituach Constr 82 273 - 0440 * Ross Realty Inc 231 - 4070 * Scrty SH-Strge 83 231 - 4070 1659 Victor Rivera 82 273 - 3614 Josephine Arroyo 1434 - 4779 Zoila Cruz 1434 - 1473		1644×	ELS Mfg	80	273 - 2652
* Pine Aire Outlet 80 273-2652 1647 * E-Z Driving Schol 85 435-4664		*	Jo-Mat Sportswear	83	273-2652
* Easty Driv Schl	П	1647*	Pine Aire Outlet . E-Z Driving Schol .	80	273 - 2652 435 - 4664
* Dr R A Morton	ı	*	Easty Driv Schl	85	435-4664
* Dr J C Pellin	П	*	Dr R A Morton	74	231-4848
A ★ Lil Insurance		*	Dr J C Pellin ★ Fatima Travel Inc.	75	231-4848
1650 ★ Bank of Long Islnd — 669—3600 1651 ★ Los Immortales . 86 273—5926 1653 ★ Fernandes&Sons . 83 273—3250 1654 ★ Binyan Reelty . 82 273—0440 ★ Pituach Constr . 82 273—0440 ★ Ross Realty Inc . — 231—4070 ★ Scrty SH—Strge . 83 231—4070 1657 1659 Victor Rivera . 82 273—3614 1660 Josephine Arroyo # 434—4779 Zoila Cruz # 434—1473		A	* Lil Insurance	п	231-5666
1651 ★ Los Immortales 86 273 - 5926 1653 ★ Fernandes&Sons 83 273 - 3260 1654 ★ Binyan Realty 82 273 - 0440 ★ Pituach Constr 82 273 - 0440 ★ Ross Realty Inc - 231 - 4070 ★ Scrty SH-Strge 83 231 - 4070 1657 1659 Victor Rivera 82 273 - 3614 1660 Josephine Arroyo		1650×	Bank of Long Island		669-3600
1654 * Binyan Realty		1651 * 1653 *	Los Immortales Fernandes&Sons	86	273-5926 273-3260
**Ross Realty Inc		1654*	Binyan Realty	82	273-0440
*Scrty SH-Strge		*	Ross Realty Inc		231-4070
1659 Victor Rivera 82 273-3614 1660 Josephine Arroyo 1434-4779 Zoila Cruz 434-1473		1657	Scrty SH-Strge	83 NP	231-4070
Zoila Cruz		1659	Victor Rivera	82	273-3614
	1	1000	Zoila Cruz		434-1473

Matthew Laine	J1117112		J
Matthew Laine	1468	NP	000-0073
### A Maguire Assoc	1471★Heat Mizer		968-5600
#Thermogen Syst	Matthew Laine	и и	
#Thermogen Syst	Frank A Leone	п,	666-2931
1484 Omega Pope	★Thermogen Syst	п	968-5600
1510 ★Cochrane & 666-0800	1484 Omega Pope	75	
## A McGuire Assocs	1500★Pauls		
#John Cochrane #R A McGuire Assocs #R A McGuir	J A Thorpe	74	
*R A McGuire Assocs	1510★Cochrane&Craven		
*R A McGuire Assocs	★John Cochrane		
*St Job Service Div	*R A McGuire Assoc .		
**R A McGuire Assocs	*H A McGuire Assocs		
#William Steel Ins 666-9308			
T Manganaro			
# Patrick J Moore 665-0530 1529 Mary Frances Speth 78 666-2573 1550 ★ Anchor Beachwear 665-6116 ★ Blank Drug 665-4717 ★ Blank Drug 665-4717 ★ Blank Drug Store 665-4717 1557 ★ A Carlos Cruz Atty 968-5454 Roberto Medina 77 666-2261 1560 ★ Soundview Instrumt - 666-1000 1568 ★ First Spansh Bpt Ch 665-0253 ★ First Spansh Bpts 666-9567 1569 NP 1571 Gracio Fuentes 666-8408 1572 ★ Americana Laudromt	*William Steel Ins		
#Patrick J Moore 1527 M Merced 1529 Mary Frances Speth 78 665-6293 1550 Anchor Beachwear 665-6293 1550 Anchor Beachwear 665-6293 1550 Anchor Beachwear 665-6293 1550 Anchor Beachwear 665-6116 1568 Blank Drug 665-4717 1557 A Carlos Cruz Atty 968-5454 1560 A Soundview Instrumt 968-5454 1560 A Soundview Instrumt 666-1000 1568 First Spansh Bpt Ch 665-0253 1573 A Stock Barrel Sprtg 666-9567 1569 1571 Gracio Fuentes 666-9567 1573 A Stock Barrel Sprtg 665-6002 1573 A Stock Barrel Sprtg 666-8408 1573 A Stock Barrel Sprtg 666-8408 1580 Brightshr Sir Corp 665-5279 1585 Amyries Bty Sin 666-3360 1583 P M Ilgesiadedios 665-5279 1585 Amyries Bty Sin 666-7901 1585 Myries Bty Sin 665-5279 1581 Andres Claudio 79 665-2869 1587 Acmore General Pntn 968-446 1587 Gilberto Oquendo 79 665-2869 1595 Complete Med Diagn 666-1220 1603 1603 1612 Fifth Av Car Wash 665-992 1611 Filiberto Galdamez 666-906 1612 Fifth Av Car Wash 665-097 1617 Alatropical Market 665-1005 1617 Alatropical Market 665-1005 1613 Agay Shr Ato Algnmt 666-000 1617 Alatropical Market 665-1005 1631 Agay Shr Ato Algnmt 666-000 1641 NP 1644 ELS Mfg 273-2652 1656 Market Housewrs Co 231-5353 1636 Market Housewrs Co 231-5353 1637 John Justice 76 1647 Alar Mira Tavern 273-9619 1659 Alar Munoz 273-9639 1666 Namy 1666 Namy 273-9639 1659 Alar Munoz 273-9639 1666 Namy 273-9639 1667 Antonio Irizarry 273-9639 1668 Namy 273-9639 1666 Namy 273-9639 1667 Namy 273-9639 1668 Namy 273-9639 1668 Namy 273-9639 1668 Namy 273-9639 1668 Namy 273-9639 1669 Namy 273-9639 1666 Namy 273-9639 1666 Namy 273-9639 1666 Namy 273-9639 1666 Namy 273-9639 177	1521 Fifth AV Nursry		
1527 M Merced	Manganaro	/ /	
1529 Mary Frances Speth 78 666-2573 1550★Anchor Beachwear 665-6116 ★Blank Drug 665-4717 ★Blank Drug Store 665-4717 1557★A Carlos Cruz Atty 968-5454 Roberto Medina 77 666-2261 1560★Soundview Instrumt 666-1000 1568★First Spansh Bpt Ch 665-0253 ★First Spansh Bptst 666-9567 1569 1571★Gracio Fuentes 666-8408 1572★Americana Laudromt 666-9567 1573★Stock&Barrel Sprtg 665-9658 James Osonio 666-3360 1573★Stock&Barrel Sprtg 665-57302 ★Re&J Garage Inc 666-880 1580★Brightshr Sir Corp 665-5279 ★Parkway Ready Mix 665-8794 1583 P M Ilgesiadedios 666-8880 1585★Mytries Bty Sin 665-954 1587 ★Mytries Bty Sin 665-954 1587 ★Complete Med&Diagn 665-7499 1591 Andres Claudio 79 665-2869 ★Manor General Pntn 968-8446 M Perez	*Patrick J Moore		
#Blank Drug #Blank	1520 Many Frances Coath	70	
#Blank Drug	1550+ Anchor Beachwest	/6	
#Blank Drug Store	+Blank Dave		
### ### #### #### #### ##############	+Blank Drug Store	4 * *	
*Valdas Duoba Atty Roberto Medina	1557+A Carlos Cruz Attu		
Roberto Medina	→Valdas Duoba Attu		
1560★Soundview Instrumt	Roberto Medina	77	
## First Spansh Bpts	1560 ★ Soundview Instrumt		
#First Spansh Bptst	1568+First Sposh Bot Ch		
1572 ★Americana Laudromt	★First Spansh Botet		
1572★Americana Laudromt	1569	NP	300 3001
1572★Americana Laudromt	1571 Gracio Fuentes	.141	666-8408
James Osono	1572 ★ Americana Laudromt		
1573★Stock&Barrel Sprtg	James Osono	N IN	
#Re&J Garage Inc #Re&J Garag	1573 ★ Stock&Barrel Sprtg	-	
*Re&J Garage Inc 666-8880 1580 ★ Brightshr Sir Corp 665-5279	1575 Jartran Truck Rntl	-	
1580	★Re&J Garage Inc		
** Parkway Ready Mix 665-8794 1583 P M ligesiadedios	1580 + Brightshr Sir Corp		
1583 P M Ilgesiadedios 1585★Mytries Bty Sin 1587 Gifberto Oquendo 1591 Andres Claudio 1591 Andres Claudio 1595 ★Long Island Basket 1597★Complete Med&Diagn 1603 1609 William Pacheco 1603 NP 1609 William Pacheco 1611 Filiberto Galdamez 1612★Fifth Av Car Wash 1617★Latropical Market 1617★Latropical Market 1630★Co Police Dept 3 1637 John Justice 1637 John Justice 1637 John Justice 1637 John Justice 1641 ★Rosados Auto Body 1641 ★Rosados Auto Body 1641 ★ELS Mfg Inc 1657 ★Regal Furniture Co 1658 ★Regal Furniture Co 1657 ★Regal Furniture Co 1658 ★Regal Furniture Co 1659 ★Regal Furniture Co 1659 ★Regal Furniture Co 1659 ★Regal Furniture Co 1657 Antonio Irizarry 1658 ★Regal Furniture Co 1659 ★Regal Furniture Co 1657 Antonio Irizarry 1658 ★Regal Furniture Co 1659 ★Regal F	★Parkway Ready Mix		
1585★Mytries Bty Sln	1583 P M Ilgesiadedios		
1587 Gifberto Oquendo .79 665-4791 1591 Andres Claudio .79 665-2669 ★Manor General Pntn	1585 ★ Mytries Bty Sln		
#Manor General Pntn M Perez 1595 ★Long Island Basket	1587 Gilberto Oguendo	79	665-4791
#Manor General Pntn M Perez 1595 ★Long Island Basket	1591 Andres Claudio	79	665-2869
1595	★Manor General Pntn		968-8446
1595★Long Island Basket	M Perez	н. н	665-7499
1603 1609 William Pacheco	1595★Long Island Basket	и	666-2615
## William Pacheco	1597★Complete Med&Diagn .		666-1220
South Shr Auto Prt 665-9792 1611 Filiberto Galdamez - 666-2092 **M M Rodriguez Ins 666-9090 1612Fifth Av Car Wash 665-0597 **Hubbard Snd&Grvel 665-1005 **Mark Kenedy Inc 666-4550 **Thermography	1603	.NP	
## M M Rodriguez Ins 666-2092 ## M M Rodriguez Ins 666-9060 1612★Fifth Av Car Wash 665-0597 # Hubbard Snd&Grvel 665-1005 # Mark Kenedy Inc 666-4550 # Thermography = 665-2871 1615★C&B Printing 666-0070 1617★Latropical Market 665-1248 1630★Co Police Dept 3 435-4400 1631★Bay Shr Ato Algnmt 666-7473 ## Bay Shore Co Inc 666-7473 1635 John J Justice 76 231-9233 1636★Market Housewrs Co 231-5353 1637 John Justice 76 231-9233 1636★Market Housewrs Co 231-93939 ## Rosados Auto Body 273-9718 ## Rosados Auto Body 273-9718 ## By Fifth Nerous Police 273-2652 ## By Fifth Sprtswr 273-0017 ## Pine Aire Outlet 273-2652 ## By Fifth Avenue Deli 273-0806 1653★Regal Furniture Co 231-8392 1654★Fifth Avenue Deli 273-0806 1659 ## Asa A Augies Auto Pt ## 231-5232 ## Augies Autmtv Entp 231-5232 ## Augies Autmtv Entp 231-5232 ## Augies Autmtv Entp 231-5232 ## Tenem Amoco Serv 273-9774	1609 William Pacheco	78	666-9413
★M M Rodriguez Ins 666-9060 1612★Fifth Av Car Wash 665-0597 ★Hubbard Snd&Grvel 665-0597 ★Mark Kenedy Inc 666-4500 ★Mark Kenedy Inc 666-2871 1615★C&B Printing 666-0008 ★Quanills Liquors 666-3070 1617★Latropical Market 665-1248 1630★Co Police Dept 3 435-4400 1631★Bay Shr Ato Algnmt 666-7473 ★Bay Shore Co Inc 666-7473 1635 John J Justice 76 231-9233 1636★Market Housewrs Co 231-5353 231-4789 1637 John Justice .76 231-9233 1637 John Justice .76 231-4789 1640★Rosado Auto Body 273-9718 ★Rosados Auto Body 273-9718 ★ELS Mfg 273-2652 ★B Jeffrey Sprtswr 273-0652 ★B Jeffrey Sprtswr 273-0652 ★B Jeffrey Sprtswr 273-0652 ★B Jeffrey Sprtswr 273-0852 ★Pine Aire Outlet 273-2652 ★B Jeffrey Sprtswr 273-0806 <t< td=""><td>*South Shr Auto Prt</td><td></td><td></td></t<>	*South Shr Auto Prt		
### ### ### ### ### ### ### ### ### ##			
★Hubbard Snd&Grvel 665-1005 ★Mark Kenedy Inc 666-4550 ★Thermography □ 665-2871 1615★C&B Printing 666-0008 ★G65-2871 1617★Latropical Market 665-1248 1630★Co Police Dept 3 435-4400 1631★Bay Shr Ato Algnmt 666-7473 ★Bay Shore Co Inc 666-7473 1635 John J Justice .76 1636★Market Housewrs Co 231-9233 1637 John Justice .76 1640★Rosado Auto Body 273-9718 ★Rosados Auto Body 273-9718 ★ELS Mfg 273-2652 ★B Jeffrey Sprtswr 273-2652 ★B Jeffrey Sprtswr 273-2652 ★B Jeffrey Sprtswr 273-0017 ★Pine Aire Outlet 273-2652 1647★Mar Mira Tavern 273-9639 ★Dr J C Pellin 231-4848 1649★Fifth Avenue Deli 273-9639 ★Self Storage □ 231-4970 ★Self Storage □ 231-4070 ★Self Storage □ 231-4070 ★Self Storage □ 231-5521	*M M Hodriguez ins		
* Mark Kenedy Inc	Hubbard Sadt Carel		
*Thermography			
# Guanills Liquors 666-3070 # Guanills Liquors 666-3070 # Guanills Liquors 666-3070 # Guanills Liquors 666-3070 # Gef-3070 666-3070 # Gef-3070 666-7473 # Bay Shr Ato Algnmt 666-7473 # Bay Shore Co Inc 6231-6353 # Rosados Auto Body 273-9618 # Bay Shore Co Inc 6231-6326 # Bay Jeffrey Sprtswr 273-652 # Bay Jeffrey Sprtswr 273-639 # Bay Jeffrey Sprtswr 273-639 # Bay Jeffrey Sprtswr 273-632 # Bay Jeffrey Sprtswr 273-683 # Bay Jeffrey Sprtswr 273-6774 # Bay Jeffrey Sprtswr 273-6774 # Bay Jeffrey Sprtswr 231-628 # Bay Jeffrey Sprtswr 273-6774 # Bay Jeffrey Sprtswr 231-628 # Bay Jeffrey Sprtswr 273-6774 # Bay Jeffrey Sprtswr 231-628 # Bay Jeffrey Sprtswr 273-6774 # Bay Jeffrey Sprtswr 273-6			
*** Guanills Liquors 666-3070 1617 ★ Latropical Market 665-1248 1630 ★ Co Police Dept 3 435-4400 1631 ★ Bay Shr Ato Algnmt 666-7473 ★ Bay Shore Co Inc 666-7473 1635 John J Justice			
1617★Latropical Market 1630★Co Police Dept 3 1435-4400 1631★Bay Shr Ato Algnmt			
1630★Co Police Dept 3	1617+Latropical Market		
1631★Bay Shr Ato Algnmt ★Bay Shore Co Inc. 666-7473 1635 John J Justice	1630+Co Police Dent 3		
**Bay Shore Co Inc 666-7473 1635 John J Justice 76 1636 **Market Housewrs Co 231-9233 1637 John Justice 76 1640 **Rosado Auto Body 273-9718	1631 + Bay Shr Ato Algorit		
1635 John Justice	★Bay Shore Co Inc		
1636★Market Housewrs Co 1637 John Justice76 231-5353 1637 John Justice76 231-4789 1640★Rosado Auto Body273-9718 ★Rosados Auto Body231-9009 1641	1635 John J Justice	. 76	
1637 John Justice	1636★Market Housewrs Co		
1640★Rosado Auto Body 273-9718 ★Rosados Auto Body 231-9009 1641 1644★ELS Mfg 273-2652 ★ELS Mfg Inc 273-2652 ★B Jeffrey Sprtswr 273-0017 ★Pine Aire Outlet 273-2652 1647★Mar Mira Tavern 273-9639 ★Dr J C Pellin 231-4848 1649★Fifth Avenue Deli 273-0806 1653★Regal Furniture Co 231-8392 1654★Fifth Ave Self-Stg 231-4070 ★Self Storage 231-4070 1657 Antonio Irizarry 273-5521 Chely Ruiz 273-5521 1659 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmity Entp 231-5232 772★Tenem Amoco Serv 273-9774	1637 John Justice	76	
#Rosados Auto Body	1640 ★ Rosado Auto Body		
1641 1644★ELS Mfg	*Rosados Auto Body		
★ELS Mfg Inc 273-2652 ★B Jeffrey Sprtswr 273-0017 ★Pine Aire Outlet 273-2652 1647★Mar Mira Tavern 273-9639 ★Dr J C Pellin 231-4848 1649★Fifth Avenue Deli 273-9839 1654★Fifth Avenue Deli 231-8392 1654★Fifth Ave Self-Stg 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-6070 1659 Antonio Irizarry 231-6291 1669 Hans Deli 273-9329 1663 R Munoz 231-6326 1666 NP 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmity Entp 231-5232 770 M E Dasilva 76 273-683 772★Tenem Amoco Serv 273-9774	1641	.NP	
★ELS Mfg Inc 273-2652 ★B Jeffrey Sprtswr 273-0017 ★Pine Aire Outlet 273-2652 1647★Mar Mira Tavern 273-9639 ★Dr J C Pellin 231-4848 1649★Fifth Avenue Deli 273-9839 1654★Fifth Avenue Deli 231-8392 1654★Fifth Ave Self-Stg 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 ★Self Storage 231-6070 1659 Antonio Irizarry 231-6291 1669 Hans Deli 273-9329 1663 R Munoz 231-6326 1666 NP 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmity Entp 231-5232 770 M E Dasilva 76 273-683 772★Tenem Amoco Serv 273-9774	1644★ELS Mfg	111	273-2652
★B Jeffrey Sprtswr 273-0017 ★Pine Aire Outlet 273-2652 1647★Mar Mira Tavern 273-9639 ★Dr J C Pellin 231-4848 1649★Fifth Avenue Deli 273-0806 1653★Regal Furniture Co 231-8392 1654★Fifth Ave Self-Stg 231-4070 ★Self Storage 231-4070 ★Self Storage 231-4070 Chely Ruiz 231-0296 1659 1660★Hans Deli 273-9329 1663 R Munoz 231-6326 1666 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmity Entp 231-5232 570 M E Dasilva 76 273-7683 172★Tenem Amoco Serv 273-9774	*ELS Mtg Inc		
1647★Mar Mira Tavern 273-9639 ★Dr J C Pellin 231-4848 1649★Fifth Avenue Deli 273-0806 1653★Regal Furniture Co 231-8392 1654★Fifth Ave Self-Stg 231-4070 ★Self Storage 231-4070 ★Self Antonio Irizarry 273-5521 Chely Ruiz 231-0296 1659 NP 1669★Hans Deli 273-9329 1663 R Munoz 231-6326 1666 NP 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmity Entp 231-5232 770★Tenem Amoco Sery 273-9774	★B Jeffrey Sprtswr	F 4:	273-0017
1647★Mar Mira Tavern 273-9639 ★Dr J C Pellin 231-4848 1649★Fifth Avenue Deli 273-0806 1653★Regal Furniture Co 231-8392 1654★Fifth Ave Self-Stg 231-4070 ★Self Storage 231-4070 ★Self Antonio Irizarry 273-5521 Chely Ruiz 231-0296 1659 NP 1669★Hans Deli 273-9329 1663 R Munoz 231-6326 1666 NP 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmity Entp 231-5232 770★Tenem Amoco Sery 273-9774	*Pine Aire Outlet		
1649★Fifth Avenue Deli 273-0806 1653★Regal Furniture Co 231-8392 1654★Fifth Ave Self-Stg □ 231-4070 ★Self Storage □ 231-4070 1657 Antonio Irizarry □ 273-5521 Chely Ruiz □ 231-0296 1659 NP 1660★Hans Deli 273-9329 1663 R Munoz □ 231-6326 1666 1666 NP 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmtv Entp 231-5232 570 M E Dasilva 76 273-7683 172★Tenem Amoco Serv 273-9774	1647 ★ Mar Mira Tavern		
1653 Regal Furniture Co 231-8392 1654 Fifth Ave Self-Stg □ 231-4070 ★Self Storage □ □ 231-4070 1657 Antonio Irizarry □ 273-5521 Chely Ruiz □ □ 231-0296 1659 NP 1660 Hans Deli □ 273-9329 1663 R Munoz □ □ 231-6326 1666 NP 1669 A&A Augies Auto Pt 231-5232 ★Augies Autmity Entp 231-5232 770 M E Dasilva □ 76 273-7683 772 Tenem Amoco Serv □ 273-9774	*Dr J C Pellin	* *	
1654★Fifth Ave Self-Stg	1649 Fifth Avenue Dell	* *	
1657 Antonio Irizarry	1653 Regal Furniture Co	* *	
1657 Antonio Irizarry	Self Storage	12	
Chely Ruiz 231-0296 1659	1657 Antonio Irizaro	· .H	
1659 NP 1660★Hans Dell 273-9329 1663 R Munoz 231-6326 1666 NP 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmitv Entp 231-5232 770★ E Dasilva 76 273-7683 772★Tenem Amoco Serv 273-9774	Chely Dies	0	
1660★ Hans Deli 273-9329 1663 R Munoz 231-6326 1666 NP 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmit Entp 231-5232 772★Tenem Amoco Serv 273-9774	1659	ND	521-0580
1663 R Munoz 231-6326 1666 NP 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmtv Entp 231-5232 570 M E Dasilva 76 273-7683 172★Tenem Amoco Serv 273-9774	1660+Hane Dell	- IAI	272 0220
1666 1669★A&A Augies Auto Pt 231-5232 ★Augies Autmtv Entp 231-5232 570 M E Dasilva	1663 R Munoz	4. 4	
★Augies Autmtv Entp 231-5232 570 M E Dasilva	1666	NP	231-0320
★Augies Autmtv Entp 231-5232 570 M E Dasilva	1669+A&A Augies Auto Pt	1.41	231,5222
570 M E Dasilva	+Augies Autmty Foto	* 3	
72 Tenem Amoco Serv 273-9774	570 M E Dasilya	. 76	
na NP	72★Tenem Amoco Serv		
	73		-10.0114

Target Street Cross Street Source

Cole Criss-Cross Directory

1520 1 Storm	
1529 L Storm	. 6 666-9644
1550★ Ancho Beachwear	. 🗆 665-6116
*Blank Drug	. 665-4717
*Blank Drug Store	. 665-4717
* Enterprise Adving	
1557 * Elder Homes	968-8585
1557 × Elder Homes	809-0000
Roberto Medina	
1560 * Crossly Bidg Prods .	. 666-8500
*Redco	. 666-8500
1568 * First Spnsh Bpt Ch	665-0253
*First Spansh Bptst	666-9567
1571 Gracio Fuentes	
1572 Ramon Alvarez	
*R&O Cleaners Inc	665-9658
1573 * Angotti Pimbg&Heat	
1575★Re&J Garage Inc	
* U-Haul Company	
1580★ Parkway Ready Mix.	
1581 * Caribe Restaurant	
1583 * Total Woman Bigue.	968-9574
1585 * Mytries Bty Sin	
1591 N	
1595 * Desena Industr Inc.	
* Mica Accessories	
1609 * South Shr Auto Prt	665-9792
1611 * Cophresi Travels	□ 666-3716
Maria Santiago	
1612 # Fifth Av Car Wash	665-9444
* Hubbard Snd&Grvel.	605 100E
*Kenedy Land Clearg	
* Kenedy Land Cleard	
* Subrbn Concrete Sv	273-0220
* Subrbn Concrete Sv 1615 * Boringuen Meat Ctr.	273-0220
*Subrbn Concrete Sv 1615 *Borinquen Meat Ctr. *Guanilis Liquors	273-0220 665-8871 666-3070
*Subrbn Concrete Sv 1615 *Borinquen Meat Ctr. *Guanilis Liquors	273-0220 665-8871 666-3070
★ Subrbn Concrete Sv 1615 ★ Borinquen Meat Ctr. ★ Guanills Liquors. 1617 ★ Latropical Market	273-0220 665-8871 666-3070 665-9858
* Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248
* Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 MO6-7473
* Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 MO6-7473
* Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 MO6-7473 MO6-7473
* Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 MO6-7473 MO6-7473 0 273-2462 231-5353
* Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 MO6-7473 MO6-7473 0 273-2462 231-5353
* Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 MO6-7473 MO6-7473 MO6-7473 0 273-2462 231-5353 6 231-4789
* Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 MO6-7473 MO6-7473 0 273-2462 231-5353 6 231-4789 273-9718
*Subrbn Concrete Sv 1615 *Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009
*Subrbn Concrete Sv 1615 *Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 MO6-7473 MO6-7473 MO6-7473 6 273-2462 231-5353 6 231-4789 273-9718 231-9009
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009
*Subrbn Concrete Sv 1615 *Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639
*Subrbn Concrete Sv 1615 *Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848
*Subrbn Concrete Sv 1615 *Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848
*Subrbn Concrete Sv 1615 *Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-0806
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-0806 231-4030
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-0806 231-4030 231-9737
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-5232 231-5232
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4848
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-4930 231-3429
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4930 231-4930 231-4930 231-4930 231-5232
*Subrbn Concrete Sv 1615 * Borinquen Meat Ctr.	273-0220 665-8871 666-3070 665-9858 665-1248 M06-7473 M06-7473 273-2462 231-5353 6 231-4789 273-9718 231-9009 231-4848 273-9639 231-4848 273-9639 231-4848 273-9639 231-4930 231-4930 231-4930 231-4930 231-5232

Target Street Cross Street Source

✓ - Cole Criss-Cross Directory

M0543	
1 66644	66644
MO5775	
MO5317.	M053173
	M054843
P	
P	
1 665934	EAED 233
665908	
666080	6660800
n666099 S 665232	
CO 665232	
CL 665416	6654164
п665220	
665685 #665868	
	6650530
п665388	
5 MO5633	6650530
¤665685	6656856
665454	6654540
	6654717
	6654717
G #665486	
B665468	6654688
DS 666850	
CH 665025	
п666981	
BR665801	
0 M06840	
	6859658
AT HORSEA	
666888	
666888	0888888
RY#666635	
T 666654	6666547
M059564	MO59564
T 6659168	6659674
TS#665743	
п665775	
	M052084 6663249
	6659400
H 665944	6659444
	6653813
RG 666455	
6 6651610	
	6663070
	6654204
T 665985	6659858
T 665124	6651248
	M067473
S #2319776 CO 231535	2319778
	2731884
m273907	2739076
2739711	2739718
n2314848	2314848
ON#231984	2319841
	2316492
	2730806
	2733377
P	
	2735422
	2736329
n2730951	2730951
P	
-2314110	2314116
R 273976	2739767
	2739767
n231979	2319797
ARE273976	2/39767
TSOEVER EXCEP	VER EXCEPT A

Hubbard Power & Light

1600 5th Avenue Bay Shore, NY 11706

Inquiry Number: 3812742.3

December 17, 2013

Certified Sanborn® Map Report



Certified Sanborn® Map Report

12/17/13

Site Name: Client Name:

Hubbard Power & Light
Nobis Engineering, Inc.
1600 5th Avenue
585 MIddlesex St
Bay Shore, NY 11706
Lowell, MA 01851

EDR Inquiry # 3812742.3 Contact: Adam Roy



The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by Nobis Engineering, Inc. were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: Hubbard Power & Light Address: 1600 5th Avenue Bay Shore, NY 11706

Cross Street:

P.O. # 84001

Project: Hubbard Power & Light Certification # 594B-4B47-9510

5anion)

Sanborn® Library search results Certification # 594B-4B47-9510

UNMAPPED PROPERTY

This report certifies that the complete holdings of the Sanborn Library, LLC collection have been searched based on client supplied target property information, and fire insurance maps covering the target property were not found.

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

Library of Congress

✓ University Publications of America

✓ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Nobis Engineering, Inc. (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.



WHAT IS "ALL APPROPRIATE INQUIRIES"?

"All appropriate inquiries," or AAI, is a process of evaluating a property's environmental conditions and assessing the likelihood of any contamination. Every Phase I assessment conducted with EPA Brownfields Assessment Grant funds *must* be conducted in compliance with the All Appropriate Inquiries Final Rule at 40 CFR Part 312. The All Appropriate Inquiries Final Rule provides that the ASTM E1527-05 standard is consistent with the requirements of the final rule and may be used to comply with the provisions of the rule. In addition, all appropriate inquiries must be conducted in compliance with the Final Rule or the ASTM standard to obtain certain protections from liability under the federal Comprehensive Environmental Response, Compensation and Liability Act (CERCLA, aka Superfund).

WHAT ARE THE DOCUMENTATION REQUIREMENTS FOR ALL APPROPRIATE INQUIRIES?

The final rule requires that the results of an AAI investigation be documented in a written report. The specific reporting requirements for all appropriate inquiries are provided in 40 CFR §312.21 (*Results of Inquiry by an Environmental Professional*) and §312.31 of the final rule and in §12 of ASTM E1527-05. All AAI final reports *must*, at a minimum include the following:

- 1. An *opinion* as to whether the inquiry identified conditions indicative of releases or threatened releases of hazardous substances, and as applicable, pollutants and contaminants, petroleum or petroleum products, or controlled substances, on, at, in, or to the subject property.
- 2. An identification of "significant" data gaps (as defined in §312.10 of AAI final rule and §12.7 of ASTM E1527-05), if any, in the information collected for the inquiry. Significant data gaps include missing or unattainable information that affects the ability of the environmental professional to identify conditions indicative of releases or threatened releases of hazardous substances, and as applicable, pollutants and contaminants, petroleum or petroleum products, or controlled substances, on, at, in, or to the subject property. The documentation of significant data gaps must include information regarding the significance of these data gaps.
- 3. **Qualifications and signature** of the environmental professional(s). The environmental professional must place the following statements in the document and sign the document:
 - ''[I, We] declare that, to the best of [my, our] professional knowledge and belief, [I, we] meet the definition of Environmental Professional as defined in §312.10 of this part.''
 - ''[I, We] have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. [I, We] have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.''

Note: Please use either "I" or "We."

4. In compliance with §312.31(b) of the AAI final rule and §12.6.1 of ASTM E1527-05, the environmental professional must include in the final report an *opinion regarding additional appropriate investigation*, if the environmental professional has such an opinion.

For each Phase I Environmental Site Assessment, or AAI, conducted using EPA Brownfields Grant monies, the grantee must complete, sign, date, and submit the following check list with any AAI reports submitted to EPA.

Also see U.S. EPA's website at www.epa.gov/brownfields for additional information.

Checklist for Phase I Site Assessments Conducted using EPA Brownfields Assessment Grant Funds

	Contact Information
Grantee Name: Suffok Co	ounty, New York
Grant Number: EP-W-11-	-043
ACRES Property ID:	NA
Program Manager Name:	Thomas Kelly
(Point of Contact)	
Contact Phone Number: 6	531-853-4524
Name / Address of Property	
	Shore, New York Checklist
met for the Phase I assessme An opinion as to whe releases of hazardous petroleum products, o An identification of " ASTM E1527-05), if regarding the signific unattainable informat conditions indicative applicable, pollutants	the following All Appropriate Inquiries documentation requirements were ent conducted at the above listed property: ether the inquiry has identified conditions indicative of releases or threatened a substances, and as applicable, pollutants and contaminants, petroleum or controlled substances, on, at, in, or to the subject property. "significant" data gaps (as defined in §312.10 of AAI final rule and §12.7 of any, in the information collected for the inquiry, as well as comments cance of these data gaps. Significant data gaps including missing and tion that affects the ability of the environmental professional to identify of releases or threatened releases of hazardous substances, and as and contaminants, petroleum or petroleum products, or controlled or to the subject property.
professional must pla '[I, We] declare that of Environmental Pro '[I, We] have the spe	ignature of the environmental professional(s). The environmental use the following statements in the document and sign the document: It, to the best of [my, our] professional knowledge and belief, [I, we] meet the definition of this part." Expected experience to assess a property of
appropriate inquiries Note: Please use either In compliance with §: environmental profes	ind setting of the subject property. [I, We] have developed and performed the all in conformance with the standards and practices set forth in 40 CFR Part 312." "I" or "We." 312.31(b) of the AAI final rule and §12.6.1 of ASTM E1527-05, the isional must include in the final report an opinion regarding additional attention, if the environmental professional has such an opinion.
	- 마리마스 (1986년) - 10 - 10 - 10 - 10 - 10 - 10 - 10 - 1

Lilly

Signature of Grantee Program Manager

2/28/14

Date